



Avaya Aura® Contact Center Release 7.1.0.0

Release Notes

This document contains information on software lineup, known issues and workarounds specific to this release of Avaya Aura® Contact Center.

TABLE OF CONTENTS

Purpose	3
Publication History	3
Software Information.....	4
Hardware Appliance	4
Software Appliance	4
DVD Product Installation	5
Release Pack Bundle	5
Additional Required Updates	6
Additional Optional Updates	7
Switch Software Support	9
Avaya Aura® Software	9
Avaya Communication Server 1000	10
Platform Vendor Independence (PVI)	12
Hardware Requirements	12
Recommended Network Adapter	12
Operating System & Virtualization	13
Operating System	13
Microsoft Operating System Updates	15
Internet Explorer Support	17
Microsoft .NET Framework Support.....	17
VMware	17
Deployment & Configuration Information.....	18
Pre-Installation Considerations	18
Installation.....	22
Post-Installation Configuration	26
Workspaces on Avaya Aura® Contact Center	30
Deployment.....	30
Post-Deployment Configuration.....	35
Scale.....	37
Workspaces and High Availability	37
Security Information	38
Localization	43
Overview of I18N and L10N Products & Components	43
Language specific support and configuration	44
Start Localized AAD Client	47
Troubleshooting	48

Release Notes

Known Issues.....	49
Hardware Appliance	49
Software Appliance	49
Workspaces on AACC	49
Application\Features.....	55
Localization issues	65
Appendix	66
Appendix A – Issues Addressed in this release	66
Appendix B – Additional Security Information.....	70

PURPOSE

This document contains known issues, patches and workarounds specific to this build and does not constitute a quick install guide for Contact Centre components. Please refer to the information below to identify any issues relevant to the component(s) you are installing and then refer to the Avaya Aura® Contact Center Installation and Commissioning guides for full installation instructions

PUBLICATION HISTORY

Issue	Change Summary	Author(s)	Date
1.0	Generally Available Release	CCReleaseEng	02-Jul-2019
1.1	Updated Appendix A	CCReleaseEng	23-Jul-2019

SOFTWARE INFORMATION

Hardware Appliance

There are no software downloads associated with the Hardware Appliance deployment.

Software Appliance

The following are the files required to deploy Avaya Aura® Contact Center Release 7.x into a virtualization environment. Please ensure you are using this version for all new software installation.

Avaya Aura Media Server OVA

File Name	MD5 Checksum
MediaServer_8.0.0.169_A6_2018.10.24_OVF10.ova	eda4b84b51ab9447d78755a3e2d31af8

Avaya WebLM OVA

The Avaya WebLM 8 OVA is the required software when deploying the OVA in a virtualisation environment. This software is used for product licensing. Please download this software from <http://support.avaya.com>

File Name
WebLM-8.0.0.0.9-31370-e65-14.ova

Workspaces Cluster

The Avaya Aura® Contact Center Workspaces OVA is required when deploying the workspaces cluster in a virtualization environment. The software provides the base image and software for the deployment of the Avaya Aura® Contact Center Workspaces Cluster.

File Name	MD5 Checksum
ACC_WORKSPACES_OVA_BASEIMAGE-1561059978.ova	7401d2ea284cdd0420c4c1ff76ed8d7f

DVD Product Installation

The following are the files required when deploying Avaya Aura® Contact Center using the Avaya Aura® Contact Center DVD. Please note, as part of the deployment of the product you are required to install the latest available service pack bundle when installing the product.

The supported Avaya Aura® Contact Center DVD version is outlined below. Please ensure you are using this version for all new software installation.

File Name	MD5 Checksum
AACC_7.1.0.0-78.iso	ea45bc2f4e0ab3e2c9da393321cf2dde

Important Note:

Information on the latest feature packs available with this release is documented in the **Release Pack Bundle** section below.

Release Pack Bundle

The Avaya Aura® Contact Center software is delivered to customers as a release pack bundle. The release pack is installed on your base software and contains the latest software updates for the release.

File Name	MD5 Checksum
ACC_7.1.0.0_449.zip	7582816efce31e9a24bf8497e68eb00c

Additional Required Updates

Avaya Aura® Contact Center Server

The following are additional Avaya Aura® Contact Center updates containing critical fixes that **must** be applied to your system.

File Name	MD5 Checksum
ACC_7.1.0.0_FeaturePack00ServicePack00_GA_Patches-9.zip	01a5a6d7d39864b7592d20fdc08e63ff

You must download all files listed. Please verify the MD5 checksums after download to ensure all files have been downloaded successfully.

Avaya Contact Center Select Workspaces Cluster

The following updates contain critical fixes that must be applied to your Workspaces Cluster

File Name	MD5 Checksum
CC_7.1.0.0_DockerMove_Script_v2.zip	83cb5721aebfd10eb2e83abc0de0bcc7
CC_7.1.0.0_CoreDNS_Script_v3.zip	dce94c9124f13d07554e09f6dc91893d
CC_7.1.0.0_istiocmd.zip	1d73339d32afaef00f25d415ca146c74

Avaya Aura Media Server OVA and Hyper-V Upgrade

The AAMS OVA version is: 8.0.0.169. Both need to be upgraded to the latest version. The Media Server needs to be updated to 8.0.0.205 and the System layer needs to be updated to 16. This is accomplished by downloading the two ISO files:

MediaServer_Update_8.0.0.205_2019.04.29.iso

MediaServer_System_Update_8.0.0.16_2019.04.05.iso

This procedure is detailed in document: "Upgrading and patching Avaya Aura® Contact Center"

File Name	MD5 Checksum
MediaServer_Update_8.0.0.205_2019.04.29.iso	32ff99844e1d40d3c9f0d9341307f829
MediaServer_System_Update_8.0.0.16_2019.04.05.iso	5bd8c1d0ada215088b03571350185924

Additional Optional Updates

ASG Plugin

The ASG Plugin is a serviceability application which enables secure access to the server when installed using a challenge-response mechanism. This update removes the presence of unnecessary accounts which are given permission to access the files in the applications directory. This effectively restricts access to the applications files to administrator users only.

The ASG Plugin currently placed on the server, not installed, does not have this patch and if required this version can be downloaded and placed on the server instead of the incumbent version.

This is optional in that only if you wish to install and use this plugin should it be installed; otherwise it is not required for normal Contact Center operations.

File Name	MD5 Checksum
ASGPlugin4WindowsX64.zip	76aaa6844a4863a86884d19a0b409558

SNMP Trap Configuration File

An SNMP Trap Configuration File (.cnf) is delivered containing the Avaya recommended events for SNMP capture. The configuration file can be imported into the SNMP Event Translator that is available after installing SNMP on the Windows Server. SNMP traps will be automatically generated and forwarded to the configured NMS system for all Event Viewer events that have a match in the configuration file.

The SNMP Trap Configuration File can be imported into the SNMP Event Translator using evntcmd.exe from the command prompt. A restart of the SNMP service is required after which the file content can be viewed using the SNMP Event Translator GUI (evntwin.exe). Exact details for the procedure are available in Windows Server 2012 R2 and Windows Server 2016 documentation.

The SNMP Trap Configuration File is available for download from the support site.

This is optional in that it should only be imported if you wish to forward SNMP traps to an NMS system for treatment or monitoring. Otherwise it is not required for normal Contact Center operations.

Note: As detailed in the AACC deployment guide, SNMP should be installed on the Windows Server prior to deployment of the AACC application.

File Name	MD5 Checksum
ACC_7_1_SNMP_Trap_File_ver1_0.cnf	08a97caf629637aa7f9b4d9cd31beb8e

Patch Scanner

This Patch Scanner utility is released with every Release Pack and Patch bundle from ACCS 6.4 SP13 onwards. If you are moving from an Avaya Aura Contact Center 6.4 lineup to Avaya Contact Center Select 7.x you must use the version of the Patch Scanner published in the 7.x Release Notes document.

This version of the tool can be used prior to moving to Avaya Contact Center Select 7.x. See readme with the application zip file for further information.

File Name	MD5 Checksum
N/A	N/A

Migration Tool for RCW Generated Reports

This application is required when exporting Historical Reporting templates on an NES6/NES7/ACC 6.x server as part of a server migration. The most up to date version of the application is available with the “additional required updates” from the AACC lineup below.

The utility is available in: **Install Software\CCMA\RCW_Migration_Utility**

SWITCH SOFTWARE SUPPORT

Avaya Aura® Software

This section outlines the software requirements for the Avaya Aura® communications infrastructure. Avaya Aura® Contact Center supports minimum versions of the following Avaya Aura® components:

Avaya Aura Components	Release
Avaya Aura System Platform	7.x, 8.x
Avaya Aura Communication Manager	7.x, 8.x
Avaya Aura Application Enablement Services	7.x, 8.x
Avaya Aura System Manager	7.x, 8.x
Avaya Aura Session Manager	7.x, 8.x
Avaya Aura Presence Services	7.x, 8.x

Please note that Avaya Aura 6.4 FP2 is not supported with AACC 7.1. Aura stack must be upgraded to a minimum of version 7.0.1 to align with AACC 7.1.

Avaya Communication Server 1000

This section outlines the software requirements for the Avaya Communication Server 1000 infrastructure.

Avaya Aura® Contact Center 7.1.0.0 is only supported with CS 1000 R7.6.

Required Packages

The following are the required CS1000 packages

Application	Packages
Converged Office	77, 153, 164, 242, 243, 324 41, 42, 43, 50, 114, 155, 214 215, 218, 247, 311, 324
SIP CTI	77, 153, 164, 242, 243, 324 41, 42, 43, 50, 114, 155, 214, 215, 218, 247, 311, 324
2000 CDNs	388, 411

DepList for CS 1000 R7.6

DepList Patch	PI PEP Enabler	Comments
MPLR33345		CS1000 doesn't send AML/MLS Transfer Complete message when POM Dialler completes an external transfer MPLR33345 – GEN PEP – included in R7.6 SP6 and higher.
MPLR33041	MPLR32229	Multimedia contact cannot return to queue while agent is holding a CDN call. Package 411 prevents agent acquired by AACC from going NOT_READY without dropping the active call. MPLR32229 – Free of charge PI PEP for AACC MPLR33041 – GEN PEP – included in R7.6 SP5 and higher.
MPLR32413	MPLR30038	New constant required when CCMS pulls call from interruptible IVR & presents to agent. Free of charge PI PEP for AACC. MPLR32413 – GEN PEP – included in R7.6 SP5 and higher.
MPLR33045 (CPPM, CPPL) MPLR33072 (CPP4)	MPLR28837	CS1000 – Different CLID on CCT desktop and acquired phone when DAPC feature is used. MPLR28837 –Chargeable PI PEP for AACC MPLR33045, MPLR33072 – GEN PEP – included in R7.6 SP5 and higher.
MPLR32439		AACC USM Ringing event is missing if the call goes back to SCR of the original agent /RGNA feature. Only required if agent configured for RGNA, and only applicable for AACC-SIP (not AACC-AML). GEN patch for AACC – included in R7.6 SP5 and higher.
MPLR33744		CTI cannot control CDN call after making emergency and supervisor calls. MPLR33744: GEN PEP – included in R7.6 SP6 and higher

NOTE: Channel Partners will need to follow the standard PI Request process (per **Communication Server 1000 Product Improvement by PEP (Patch) Policy**). These patches will be available at no charge on approval to support this configuration.

Note that Unified Communication products (CS1000, CM, AES etc.) and other products in your solution follow independent lifecycle dates. Depending on their lifecycle state, full support may not be available on older versions of these products. In case where AACC patches require a dependent patch on the switch, that patch may not be available on an old switch release that is in End of Manufacture Support lifecycle state. Please refer to lifecycle bulletins specific to the products/versions in your solution.

NOTE: The PI PEP enabler is required, **ONLY** if the customer already had that functionality on an earlier release or if the customer now wants to add that functionality. Please review CS1000 patch information on ESPL to determine if any of the noted PI PEPs are applicable for your customer environment; note that some are chargeable and require an order (and PO) on Avaya before they can be provided. More information on CS1000 PI PEPs is available on ESPL @ <https://downloads.avaya.com/css/P8/documents/100166145>

PLATFORM VENDOR INDEPENDENCE (PVI)

Hardware Requirements

For Single Server deployments of, Voice and Multimedia with Avaya Media Server with/without Workspaces on a physical platform, a Gigabit Network Adapter is required that supports Receive Side Scaling (RSS) with 4 RSS queues.

Single Server deployments of, Voice and Multimedia with Avaya Media Server with/without Workspaces, are supported on physical mid-range to high-end servers only, as defined in Avaya Aura Contact Center Overview and Specification document. Lab and customer deployments must adhere to the minimum RAM requirements. Failure to do so can result in Avaya Aura Media Server being unable to launch.

Single Server deployments of, Voice and Multimedia with Avaya Aura Media Server, now deploy AAMS as a Hyper-V Linux virtual machine. Workspaces is also deployed as a Hyper-V Linux solution. A hardware requirement is that CPU Virtualization / Virtualization Technology is enabled in the host Windows Server BIOS. The available virtualization settings vary by hardware provider and BIOS version. Read your hardware provider's documents covering virtualization support to determine which settings to configure. This is commonly found in BIOS *System Settings* -> *Processor settings*.

Refer to document *AACC Overview and Specification* for additional information on Hardware requirements.

Recommended Network Adapter

The following RSS capable Gigabit Network adapter has been tested successfully with Single Server deployments – **Intel(R) Gigabit 4P I350-t Adapter**

OPERATING SYSTEM & VIRTUALIZATION

Operating System

All Avaya Aura® Contact Center server applications are supported on the following operating systems:

- Windows Server 2012 R2 Standard (64-bit Edition)
- Windows Server 2012 R2 Data Center (64-bit Edition)
- Windows Server 2016 Standard with Desktop Experience
- Windows Server 2016 Standard Datacenter (64-bit Edition)

This release no longer supports the Avaya Aura Media Server (AAMS) installed co-resident with AACC on a Windows Server platform. A single box solution where AACC and AAMS are running on the same physical server is achieved by deploying the AAMS OVA as a virtual server on the Windows Server with Hyper-V manager. This is applied in both fresh installations and upgrades.

AAMS is supported on Red Hat Enterprise Linux (RHEL) 7.x 64-bit OS. It is not supported 32-bit RHEL. It is not supported on any other version of Linux.

Microsoft Windows Server Updates

Before deploying any new Windows Security Patches and Hotfixes – you must confirm that any Windows patches are listed as supported in the Avaya Contact Center Select Security Hotfixes and Compatibility listing – published every month on support.avaya.com.

Ensure that you do not enable Automatic Updates on your Avaya Contact Center Select Server or Client PCs. All Windows Security patches and hotfixes must be manually deployed after consulting the supported Avaya Contact Center Select Security Hotfixes and Compatibility listing.

Windows Server 2012 R2

Currently, please do not install **KB4340558** (specifically sub component **KB4338419**) or **KB4340006** (specifically sub component **KB4338605**) on your Avaya Contact Center Select Server. Refer to Avaya Aura® Contact Center Security Hotfixes and Compatibility listing for updates relating to **KB4340558** or **KB4340006**.

Additionally, install all required Microsoft Operating System update listed in the section of this document.

Windows Server 2016 with Desktop Experience

Please apply all available Microsoft hotfixes as per the Avaya Contact Center Select Security Hotfixes and Compatibility listing

Red Hat Enterprise Linux Updates

AAMS is only supported on Red Hat Enterprise Linux (RHEL) 7.x 64-bit servers.

For an AAMS installed on a customer installed RHEL 7.x 64-bit server, it is mandatory to register the RHEL OS with Red Hat Networks (RHN) and to apply all of the latest updates. AAMS is tested regularly against all the latest RHEL updates.

The AAMS VMWare OVA and Hyper-V installations ship with the all the most recent RHEL security updates as of GA. Avaya supplies RHEL updates as an AAMS System Update ISO file that is uploaded and applied using AAMS Element Manager. AAMS System updates are released as part of a Service Pack release. The OVA or Hyper-V AAMS do not need to register with Red Hat Networks.

CentOS Linux Updates

The Workspaces VMWare OVA and Hyper-V installations ship with the all the most recent CentOS security updates as of GA.

Before conducting a yum update of any new CentOS packages you must confirm whether any CentOS package updates are excluded, and not to be installed, by checking the Avaya Aura® Contact Center Security Hotfixes and Compatibility listing – published every month on support.avaya.com.

Microsoft Operating System Updates

The section outlines additional Microsoft Updates that must be applied to your system. Click on the link below to bring you directly to the KB article on the update.

Windows Server 2012 R2

Update ID	Summary
KB3100956	You may experience slow logon when services are in start-pending state in Windows Server 2012 R2

Important Notes:

1. **Important** If you install a language pack after you install this update, you must reinstall this update. Therefore, we recommend that you install any language packs that you need before you install this update. For more information, see [Add language packs to Windows](#).

Update ID	Summary
KB2973337	SHA512 is disabled in Windows when you use TLS 1.2

Important Notes:

1. This KB is contained in the August 2014 update rollup **KB2975719** listed below and does not need to be installed individually if the rollup is applied.
2. **Important** Do not install a language pack after you install this update. If you do, the language-specific changes in the update will not be applied, and you will have to reinstall the update. For more information, see [Add language packs to Windows](#).

Update ID	Summary
KB2975719	August 2014 update rollup for Windows RT 8.1, Windows 8.1, and Windows Server 2012 R2

Important Notes:

1. **Important** When you install this update (2975719) from Windows Update, updates 2990532, 2979582, 2993100, 2993651, and 2995004 are included in the installation.

Update ID	Summary
KB3101694	"0x000000D1" Stop error in Pacer.sys when there's heavy QoS traffic in Windows Server 2012 R2

Important Notes:

1. **Important** If you install a language pack after you install this hotfix, you must reinstall this hotfix. Therefore, we recommend that you install any language packs that you need before you install this hotfix. For more information, see [Add language packs to Windows](#).
2. **Important** This KB should only be applied to servers which include Avaya Aura Media Server on Windows Server 2012 R2, i.e. where AACCC and AAMS have been installed co-resident on a single physical server. It is not required on any deployment which does not include Avaya Aura Media Server on Windows Server 2012 R2.

Update ID	Summary
-----------	---------

[KB3140245](#)

Update to enable TLS 1.1 and TLS 1.2 as a default secure protocols in WinHTTP in Windows

Important Notes:

1. **Important** This hotfix is required for windows 7 SP1 clients. Do not apply to AACC server.
2. **Important** Please read the Microsoft update at the link provided, as there are manual steps required with this hotfix.
3. **Important** This update is **NOT** required if Security Manager on AACC server is has Current TLS Protocol Level for CCMA-MM set to TLSv1.0.

Update ID

Summary

[KB3100956](#)

Remote desktop connection logins and local console logins can fail with a “please wait” message if some AACC services do not complete startup.

Windows Server 2016 with Desktop Experience

Install the latest updates available as per the recommendations in the Avaya Contact Center Select Security Hotfixes and Compatibility listing.

Internet Explorer Support

Element Manager and CCMA require that Internet Explorer 10.0 and Internet Explorer 11.0 be configured to run the web sites in “Compatibility Mode”.

Microsoft support indicates that some websites might not display correctly in Windows Internet Explorer 9. For example, portions of a webpage might be missing, information in a table might be in the wrong locations, or colors and text might be incorrect. Some webpages might not display at all. If a portion of the webpage doesn't display correctly, try one or more of the following procedures:

Note: IE Compatibility Mode must be enabled on IE 10.0 and IE 11.0.

To turn on Compatibility View

1. Open Internet Explorer by clicking the Start button
2. In the search box, type Internet Explorer, and then, in the list of results, click Internet Explorer
3. From the *Tools* menu select the *Compatibility View settings* option and add the relevant website address to the list of websites

The supported browser is Microsoft Internet Explorer 10.0 or later (32 Bit only – 64 Bit not supported).

NOTE: If Avaya Agent Desktop (AAD) is used on a client desktop then individual websites for CCMA and Element Manager should be added to compatibility view. The “Display all websites in Compatibility View” setting in IE should not be used on these clients.

The Avaya Agent Desktop (AAD) embedded browser defaults to IE 10 on clients with IE 10.0 or later.

Microsoft .NET Framework Support

Avaya Aura® Contact Center 7.1.0.0 is not dependent on a specific version of Microsoft .NET Framework. This release supports Microsoft .NET Framework 4.6.2 through 4.7.x

VMware

Avaya Aura® Contact Center 7.1.0.0 supports VMware vSphere 6.5 and 6.7

ESXi/vCenter 6.5 Limitations

Deploying OVA's to an ESXi 6.5 host using the desktop vSphere Client is not supported by VMware and the vSphere Web Client or Host Client must be used instead. It is recommended that you use vSphere Web Client (<https://FQDN-or-IP-Address-of-VC/vsphere-client>) when deploying new OVA's since there are known issues with the Host Client (<https://FQDN-or-IP-Address-of-ESXi-host/UI>).

The following issues exist when using the Host Client to deploy OVA:

- During deployment you are not prompted to select a profile. To work around this, you will need to manually edit the VM Virtual Hardware settings before powering the VM on.
- Properties specified when deploying OVA are ignored and they must be re-entered during the first boot process. Drop-down lists are not provided, and property defaults are not populated.

DEPLOYMENT & CONFIGURATION INFORMATION

Pre-Installation Considerations

Tools for extracting software

It is advised that you utilize the latest versions of your preferred tools for unpacking the Avaya Aura® Contact Center software.

Important - Default Out-of-Box Certificate Removal

Removal of Default Out-of-box Certificates

Default out-of-box certificates will be removed during the installation of the Contact Center 7.1.0.0 Release. Custom certificates **must** be applied to your system before upgrade begins, or after upgrade completion, using the Security Manager application.

Failure to create custom security certificates prior or during the upgrade to 7.1.0.0 will result in the loss of functionality, specifically the SIP-CTI link to AES on Avaya Aura Contact Center.

As well as the loss of functionality any previously secure connections will now not be secure until custom security certificates are put in place.

Removal of default certificates from the Contact Center server will result in additional configuration on other services that make up the solution, such as AES, as they will have to be setup to accept the new custom certificates.

Disable Windows Automatic Maintenance

Windows Server 2012 R2

Windows Server 2012 R2 provides a centralized mechanism for maintaining the operating system. This feature is called Automatic Maintenance and is used to carry out tasks such as hard disk defragmentation and application of Microsoft Windows updates among others.

This mechanism can sometimes interfere with the deployment of Contact Center software, resulting in failed installations. It is recommended that this feature be disabled for the duration of Contact Center software installs.

To disable Automatic Maintenance:

1. Start – Run ‘Taskschd.msc’
2. In the Task Scheduler Library browse to Microsoft – Windows – TaskScheduler
3. Select the *Idle Maintenance* task, right-click and choose ‘Disable’
4. Select the *Regular Maintenance* task, right-click and choose ‘Disable’
5. Alternatively, modify the properties of the *Regular Maintenance* task and ensure it is not set to run during your installation maintenance window.

After installation is complete you may re-enable Automatic Maintenance

To enable Automatic Maintenance:

1. Start – Run ‘Taskschd.msc’

2. In the Task Scheduler Library browse to Microsoft – Windows – TaskScheduler
3. Select the *Idle Maintenance* task, right-click and choose 'Enable'
4. Select the *Regular Maintenance* task, right-click and choose 'Disable'

Disable Windows Updates

Windows Server 2012 R2

The download and installation of Windows Updates, during the installation and configuration of Contact Center software, can severely impact the fresh install and upgrade processes. Microsoft Updates must be disabled before the Contact Center installation and configuration phase, however only after all applicable windows updates have been applied.

To disable Microsoft Updates:

1. Launch the *Windows Control Panel*
2. Click *System and Security*
3. Click *Windows Update*
4. Click *Change settings*
5. In the available drop down, choose the option to *Never check for updates (not recommended)*

Windows Server 2016 with Desktop Experience

The download and installation of Windows Updates, during the installation and configuration of Contact Center software, can severely impact the fresh install and upgrade processes. Microsoft Updates must be disabled before the Contact Center installation and configuration phase, however only after all applicable windows updates have been applied.

To disable Microsoft Updates:

1. Start – Run *gpedit.msc*
2. Browse to Computer Configuration \ Administrative Updates \ Windows Components \ Windows Update
3. Locate the *Configure Automatic Updates* setting
4. Note the current setting so that it can be reverted to later
5. Double-click on *Configure Automatic Updates* and select the *Disabled* radio button option
6. Click Apply
7. Click OK
8. Exit *gpedit.msc*

After installation and configuration of Contact Center software is complete, you may revert this setting to its original value.

PEM certificates with DIW

PEM certificates do not work with DIW. PEM certs must be renamed as .CER for adding to DIW.

Changes to Universal Networking in AACC 7.x

The new 10.1 version of Gigaspaces deployed with AACC 7.x is not compatible with the version deployed in AACC 6.x. This impacts the Universal Networking feature (UNE). It will not function between AACC 7.x and AACC 6.x without the deployment of a UNE alignment patch on 6.x which adds UNE Web Services.

Before adding AACC 7.x to an existing AACC 6.x network or upgrading a networked deployment to AACC 7.x, the network must first be upgraded with the UNE alignment patch using the following steps:

- If customer are on AACC 6.4 SP14 or earlier they need to contact Avaya Support to request an alignment patch
- For customers on AACC 6.4 SP15
 1. Install the UNE alignment patch on each 6.x node. Patch name is AvayaAura_CCCC_6.4.215.208
 2. Proceed with adding or upgrading AACC 7.x nodes as required.
- For customer on AACC 6.4 SP16 no additional steps are required.

Migrating Report Creation Wizard Reports from pre AACC 6.4 SP15 Systems

The migration procedure for Report Creation Wizard based reports on an AACC system requires that the server hosting CCMA be at the AACC 6.4 SP14, SP15 or SP16 patch level prior to the report export step. The MigrationRPTToRCWX.exe utility has a dependency on the version of Crystal Reports and is only compatible with the version on the AACC 6.4 SP14, SP15 or SP16 lineup.

Hot Patching Support

Hot Patching is **NOT** supported to Avaya Aura® Contact Center Release 7.1.0.0

POM Support

AACC 7.1.0.0 supports POM 3.1 or later. No prior version of POM is supported with AACC 7.1.0.0. If AACC site is operating with POM then site **must upgrade to POM 3.1 or later before upgrading to AACC 7.1.0.0.**

Note: POM 3.1 requires Experience Portal (EP) 7.2.x.

Voice & Multimedia Contact Server with Avaya Aura Media Server

Avaya Aura® Contact Center no longer supports the Avaya Aura Media Server (AAMS) installed co-resident with AACC on a Windows Server platform. This release achieves a single box solution where AACC and AMS are running on the same physical server by deploying the AAMS OVA as a virtual server on the Windows Server 2012 and 2016 Hyper-V Manager. This is applied in both fresh installations and upgrades scenarios.

Hardware considerations:

- CPU Virtualization / Virtualization Technology must be enabled in the host Windows Server BIOS. The available virtualization settings vary by hardware provider and BIOS version. Read your hardware provider's documents covering virtualization support to determine which settings to configure. This is commonly found in BIOS System Settings -> Processor settings
- The Hyper-V deployment of Linux AAMS 8.0 is only supported on physical mid-range to high-end servers as defined in Avaya Aura Contact Center Overview and Specification document. Lab & site deployments must adhere to the minimum RAM requirements

Software considerations:

- As in previous releases, you cannot deploy a Voice and Multimedia Contact Server with AAMS in a virtual environment. This will be blocked by the Universal Installer and Avaya Release Pack Installer applications
- The AAMS should be upgraded or patched following the AAMS procedures for virtual deployments as outlined in product documentation. Once deployed and configured the co-resident Linux based AAMS Hyper-V image will not be upgraded or downgraded using the Avaya Release Pack Installer.

Orchestration Designer Scripts

Before upgrading you must ensure that all scripts are validated and compile successfully in Orchestration Designer.

Removing Reserved Skillset Prefixes

Before upgrading you must ensure that none of your created skillsets are using prefixes reserved by AACC. The list of reserved prefixes are EM_, PO_, OB_, WC_, SN_, SM_, IM_ and VM_. If you are using any of these you need to rename them before upgrading.

Installation

New Installations

Install-time Patching

Install-time patching is mandatory for Avaya Aura Contact Center software deployments using the provided DVD media.

Mandatory Execution of Ignition Wizard – Patch Deployments

After deployment of the AACC software using the DVD installer, if the Ignition Wizard process is deferred, it will not be possible to install Patches (DPs) either via Update Manager or manually (double-clicking on the installer file). Successful execution of the Ignition Wizard prior to applying Patches to the system is **mandatory**.

This does **not** affect the removal or reinstallation of AACC Service Packs, only AACC Patches (DPs).

System Backup after Ignition (IMPORTANT)

A full AACC backup must be taken after the ignition process has completed and before the system is commissioned or used.

This is important for systems that will be used as migration targets. The CCMA data can only be migrated to a system that does not contain any customer data. The CCMA migration will fail if the system is found to contain data other than what was injected by the Ignition Wizard.

If the CCMA migration fails in this way, the solution is to go back to the post-ignition backup or re-install the system.

Upgrades

Direct upgrades from 7.0.0.0 and 7.0.0.1 to 7.1.0.0 are not supported. You must first upgrade to 7.0.1.x before upgrading to 7.1.0.0.

Encrypted databases must be un-encrypted before performing the upgrade. Encrypted databases are unencrypted using Security Manager.

Avaya Release Pack Installer

A new application is provided within the Avaya Aura® Contact Center Release Pack bundle called the Avaya Release Pack Installer (ARPI). This application provides an automated method of updating existing Avaya Aura® Contact Center 7.x software and must be used when upgrading to this software release.

The application will perform the following actions

1. remove all installed AACC 7.0.x.x Product Updates (Feature Pack/ Service Packs and Patches)
2. remove all unwanted AACC Third Party software
3. install required Third Party Software for the release
4. install the latest AACC software from within the release pack bundle

Application Location:

The Avaya Release Pack Installer is contained within the Release Pack bundle in folder 'AvayaReleasePackInstaller'. The application supports the installation of Generally Available Patch bundle content. Please note, the Avaya Release Pack Installer is run via the setup.exe and NOT the AvayaReleasePackInstaller.exe.

Reboot Prompts

Before running the Avaya Release Pack Installer application, if the operating system or other installed software display prompts for a reboot, please reboot your system.

If additional reboots are required during execution of the Avaya Release Pack Installer application, a prompt will be displayed to the user.

All reboot prompts should be actioned – failure to reboot when requested will adversely affect the installation of software.

Limited Patch Installation

The Avaya Release Pack Installer application does not support the installation of limited patches. To deploy limited patches the Update Manager application must be used.

Note: It is not possible to install Generally Available patch (DP) content until the Ignition Wizard has been run successfully.

Update Configurator

A new application is provided within the Avaya Aura® Contact Center Release Pack bundle called the Update Configurator. This application is applicable provides an automated mechanism to deploy and configure the Linux Hyper-V AAMS upgrade and the Avaya Aura® Contact Center Workspaces Cluster. This application will launch automatically after the Avaya Release Pack Installer reboot has completed.

Downgrades

Important: Direct downgrades from 7.1.0.0 to 7.0.0.0 or 7.0.0.1 are not supported. You must downgrade from 7.1.0.0 to 7.0.1.x first, before downgrading to 7.0.0.x

Avaya Release Pack Installer

To downgrade to an earlier 7.0.3.x, 7.0.2.x or 7.0.1.x release, you must use the Avaya Release Pack Installer which accompanies that target release.

E.g. if the downgrade target is release 7.0.1.1, you must download the complete 7.0.1.1 release bundle from the support site.

Instructions:

Refer to the Release Notes for the target Release for downgrade instructions.

High Availability Maintenance Utility

Following a downgrade certain High Availability and Configuration information is lost. It is therefore necessary to run the High Availability Maintenance Utility to restore this information.

This utility should be run after ARPI has been run for the downgrade, but before the Server has been rebooted.

Application Location:

The High Availability Maintenance Utility is installed with this release of the software and can be found in the following location:

D:\Avaya\Contact Center\Common Components\HighAvailabilityMaintenance\HAMaintenance.exe

Instructions:

1. Launch the HAMaintenance.exe from the above location.
2. Use the Browse button to select the correct file to import.
 - a. The correct file will be in the D:\Avaya\Cache\Cachesys folder and will be named SYSDataExport-YYYY-MM-DD-tttt.xml where “YYYY-MM-DD-tttt” are a date/time stamp of when the file was created.
 - b. If there are multiple files with this naming format then the newest one should be selected.
3. Once a file has been selected, click the Import button.
4. Progress will be indicated on the screen and a message box will be presented to the user when the import has completed. The Import should take no longer than 5 minutes.

Avaya Aura Media Server

For co-resident Voice and Multimedia Contact Center with AAMS it is not possible to downgrade the Linux Hyper-V AAMS once it has been deployed and configured. The newly upgraded Hyper-V AAMS 8.0 can be maintained and is supported with AACCC 7.0.2 onwards.

Post-Installation Configuration

Avaya Aura Media Server

Avaya Aura Media Server Configuration

The following configuration must be carried out on all AAMS servers (PVI Linux, VMWare OVA and Hyper-V).

1. Launch AAMS Element Manager and browse to **System Configuration >> Network Settings >> General Settings >> Connection Security**
2. Un-tick **"Verify Host Name"** setting and hit the **"Save"** button followed by **"Confirm"**.
3. If using TLS SRTP media security then skip to step 6.
4. Browse to: **System Configuration >> Media Processing>>Media Security**
5. Change **Security Policy** from **BEST EFFORT** to **SECURITY DISABLED** and hit the **"Save"** button.
6. Browse to **System Configuration >> Network Settings >> General Settings >> SOAP**
7. Add AACC IP Address into **SOAP Trusted Nodes**. If HA, add AACC Active, Standby and Managed IP Address.
8. Hit the **"Save"** button followed by **"Confirm"**
9. Browse to **System Configuration >> Signalling Protocols >> SIP >> Nodes and Routes**
10. Add AACC IP Address into **SIP Trusted Nodes**. If HA, add AACC Active, Standby and Managed IP Address.
11. Ensure that AAMS can resolve both the hostname and Fully Qualified Domain Name (FQDN) of the CCMA server by pinging the CCMA hostname and FQDN from the AAMS.
 - Name resolution can be achieved either by using a DNS server or editing the hosts file on the AAMS.
 - The AAMS OVA and Hyper-V deployments do not allow root ssh access, so the ability to edit the hosts file is provided in Element Manager:
 - On EM navigate to **System Configuration > Network Settings > Name Resolution** and enter the hostname and FQDN name resolution of the CCMA server.
 - On PVI AAMS running on customer supplied Red Hat servers, EM does not provide Name Resolution functionality. Host and FQDN resolution need to be added to **/etc/hosts** file on Red Hat server.

Avaya Aura Media Server - Upgrade - License

If the AAMS Element Manager -> Element Status is displaying **"Media Server instance is not licensed"** then the following configuration steps must be carried out to update the AAMS license:

1. On AACC launch SCMU and navigate to LM tab
2. Shut down License Manager
3. Start License Manager

Avaya Aura Media Server - Upgrade - Service Status

If the AAMS Element Manager -> Element Status -> Service Status is displaying **Stopped** state, and it is not possible to Start AAMS via Element Manager then the following configuration steps must be carried out to update the Service Status:

1. Open an SSH session to the AAMS e.g. using putty
2. Login with cust and <custpw> entered during configuration.
3. At the prompt enter 'reboot' and 'y' to confirm
4. Allow time for the AAMS to restart and verify the state is Started in Element Manager -> Element Status -> Service Status

PVI AAMS Installed on Red Hat Enterprise Linux Servers

The following configuration must be carried out on all servers with AAMS installed on Red Hat Enterprise Linux Servers. Note: This configuration is **not** required for the AAMS OVA or Hyper-V.

1. Install firewall (iptables) policy file and enable firewall
2. Create AAMS Element Manager User account Group: **susers** Account: **cust**
3. Configure and enable Network Time Protocol (NTP)

A RHEL shell script has been provided on the AACC DVD that applies all of the above configuration steps.

The script name is **sysconfig.sh** and is located at: **Install Software\AMS\Linux**

Run the following steps on PVI RHEL Installed AAMS servers (Not required for co-resident Windows or OVA)

1. Copy the following file from the AACC DVD to the /tmp directory on the AAMS server:
Install Software\AMS\Linux\sysconfig.sh
2. Log onto the AAMS server command line with root privileges (e.g. using putty), execute the following commands and then follow the prompts:

```
cd /tmp
chmod +x sysconfig.sh
./sysconfig.sh
```

Agent Greeting Recorder commissioning when CCMA managing Multiple CCMS Servers

In AACC 7.x, the Agent Greeting recorder application is always installed on the AACC Tomcat server that is co-resident with CCMS. By default, it will assume that CCMA is also installed on the same host. In cases where the CCMA instance managing CCMS is hosted elsewhere, the Agent Greeting recorder needs to be made aware of the remote CCMA address in order to operate correctly.

There is no GUI mechanism for updating this Agent Greeting recorder configuration. To set the CCMA address, edit the following file and update the **ccma.address** entry from its default value of 127.0.0.1 to the appropriate IP address:

```
D:\Avaya\Contact Center\apache-tomcat\conf\agentgreeting.properties
```

EWC – Server name change procedure: Steps when removing CCMM patches

This section is only applicable to systems running Enterprise Web Chat (EWC). EWC is a licensed feature introduced in AACC 7.0 offering an alternative to the traditionally available Web Communications. EWC uses a new chat engine and because of this additional steps are required when performing a server name change on the CCMM server with EWC installed. These steps are fully documented in the *Avaya Aura Contact Center Server Administration* document. In the event that CCMM patches are removed from the CCMM server after a server name change operation has occurred, it will be necessary to reapply the EWC specific name change steps again. These steps are outlined below and should be run after CCMM patches have been removed/re-applied.

Before you begin

Shut down the CCMM services using SCMU.

Procedure

1. Log on to the Multimedia Contact Server
2. Right-click Start.
3. Select Run.
4. Type cmd.
5. Click OK.

6. In the command line window, enter
CD D:\Avaya\Contact Center\EnterpriseWebChat\eJabberd
7. Enter `update_hostname.bat <CCMM_servername>` where
<CCMM_servername> is the new Multimedia Contact Server name.
8. Restart the CCMM server to apply changes
9. Ensure CCMM services have started OR use SCMU to start CCMM services.

Agent Controls Browser Application – Mandatory certificate with IOS 9 and later

From IOS9 any IOS device running the Agent Controls Browser Application to connect to AACC will be required to provide a certificate.

SIP Networking in an Environment with pre-AACC 7 Nodes

In a networking configuration, every node in the network must have a unique Home Location Code (HLOC). The unique HLOC guarantees that call IDs are unique across the network. Prior to AACC 7, unique HLOCs for each SIP node were manually configured. AACC 7 introduced the automatic configuration of the unique HLOC for a node. Automatically configured HLOCs begin at 10001. In a network with manually configured nodes ensure that the manually configured nodes do not conflict with the automatically configured HLOCs. Configuration of HLOC is only applicable in a networking setup.

Multimedia Prerequisites for server migration

This is only applicable to users migrating to new servers and keeping the same server names:

In this scenario users must select the same Multimedia Database Drive during the AACC 7.x install as contained in Backup. If post install, users migrate a database backup from a previous version of AACC and the Multimedia Database drive defined in the backup does not match the Multimedia Database drive selected during the 7.x install users will be unable to open attachments that were restored from the backup.

WebLM

WebLM provides Contact Center licensing in an Aura deployment. A WebLM instance is available as part of AACC. This instance is called **Local WebLM**. Alternatively, an independent WebLM can be deployed using the WebLM OVA. The independent WebLM is called **Remote WebLM**. Local WebLM and Remote WebLM are supported on all AACC deployment platforms and all AACC deployment configurations.

WebLM generate a unique ID to identify the WebLM instance. The ID is called **Host ID**. The Host ID is used to lock a license file to the customer deployment. The Host ID is generated by WebLM and is published as a server property in the Web License Manager web application. For Local WebLM, the web application can be accessed from <https://localhost:8444/WebLM>. For Remote WebLM, the web application can be accessed from [https://\[HOST\]:52233/WebLM](https://[HOST]:52233/WebLM).

The Host ID generated by WebLM for a virtualized deployment is a function of the IP address and the VMware UUID. To guarantee a constant Host ID is generated by WebLM in High Availability deployments, configure the managed IP address lower than both the active and standby IP addresses. Managed IP address configuration is effected using the High Availability configuration utility.

CCMA SSO via SMGR

In case SAM usernames is different from UPN usernames (CC-14196). User needs run CCMA User Migration tool to update UPN usernames for CCMA DB.

1. A new button ("Auto Update UPN") is already added to CCMA User Migration tool. It is used to automatically update UPN usernames for many SAM accounts which are already mapped to domain users in case SSO for CCMA is enabled. User needs to use CCMA User Migration tool and click "Auto Update UPN" new button. It will search CCMA users who need to update their own UPNs then click Save button to save changes to database. If user does not use that new button "Auto Update UPN", user can map one by one user and save it as the previous behavior.
2. In case SSO is enabled user can log in to CCMA through SMGR using both SAM and UPN. If using SAM, user needs to input SAM usernames and its password. If using UPN usernames, user needs to input UPN usernames with format "[UPN@domain.com](#)" and its password

WORKSPACES ON AVAYA AURA® CONTACT CENTER

Deployment

This release makes the Workspaces feature available on Avaya Aura® Contact Center. Workspaces is deployed as a Kubernetes three node cluster.

Workspaces can be deployed in the following environments:

1. Physical machine; Hyper-V Workspaces cluster co-resident with Contact Center software
2. Virtual deployment; VMWare hosted Workspaces cluster

Physical Machine Deployments

Physical Pre-Install Checks

- **Microsoft Updates**
 - All applicable MS Updates must be applied to the Contact Center system **before** installation of Contact Center software.
Both the download **and** install of MS Updates must be turned **off** for the duration of the Contact Center installation and configuration phases
- **Additional Hard Drive/Partition**
 - For Workspaces deployments, additional disk space is required as defined in *AACC Overview and Specification* document available on support.avaya.com
 - The additional disk space must be accessible via a single drive letter e.g. W:
 - During deployment, users will be prompted to choose a drive which will be used for the storage of cluster data
 - This drive will be used to store cluster data in Network File System (NFS) shared folders
- **Workspaces Cluster Provisioning**
 - For physical deployments, all required Workspaces machines will be created automatically during the configuration phase
- **IP Addressing**
 - IP addresses must be supplied during Workspaces configuration
 - IP addresses provided must not already be allocated to existing systems on the network
 - All cluster IP addresses must reside within the **same subnet** as the Contact Center server
 - It is expected that the Subnet Mask IP is 255.255.255.0 and Gateway IP Subnet matches the user entered IPs e.g. GW 192.168.10.xxx and user entered IPs 192.168.10.xxx

Fresh Install

1. Review section *Physical Pre-Install Checks* above
2. Review the additional disk space requirement as defined in *AACC Overview and Specification*
3. Download the AACC 7.1.0.0 DVD and verify checksum
4. Download the AACC 7.1.0.0 Release Bundle and verify checksum
5. Extract all downloaded content locally

Release Notes

6. Launch the Universal Installer application from the DVD
7. To deploy Workspaces, choose the option to configure Workspaces
8. Progress through the Universal Installer application providing required input (Release Bundle location, drive selections etc.)
9. Reboot system if/when prompted
10. After reboot, configure the system using the Ignition Wizard application
11. Complete required Ignition Wizard fields providing appropriate input on the Workspaces tab
12. Reboot system after Ignition Wizard completion

Upgrades

1. Download the AACC 7.1.0.0 Release Bundle and verify checksum
2. Extract all downloaded content locally
3. From the extracted Release Bundle content, launch the Avaya Release Pack Installer application to upgrade Contact Center and Third Party software
4. Also, while running the Avaya Release Pack Installer, choose the option to install Workspaces, providing the required input
5. **Reboot** system when prompted

Virtual Environment Deployments

Virtual Pre-Install Checks

- **Microsoft Updates**
 - All applicable MS Updates must be applied to the Contact Center system **before** installation of Contact Center software.
Both the download **and** install of MS Updates must be turned **off** for the duration of the Contact Center installation and configuration phases
- **Additional Hard Drive/Partition**
 - For Workspaces deployments, additional disk space is required as defined in *AACC Overview and Specification* document available on support.avaya.com
 - The additional disk space must be accessible via a single drive letter e.g. W:
 - During deployment, users will be prompted to choose a drive which will be used for the storage of cluster data
 - This drive will be used to store cluster data in Network File System (NFS) shared folders
- **Workspaces Cluster Provisioning**
 - For virtual deployments, users must manually deploy three separate systems using the provided OVA, **prior** to installation or upgrade of Contact Center
- **IP Addressing**
 - IP addresses must be supplied during Workspaces configuration
 - For physical machine deployments, IP addresses provided must not already be allocated to existing systems on the network
 - During creation of VMWare cluster machines via the provided OVA, each node/machine must be allocated an IP address and readily accessible on the network
 - For both physical and virtual deployments, all cluster IP addresses must reside within the **same subnet** as the Contact Center server
 - It is expected that the Subnet Mask IP is 255.255.255.0 and Gateway IP Subnet matches the user entered IPs e.g. GW 192.168.10.xxx and user entered IPs 192.168.10.xxx

Pre-Installation Steps

1. Review section *Virtual Pre-Install Checks* above
2. Manually Deploy Cluster Machines using provided Workspaces OVA (see folder 02 – Software Release Bundle)
 - a. Using your preferred VMWare client (vCenter/ESXi Web Client) deploy the Workspaces OVA **three** times
 - b. Name each of the created virtual machine as:
 - wsk8master
 - wsk8node1
 - wsk8node2
 - c. During deployment of the OVA, ensure the 1TB disk of each virtual machine is configured as **thin**
3. Manually Configure the OVAs onto the Network

- a. Log into each deployed virtual machine with username *root* and password *root01*
- b. Using the following command, open the CentOS network config script:
vi /etc/sysconfig/network-scripts/ifcfg-ens192
- c. Select the <Insert> key on the keyboard to enter edit mode
- d. Add/modify the *IPADDR*, *GATEWAY*, *NETMASK* & *DNS* entries as required

```
NAME="ens192"
DEVICE="ens192"
ONBOOT=yes
NETBOOT=yes
IPV6INIT=no
BOOTPROTO=none
TYPE=Ethernet
IPADDR=0.0.0.0
GATEWAY=0.0.0.0
NETMASK=0.0.0.0
DNS1=0.0.0.0
```

- e. To save changes select the Esc key then type *wq!* followed by Enter
 - f. To exit without saving, select the Esc key then type *q!* followed by Enter
 - g. A restart of the network service is required to enable the changes. Enter the following command: *systemctl restart network*
4. Verify that the date and time of each of the recently Workspaces nodes is the same as the Windows ACCS machine. Log into each of the recently deployed virtual machines with username *root* and password *root01*:
 - a. Inspect the current date and time of each node using the command:
timedatectl
 - b. If the date and time needs to be modified to align with the ACCS machine it is most likely only the timezone that needs to be modified. The commands to utilise are:
timedatectl list-timezones
 - c. Use the set-timezone argument to change the time zone:
timedatectl set-timezone [DesiredTimezone]
 - d. If you require to modify the date time further then the following commands can be used:
To change the date *# timedatectl set-time [YYYY-MM-DD]*
To change the current time *# timedatectl set-time [HH:MM:SS]*
 5. Ensure all 3 x VMs are in running state and pingable, via IP address, from the Contact Center Windows server

Fresh Install

1. Download the AACC 7.1.0.0 DVD and verify checksum
2. Download the AACC 7.1.0.0 Release Bundle and verify checksum
3. Extract all downloaded content locally
4. Launch the Universal Installer application from the DVD
5. To deploy Workspaces, choose the option to configure Workspaces
6. Progress through the Universal Installer application providing required input (Release Bundle location, drive selections etc.)
7. Reboot system if/when prompted
8. After reboot, configure the system using the Ignition Wizard application
9. Complete required Ignition Wizard fields providing appropriate input on the Workspaces tab
10. Reboot system after Ignition Wizard completion

Upgrades

1. Download the AACC 7.1.0.0 Release Bundle and verify checksum
2. From the extracted Release Bundle content, launch the Avaya Release Pack Installer application to upgrade Contact Center and Third Party software
3. Also, while running the Avaya Release Pack Installer, choose the option to install Workspaces, providing the required input
4. **Reboot** system when prompted

Post-Deployment Configuration

Date and Time

1. Inspect the Date and Time of each Kubernetes Node
 - a. Log into each Kubernetes node with username *root* and the user supplied password entered during the configuration phase
 - b. Inspect the current date and time of each node using the following command
timedatectl
 - c. If the date and time needs to be modified, it is most likely only the timezone that needs to be modified. The commands to utilise are:
timedatectl list-timezones
 - d. Use the *set-timezone* argument to change the time zone. The following example changes the time zone to Europe/Dublin:
timedatectl set-timezone Europe/Dublin

If you need to modify the date time further, then the following commands can be used.

2. To change the date, use the following syntax:
timedatectl set-time [YYYY-MM-DD]
3. To change the current time, use the following syntax. Enter the hour by using a 24-hour clock:
timedatectl set-time [HH:MM:SS]
4. To configure your system to maintain the clock in the local time, use the following command:
timedatectl set-local-rtc yes
5. To configure your system to use UTC, use the following command:
timedatectl set-local-rtc no

Security Disabled (Not recommended for production)

If the AACC install has security **off**, then modify the Integration Portal web application to allow untrusted connections. (IP is the container for CCS and is deployed on IIS)

1. Modify File location: D:\Avaya\Contact Center\CCT\IntegrationPortal\Web.config and set "AllowUnsecureConnections" value to True
 - a. `<add key="AllowUnsecureConnections" value="True" />`
2. Add binding for port 443 in IIS
 - a. Open Administrative Tools → IIS Manager → Default Web Site
 - b. Click on Bindings → then click on Add to add a binding for port 443.
3. Run script (istiocmd.sh available from support.avaya.com - Avaya Contact Center 7.1 Istio Config)
 - a. Copy file to temp folder on Master Node
 - i. Download and install WinSCP
 - ii. Launch WinSCP
 - iii. Login to master node using root user and password
 - iv. Upload istiocmd.sh to temp folder
 - b. Change access permissions on file: *chmod +x istiocmd.sh*
 - c. Run script. Usage is: *./istiocmd.sh <AACC IP>*
for example: *./istiocmd.sh 10.134.38.93*

Email handling – Closed Reason Code

Email reply will not send if a closed reason code was never created on the AACC/ACCS system.

Check if Closed reason Code exists

1. Run CCMM Administration
2. Check under Agent Desktop Configuration -> Resources → Closed Reason Codes
3. If no Closed Reason code exists then create one

Workspaces cluster - Docker boot location – Move to home/docker/

1. Download the CC_7.1.0.0_DockerMove_Script_v2.zip and verify checksum.
2. Extract to zip content to C:/ drive of your ACC machine
3. Open the CC_7.1.0.0_DockerMove_Script_v2 folder and right click WS_InstallationFixes.bat, selecting Run as Administrator.
4. NOTE: this runs a bash script, moving the docker boot location on all deployed Workspaces nodes, and can take up to 30 mins to complete on each node.
5. On completion, to confirm the change has been successful, run the following command on each node - **docker info**
6. Before running the workaround, the value of "Docker Root Dir" is /var/lib/docker
After successful running of the workaround, that value will be /home/docker.

NOTE: If the value /home/docker is not seen, or if you see the following prompt - *Cannot connect to the Docker daemon at unix:///var/run/docker.sock. Is the docker daemon running* - rerun the script using the steps indicated above.

Workspaces cluster – Add attachment server hostname to CoreDNS configuration

1. Download the CC_7.1.0.0_CoreDNS_Script_v3.zip and verify checksum.
2. Extract to zip content to C:/ drive of your ACC machine
3. Open the CC_7.1.0.0_CoreDNS_Script_v3 folder and right click DeployCoreDNSChanges.bat, selecting Run as Administrator.
4. NOTE: this runs a bash script, updating the CoreDNS configuration.
5. On completion, to confirm the change has been successful, send a contact with an attachment to an agent.

Workspaces and Domain Server

NOTE: Workspaces Agents must Domain users

Add the Workspaces and Workspaces Domain servers to the CCMM admin

- Launch CCMA and select multimedia.
- Launch the CCMM admin
- Navigate to Workspaces Configuration
- Add "Workspaces server IP" using the Master IP
- Add "Domain Server IP"
- Leave the ports as the default

Scale

The Workspaces feature on Avaya Aura® Contact Center 7.1 supports up to 400 agents. The supported agent count will increase to 1000 agents with Avaya Aura® Contact Center 7.1 Service Pack 1 (7.1.0.1) targeted to GA in Jul 2019. The supported agent count will further increase to the upper limit of 3000 agents with Avaya Aura® Contact Center 7.1 Service Pack 2 (7.1.0.2) targeted to GA in Sep 2019.

Workspaces and High Availability

The current deployment does not provide a highly available Workspaces. The kubernetes cluster for Workspaces does not provide a high availability configuration - there is insufficient redundancy, resiliency and recoverability.

AACC High Availability continues to be available to protect AACC operation in the event of critical AACC hardware and software failures.

When deploying Workspaces with AACC High Availability, you must configure only a single Workspaces for both AACC nodes. When installing / upgrading select and configure Workspaces only on one node. When installing/upgrading the second node do **not** select Workspaces. The AACC configuration related to Workspaces is automatically copied across to the standby node. There is no Workspaces configuration needed on the standby.

Avaya Aura® Contact Center 7.1 Service Pack 2 (7.1.0.2) targeted to GA in Sep 2019 will deliver high availability for the deployed Workspaces in AACC.

SECURITY INFORMATION

From Avaya Aura® Contact Center release 7.0.2, fresh installations Out of The Box (OTB) security store and AES specific security certificates are no longer provided.

From release 7.0.3.0 fresh installations of the solution will not provide the default security store with default security certificates for AACC and the AES.

Fresh installations

For fresh installs the customer will have to create a custom security store for the server during the Ignition Wizard security configuration stage to enable the On by Default and secure the server and services as was provided automatically in previous releases.

If the Ignition Wizard security configuration is not completed fully then upon completion of the Ignition Wizard phase and reboot of the server the services will not be secure and the SIP-CTI link to AES will not be operational as it supports secure connection only.

Ignition Wizard has been enhanced to allow the creation and population of the contact center security store during the configuration phase. If this is skipped then warnings will be given and Security Manager (previously Security Manager) can be used to complete the creation and/or population of the security store.

From Avaya Aura® Contact Center release 7.0.3, upgrades to 7.0.3 will remove OTB or default store if detected.

Upgrades

In 7.0.3, if the OTB store is being used and is on the server it will be actively removed by the installer. From 7.0.3.0 all existing deployments will be required to have implemented custom security configuration.

Prior to upgrading to 7.0.3.0 please put in place custom security certificates and security store via the Security Manager, this is the application on the server to create a custom security store.

Avaya Aura® Contact Center security certificate migration considerations

Migration from 6.4 to 7.x

Due to the changes made in AACC 7.0 release regarding improved security stance, migration of the AACC 6.4 certificate store to AACC 7.x or higher is not possible.

The only path available when moving to AACC 7.x from AACC 6.4 is the creation of a new store on the AACC 7.x system, the signing of the certificate signing request (CSR) by a selected Certificate Authority and the importing of these new security certificates into the new store.

No elements of the security store from AACC 6.4 can be migrated to AACC 7.x

The following sections are applicable to migrations from 7.x to later versions only.

Note: AACC releases prior to 7.0.3 come with the default store as standard and as such does not need to be migrated from previous releases. Please be advised this default store is not to be used in a production environment and is designed to be used in a test/configuration only situation.

Migrating AACC Security Store from AACC 7.0 to 7.x.x

The following sections are applicable to migrations from 7.0 to later versions only.

Note: AACC 7.0 and AACC 7.0.1 come with the default store as standard and as such does not need to be migrated from previous releases. Please be advised this default store is not to be used in a production environment and is designed to be used in a test/configuration only situation.

Name of Server is important

When intending to reuse existing security certificates on a new system then the receiving system will have to have the exact name as the donor system otherwise the security certificate will not match the underlying server. If the security certificate and underlying server name do not match, then warnings and errors will be presented to the user, when attempting to use this security certificate to establish a secure connection.

Note

The recommendation is that, if possible, new security certificates be generated for the new system rather than reuse security certificates from another system.

Restoring Certificate store to a new system

If the decision to reuse the security certificates then the migration of security certificates is a manual process and requires that the security certificate store on the server be backed up using the Security Manager Backup feature.

This will back up the necessary files required to be imported back in on the new system using the Security Manager Restore feature.

The receiving system name must be the same as the donor system otherwise errors will occur when attempting to use the security certificates to establish a secure connection.

Note

The backed up files will be modified if coming from a release prior to 7.0 during the restore process so it is recommended that you keep a copy of the original backed up files.

See [Appendix C – Store Maintenance](#) for details on backing up and restoring the certificate store.

TLS v1.2 as default level for TLS communication

Fresh installations

On fresh installations only, the default TLSv1 level enforced is TLS v1.2. This means that TLS v1.0 and TLS v1.1 protocol levels are disabled and are not available to be used in the solution or on the underlying Windows 2012 R2 operating system.

Migrations

Migrations can be considered in the same area as fresh installations in that the default TLSv1 level enforced is TLS v1.2.

Upgrades

On an upgrade where the feature pack is applied on an existing 7.0 release then there is no enforcement of TLS v1.2 on the server. This is relevant only to the Windows operating system level support of TLS versions.

For SIP traffic and Event Broker web services the enforcement of TLS v1.2 still applies and if these levels need to be modified then please refer to the section “Resetting TLSv1 Levels”.

In 7.0.1 the default TLSv1 level enforced is TLS v1.2. This means that TLS v1.0 and TLS v1.1 protocol levels are disabled and are not available to be used in the solution or on the underlying Windows 2012 R2 operating system.

Resetting TLSv1 Levels

If after a fresh install and application of the feature patch there is a mechanism in place to re-enable the lower level TLS levels if required as this new TLS v1.2 default setting may have an impact on any legacy applications that consume AACC services that cannot support this level of TLSv1. To allow backward compatibility with older releases and applications that consume AACC services the TLSv1 level can be lowered to reestablish functionality if found to be incompatible with the new TLSv1 level.

The general rule when setting the TLSv1 levels is shown in the table below

TLS Level Set	TLS v1.0 available	TLS v1.1 available	TLS v1.2 available
1.0	Yes	Yes	Yes
1.1	No	Yes	Yes
1.2	No	No	Yes

When the TLS v1 level is set the general rule is any level under that set level is disabled and any level above it is still available. It is configurable via Security Manager Security Configuration tab

How to change the TLSv1 levels

The new TLSv1 level settings can all be changed in the Security Manager application which can be launched from the AACC server.

In the Security Configuration Tab of the Security Manager application there are three drop boxes which allow the user to lower the TLSv1 levels for the following application and services outlined in the next section.

Services and Applications covered by new TLSv1 setting

The three main areas where this new setting covers are

- Windows operating system
- Web Traffic
- SIP Traffic

Windows operating system

This covers all of the windows operating system and any Microsoft based applications, such as IIS for example.

This can be lowered to TLS v1.0 or TLS v1.1 if required via the Security Manager application. If TLS v1.0 is set as default for example, then TLS v1.1 and TLS v1.2 is still available.

Web Traffic

IIS

This is covered with the changes made to the underlying Windows Operating system. Which is also the same setting configurable via the Security Manager Security Configuration tab.

Tomcat

This web server is set to use TLS v1.2 only. It is currently not configurable.

All known applications that use Tomcat can operate at TLS v1.2 and thus no need to have an option to enable lower protocols.

Lightweight/framework web application servers

Event Broker Web Service TLS v1 level can be set on the Security Manager application.

SIP Traffic

This covers all SIP traffic to and from the AACC server. For AACC systems the SIP-CTI link is always TLS, the rest are configurable. This is configurable via Security Manager Security Configuration tab.

AACC has one permanent TLS connection, SIP-CTI and the following compatibility matrix shows below the supported TLS v1 levels when connecting to older AES's. If your deployment has an older version shown in the matrix below then lowering the TLSv1 level will reestablish a secure link.

AES releases TLSv1 support

AES Release	TLS v1.0 support	TLS v1.1 support	TLS v1.2 support	Options
6.3.3	Yes	No	No	Would require SIP Signaling TLS v1 level to be lowered on AACC via Security Manager GUI
7.X	Yes	Yes	Yes	
7.0.1	No	No	Yes	TLS v1.0 and TLS v1.1 can be enabled AES OAM/Admin Interface
8.0	No	No	Yes	

For non-mandatory TLS SIP connections

While AES is a mandatory secure connection, the other servers that make up the solution can be configured to secure their connection to the AACC server and so below are the compatibility tables for the different versions that may be used in the solution.

Session Manager releases	See Appendix C – Session Manager releases TLSv1 support
Avaya Aura Media Server	See Appendix C – Avaya Aura Media Server releases and TLSv1 support

Known applications and services that cannot support TLS v1.2

There are applications and services which cannot support TLS v1.2 currently and a review of these applications and services should be made to determine the course of action prior to moving to 7.0.1. The table below lists all known application and services that cannot support TLS v1.2

HDX / DIW connection to databases	See Appendix C – HDX/DIW connection to databases
Remote desktop	See Appendix C – Remote Desktop
System Manager 7.0	See Appendix C – System Manager 7.0

LOCALIZATION

Avaya Aura Contact Center 7.1 (7.1) Avaya Agent Desktop (AAD), Outbound Campaign Management Tool (OCMT), Contact Center Manager Administration (CCMA), and Web Agent Controls UI and online Help is localized into French, German, LA Spanish, Simplified Chinese, Brazilian Portuguese, Russian, Japanese, Traditional Chinese, Korean and Italian. Workspaces on Avaya Aura Contact Center UI and online Help is localized into French, German, LA Spanish, Simplified Chinese, Brazilian Portuguese, Russian, Japanese, Korean, Italian and Hebrew.

Overview of I18N and L10N Products & Components

Components that are used by Contact Center agents or by Contact Center supervisors performing non-specialized functions are localized. Interfaces to support administration or specialized functions (for example, creating routing applications) are not localized.

All AACC 7.1 products and components support Internationalization (I18n). The following table lists all AACC 7.1 products and components that support Localization (L10n):

AACC 7.1 Products	Component
CCT	Web Agent Controls
CCT	Web Agent Controls online help
CCMA	Contact Center Management
CCMA	Access and Partition Management
CCMA	Real-Time Reporting
CCMA	Historical Reporting
CCMA	Configuration
CCMA	Emergency Help
CCMA	Outbound
CCMA	Historical Report Templates
CCMA	Agent Desktop Display
CCMA	Online Help
CCMM	AAD Client
CCMM	AAD online Help
CCMM	OCMT Client
CCMM	OCMT online Help
Workspaces	Workspaces UI
Workspaces	Workspaces online Help

Refer to Chapter 17: Language support fundamentals in the Avaya Aura Contact Center Server Administration guide for supported languages.

Localized Components (CCMA and CCMM)

The following table lists the compatibility between the CCMA/CCMM language patches and the operating system language family. Only compatible languages can be enabled on the server.

		Supported Languages										
		CCMA										CCMM
OS Language		FR	DE	ES	PT-BR	IT	ZH-CN	ZH-TW	JA	RU	KO	
	English	Y	Y	Y	Y	Y	N	N	N	N	N	Y
	Any 1 Latin1 language	Y	Y	Y	Y	Y	N	N	N	N	N	Y
	Simplified Chinese	N	N	N	N	N	Y	N	N	N	N	Y
	Trad. Chinese	N	N	N	N	N	N	Y	N	N	N	Y
	Japanese	N	N	N	N	N	N	N	Y	N	N	Y
	Russian	N	N	N	N	N	N	N	N	Y	N	Y
	Korean	N	N	N	N	N	N	N	N	N	Y	Y

Language specific support and configuration

All languages are supported on Internet Explorer 10 & 11.

Language	CCMA Client	CCMM Client	CCMM Server
	Browser Language Preference	Client Windows Support	Server Windows Support/ Regional Options Configuration*
French	fr-FR	French Windows 7, 8.1 and 10	French Win 2012 R2. Regional option default (French)
German	de-DE	German Windows 7, 8.1 and 10	German Win 2012 R2. Regional option default (German)
LA Spanish	es-CO	LA Spanish Windows 7, 8.1 and 10	Spanish Win 2012 R2. Regional option default (Spanish)
Simplified Chinese	zh-CN	Simplified Chinese Windows 7, 8.1 and 10	Simplified Chinese Win 2012 R2. Regional option default (Simplified Chinese)
Brazilian Portuguese	pt-BR	Brazilian Portuguese Windows 7, 8.1 and 10	Brazilian Portuguese Win 2012 R2. Regional option default (Brazilian Portuguese)
Russian	ru-RU	Russian Windows 7, 8.1 and 10	Russian Win 2012 R2. Regional option default (Russian)
Italian	it-IT	Italian Windows 7, 8.1 and 10	Italian Win 2012 R2. Regional option default (Italian)
Japanese	ja-JP	Japanese Windows 7, 8.1 and 10	Japanese Win 2012 R2 Regional option default (Japanese)
Traditional Chinese	zh-tw	Traditional Chinese Windows 7, 8.1 and 10	Traditional Chinese Win 2012 R2. Regional option default (Traditional Chinese)
Korean	ko-KR	Korean Windows 7, 8.1 and 10	Korean Win 2012 R2. Regional option default (Korean)

* If you wish to launch AAD or OCMT in a local language BUT THE CLIENT OPERATING SYSTEM IS ENGLISH, then change the default language in the regional language options to the local language.

Email Analyzer configuration

An English email analyzer (AlphanumericAnalyzer) is enabled by default for keyword analysis of English Latin-1 character sets on the CCMM server. The email analyzer can be configured based on language specific values specified in the following table:

Language	Email Analyzer
French	Change default SimpleAnalyzer to FrenchAnalyzer
German	Change default SimpleAnalyzer to GermanAnalyzer
LA Spanish	Change default SimpleAnalyzer to AlphanumericAnalyzer
Simplified Chinese	Change default SimpleAnalyzer to ChineseAnalyzer
Brazilian Portuguese	Change default SimpleAnalyzer to BrazilianAnalyzer
Russian	Change default SimpleAnalyzer to RussianAnalyzer
Italian	Change default SimpleAnalyzer to ItalianAnalyzer
Traditional Chinese	Change default SimpleAnalyzer to ChineseAnalyzer
Japanese	Change default SimpleAnalyzer to CJKAnalyzer
Korean	Change default SimpleAnalyzer to CJKAnalyzer

The *mailservice.properties* file on the CCMM Server specifies which analyzer is enabled and lists all supported analyzers in the comments.

This procedure can be used to enable a language specific email analyzer:

1. Stop the **CCMM Email Manager** service on the server.
2. Navigate to D:\Avaya\Contact Center\Multimedia Server\Server Applications\EMAIL.
3. Open mailservice.properties.
4. Change the properties of the file from read only to write available.
5. In the <box> search for the line mail.analyzer=AlphanumericAnalyzer.
6. Change mail.analyzer value to language specific value.
7. Start the CCMM Email Manager service on the server.

Email Analyzer Limitation 1 - Wildcard use (Asian) – Single Byte Routing

There is a limitation when the email analyzer is enabled for Asian languages. A problem arises when routing with SINGLE BYTE characters in the keyword. Double byte keywords route successfully. This limitation also applies for wildcards included in keywords.

To route a single byte keyword to a skillset, you must save the keyword as DOUBLE byte on the server. For example to route the single byte keyword コプタ to a skillset called EM_Test do the following:

1) Create a DOUBLE byte keyword

- In the Multimedia Administrator, click the plus sign (+) next to Contact Center Multimedia, click the plus sign next to E-mail Administration, and then double-click Keyword Groups.
- The Keyword Groups window appears.
- To create a new keyword group, click New.
- In the Name box, type a unique name for the keyword group (maximum 64 characters. This NAME must be in English). E.g. "DoubleByteCoputa"
- In the Keyword box, type the word (in DOUBLE byte) you will be searching for.
E.g. "コプタ" Click Add.
The keyword is added to the list, and the keyword group is created. Click Save.

2) Create a Rule to route the keyword to a skillset

- Start the Rule Configuration Wizard.
- On the Rule Configuration Wizard – Input Criteria window, under Available Keyword Groups, select a keyword group you want to use for this rule. E.g. “DoubleByteCoputa”
- Click the black arrow to insert the keyword group name into the selection box.
- Click Next.
- In the Rule box, type the name for your rule. E.g. “DoubleByteCoputaRule”
- In the Skillset box, select a skillset for your rule. . E.g. “EM_Test”
- Click Save.
- Click Finish. Your rule is created with the keyword group.

Note: This is a limitation of the 3rd party creator of the analyzer, Lucene.

Email Analyzer Limitation 2 - Wildcard use (Asian) - Wildcard * and ? string position

There is a limitation when the email analyzer is enabled for Asian languages. Wildcard ‘?’ or ‘*’ can only be used at the end of a keyword.

 
e.g. Wildcard use たば* is correct. Wildcard use た*た is not correct.

Note: To route the wildcard keyword successfully, the ‘*’ can be entered in either full-width or half width. The ‘?’ can be entered in full-width only.

Start Localized AAD Client

Pre-installation steps

- Ensure that Localization is enabled in CCMM Administration -> Agent Desktop Configuration -> User Settings



Enable Localization ☒

- If you wish to launch AAD in a local language but the client operating system is ENGLISH, then change the default language in the regional language options to the local language.

Installing the Agent Desktop Client

Install the Agent Desktop if you are launching the application for the first time or if you are launching the application following installation of an upgrade or a patch.

Prerequisites

- Ensure that the administrator has configured your Windows User ID in CCT and that you have a valid User ID, Password, and Domain for use with Contact Center Agent Desktop.

Procedure steps

1. In Windows Explorer or Internet Explorer, enter the HTTP address (URL) using format:
https://<Contact Center Multimedia servername>/agentdesktop/LANGUAGE CODE*
2. Click Launch AAD.
3. Click Install.

Starting the Agent Desktop Client

Start the Agent Desktop when you are ready to view the application.

Prerequisites

- Ensure that you install Avaya Agent Desktop.

Procedure steps

1. In Windows Explorer or Internet Explorer, enter the HTTP address (URL) using format:
https://<Contact Center Multimedia servername>/agentdesktop/LANGUAGE CODE*
2. Click Launch AAD.

Alternative Procedure steps

1. Click Windows Start, All Programs, Avaya, Avaya Aura Agent Desktop.
The Agent Desktop toolbar appears. If a CCT Connection Failure message appears, your Windows User ID is not configured on CCT. Click Retry to enter valid User Credentials or click Cancel to exit the application.

* Applicable **LANGUAGE CODEs** to be used are:

- French = fr
- German = de
- LA Spanish = es
- Simplified Chinese = zh-cn
- Brazilian Portuguese = pt-br
- Russian = ru
- Italian

Troubleshooting

Detecting latest Language files

In case that client runs the English AAD and OCMT applications and does not pick up the language files, then these files are now stored in the GAC (.Net cache) on the client PC. The .Net cache (GAC) therefore, needs to be emptied on the client PC so the latest English and language files can be taken from the server.

Note: If you install an updated Service pack or Design patch, the client still runs applications with cached language files. The .Net cache (GAC) must be emptied, so the latest language files can be taken from the server.

Emptying the .Net cache on the client PC running AAD and OCMT

Procedures such as uninstalling application and emptying the .Net cache require administrator rights.

1. Close AAD and OCMT.
2. Click Add/Remove Programs.
3. Remove Avaya/Avaya Agent Desktop.
4. Navigate to *C:\Documents and Setting\USERNAME\local settings\apps*.
5. Delete the 2.0 folder.
6. *Note:* This folder may be hidden. If so, open Windows Explorer and click on Tools, Folder options. Choose the View tab. Under Files and folders or Hidden files and folders, choose to show hidden files and folders. Click Apply and click OK.
7. Start AAD to download the latest AAD files from the CCMM server.
8. Start OCMT from CCMA to download the latest OCMT files from the CCMM server.

KNOWN ISSUES

Hardware Appliance

None

Software Appliance

None

Workspaces on AACC

Workspaces Deployment – Server 2016 Roles & Features can take 3hrs

Tracking Number	CC-17585
Application	Workspaces Deployment
Description	On a 2016 machine the roles and features take almost 3 hrs to install
Impact	Lengthy installation time impacting maintenance window planning
Workaround	No workaround - wait for process completion. To mitigate, ensure Microsoft Updates are turned off for the duration of the installation and configuration phases

Workspaces Deployment – Notifications of failure to user and supporting tools

Tracking Number	CC-18142
Application	Workspaces Deployment
Description	Deployment of containers can fail without notifications to user or supporting tools
Impact	Not clear whether a deployment has failed due to lack of sufficient robustness or supporting tools.
Workaround	Manual inspection of the log files to confirm success/failure. Windows: C:\Avaya\Logs\Sysops\Workspaces CentOS: /etc/workspaces/logs

Multiple Workspaces can be launched on the same PC

Tracking Number	CC-17105
Application	Workspaces
Description	Multiple instances of workspaces can be launched on the same client
Impact	Agent can launch multiple Workspaces on the same client leading to indeterminate behavior
Workaround	Do not launch multiple instances of workspaces on the same client

Finish and exit button enabled when working contact

Tracking Number	CC-17210
Application	Workspaces
Description	Finish and Exit button are enabled when working a contact
Impact	Agents may incorrectly close contact when still active
Workaround	Do not use Finish, Exit when active on a contact. Requires agent training.

Decline/Reject contact not represented for Email and Chat

Tracking Number	CC-17595 and CC-17596
-----------------	-----------------------

Release Notes

Application	Workspaces
Description	Declined/Rejected Email or Web chat is not represented to next available agent. Agent not set to not ready after rejecting contact.
Impact	Cannot Decline/reject Email or Web chat contacts and have the interaction return to the queue and/or have the agents automatically set to Not Ready
Workaround	Manual set agent to Not Ready instead of using reject

Decline/Reject not operating for Voice

Tracking Number	CC-17597
Application	Workspaces - Voice
Description	Agent cannot reject an incoming voice call
Impact	Cannot reject voice call
Workaround	Agent can go not ready when contact presenting

Incorrect Time Zone in Logs

Tracking Number	CC-17638
Application	Workspaces
Description	The timestamp in the log files was incorrect. It was GMT instead of the relevant time zone
Impact	Troubleshooting
Workaround	Manually apply time zone offset from GMT

Agents automatically Set to Not Ready

Tracking Number	CC-18018
Application	Workspaces
Description	During load test traffic run agents went not ready
Impact	Workspaces Traffic – Agents set to not ready after 8 hour run
Workaround	Manually set agents to Ready

Logged in Overnight Causes Unresponsive Agents

Tracking Number	CC-18087 & CC-18269
Application	Workspaces
Description	Agents left logged in overnight (i.e. beyond configured token timeout) have no user buttons to start work, finish work, or exit
Impact	Workspaces agents left logged in overnight become unresponsive
Workaround	Increase token timeout beyond the default 9 hours

Agents Cannot Start Work in Ready State

Tracking Number	CC-18154
Application	Workspaces
Description	Agents are not automatically set to Ready on login to AACC if option selected in Agents Workspace Preferences. Default is Not Ready
Impact	Agents Workspace Preferences not picked up for Starting Work Ready
Workaround	Agents can manually go ready

Agents cannot activate after an un-controlled AACC restart

Tracking Number	CC-18268
-----------------	----------

Release Notes

Application	Workspaces
Description	When AACC is restarted in an-uncontrolled manner only, there is no feedback that the connection is lost. Menus and buttons are available, but no actions take effect. If the web-page is refreshed, the user can login and can activate, however menus and buttons have no effect.
Impact	No issue for controlled restarts within a maintenance window. Agents are not able to activate when AACC is restarted in un-controlled manner.
Workaround	Restart the IntegrationPortalAppPool application pool in IIS: From Start menu: Launch internet information Services (IIS) Manager. Navigate to Application Pools/IntegrationPortalAppPool. Right-click and select Stop. When status is stopped, right click and select Start.

Logged in when AACC down blocks Agents when AACC goes back up

Tracking Number	CC-18273
Application	Workspaces
Description	When AACC is down, an agents authentication succeeds and activation succeeds. However, the agent is in UNKNOWN state and has no available buttons. There is no other feedback to the agent. The agent is not notified when AACC is up again. Agent remains in UNKNOWN state even after an additional login/activation
Impact	Agents who authenticate/activate while AACC is down. No impact to agents who did not log in/activate while AACC is down when they next log in.
Workaround	For agent that authenticated and activated when AACC down they need to clear cache cookies on their browser and re-authenticate when AACC goes back up

Agents cannot Login after Database Restore

Tracking Number	CC-17749
Application	Workspaces – Admin Adaptor
Description	Admin Adaptor does not pick the users from CCMA after a database restore
Impact	Agents cannot login if database restored without restart/change of data
Workaround	Restart of OAM services

Screenpops Not presenting to agents correctly

Tracking Number	CC-18263
Application	Workspaces – Admin Adaptor
Description	Screenpop is displaying as empty when launching a screenpop on an outgoing call
Impact	Workspaces agents cannot use screenpops in some scenarios
Workaround	Need to use AAAD for some screenpops operations

Agent activation fails when Security OFF

Tracking Number	CC-18160
-----------------	----------

Release Notes

Application	Workspaces - Authentication
Description	Login activation fails when security is off
Impact	Systems with security set to OFF, activating workspaces agents will fail
Workaround	Two options: (1) Turn Security ON or (2) apply manual workaround steps

After exiting, Agents cannot log in again

Tracking Number	CC-17750
Application	Workspaces – CCS Adaptor
Description	Subsequent activation attempts fail after an agent exits the session after an initial successful log in.
Impact	Agents cannot log in – intermittent issue
Workaround	None

Unable to resolve Standby Hostname

Tracking Number	CC-17986
Application	Workspaces – CCS Adaptor
Description	Workspaces adapters cannot connect to AACC as unable to resolve standby hostname.
Impact	Workspaces installations on High Availability systems with managed IP.
Workaround	Manually edit ConfigMap for CoreDNS service via: “kubectl edit cm coredns -n kube-system” command and add a section with section (replace an entry with ip_addr/FQDN/alias):

CCS Adaptor failed after 8 hours traffic

Tracking Number	CC-18141
Application	Workspaces – CCS Adaptor
Description	CCS adaptor failed and went into evicted stated after 8 hours traffic
Impact	All workspaces agents – work in progress lost for chat and email, but active voice/video call would not be impacted (but could not be controlled from workspaces)
Workaround	Restart of services

Reply email displays incorrect from/to addresses to Agents

Tracking Number	CC-17615
Application	Workspaces - Email
Description	Incorrect From/To when replying to email displayed to agents but is correct when sending email.
Impact	Workspaces agents see incorrect information in email address fields
Workaround	Agents can ignore incorrect display as no impact on mail being sent

Agents able to Close Emails without Replying

Tracking Number	CC-17930
-----------------	----------

Release Notes

Application	Workspaces - Email
Description	It is possible to close the email interaction without replying
Impact	Behavior change between AAD flow and workspaces flow
Workaround	None

Attachment service has large Memory use

Tracking Number	CC-18140
Application	Workspace - Email
Description	Attachment service consumes 2GB of RAM
Impact	No direct impact seen however large memory use could impact other running containers
Workaround	None

Cannot add attachments to Outgoing email

Tracking Number	CC-18185
Application	Workspaces - Email
Description	Uploading attachments failing on email (agent initiated and reply)
Impact	Attachments cannot be added to outgoing emails
Workaround	Customer would need to use AAAD for this functionality

Domain name cannot contain extended character set

Tracking Number	CC-18133
Application	Workspaces - Logging
Description	Cannot login agent if they have a domain name that contains extended character set e.g. - _ , .
Impact	Cannot login agents to Workspaces.
Workaround	Remove extended characters from domain name

Agent label and customer label displaying incorrectly

Tracking Number	CC-17417
Application	Workspaces – Web Chat
Description	Agent label and customer label displayed incorrectly on workspaces
Impact	Specific to agents handling chat only
Workaround	None

State info mismatch following agent log out while on a call

Tracking Number	CC-17379
Application	CCS SDK
Description	When agent logs off while on an active interaction, no indication to agent of state change
Impact	No indication of logged out station on workspaces
Workaround	None

Java API is logging web chat body

Tracking Number	CC-17975
-----------------	----------

Release Notes

Application	CCS SDK
Description	The chat body is being logged by Java API.
Impact	Agents deployments Logs may contain (sensitive) chat information
Workaround	Manually delete logs

Call interaction card not created when Invalid number dialed

Tracking Number	CC-18089
Application	CCS SDK
Description	No interaction card created on making a call to an invalid number
Impact	No indication of failed call on workspaces and Agent cannot release call on workspaces
Workaround	Call to invalid number needs to be released from phone set

Issue Transferring Chat Back to Same Agent

Tracking Number	CC-17925
Application	CCT-Contact Control Service
Description	Transfer to Service option fails to re-present when contact is returned to the same agent
Impact	Localised to workspaces agents. No interaction card shown for chat contact transferred to the same agent
Workaround	None

Application\Features

AMS VHDX does not allow a subnet mask different from 255.255.255.0

Tracking Number	CC-17121
Application	AAMS VHDX Deployment
Description	There is a network restriction when installing the AMS VHDX where the customer must use 255.255.255.0 as the Subnet Mask IP
Impact	Customer networks may not conform to this so these restrictions need to be removed
Workaround	The network configuration of the underlying physical NIC card must have a Subnet Mask IP of 255.255.255.0.

AAMS Media Services displayed incorrectly as not started in EM after AACC licenses AAMS

Tracking Number	CC-14420
Application	Avaya Aura Media Server
Description	If an AAMS is not licensed and AACC licenses the AAMS then the AAMS Element Manager can sometimes display the AAMS Media Services as “Not Running” when it is up and running. The Start Button in AAMS EM Element Status will be selectable and the Stop button will be grayed out.
Impact	There is no impact on AACC as AAMS is up and running fully. The AAMS is displaying the wrong state in EM.
Workaround	Reboot the AAMS by logging into ssh terminal and running “reboot”

Remote desktop connection fails due to service stuck in starting

Tracking Number	CC-2435
Application	Windows Server 2012 R2
Description	Under certain error conditions, i.e. misconfiguration, some AACC services will not complete startup. While in this error state remote desktop connection logins and local console logins can fail with a “please wait” message.
Impact	Inability to login through RDC of local console to AACC server.
Workaround	If this error condition is experienced a connection to the console should be attempted. In the case of a physical sever deployment this would be the physical keyboard and monitor connection to the server. In the case of virtualized environments the equivalent to the physical console should be used. If a connection is successful on the console the service which is stuck in starting should be identified and normal trouble shooting performed to determine why the service is not completing startup. If the connection to the console is not successful a power cycle of the server will be required. A connection should be attempted, either through the console or through RDC, as soon as possible after the power cycle is performed.
Solution	This issue is resolved by applying the following Microsoft fix (KB3100956) mentioned in the Microsoft Operating System Updates section.

AAMS Element Manager may display incorrect FQDN of AAMS VHDX server after deployment AAMS SP

Tracking Number	CC-16955
Application	AAMS VHDX Deployment
Description	After deployment AAMS SP, Element Manager may display invalid FQDN of AAMS server. EM may display the following instead of FQDN: • hostname without domain name; • FQDN with default domain name ("accdev.lab"); • two IP addresses of AAMS.
Impact	Element Manager displays incorrect FQDN
Workaround	Log into AAMS VHDX Linux. Look at a content of the <code>/etc/sysconfig/network-scripts/ifcfg-eth0</code> file. It must contains IPADDR and NETWORK entries only once. If necessary, edit that file removing duplicated entries and reboot AAMS VHDX server.

Agent Greeting not working on AACC due to Apache Tomcat 8081 port conflict

Tracking Number	CC-9938
Application	Agent Greeting and CCT Console
Description	Installing Avaya Aura Contact Center installs Apache Tomcat Server. The default port number for Apache Tomcat is 8081. If you need to change the port number to avoid conflicts with third-party software, see your Apache Tomcat documentation. If the Tomcat port is changed then refer to section: " Adding Communication Control Toolkit to CCMA " in the commissioning guide to change the CCT Console port used. McAfee Agent Common Services (macmnsvc.exe) or McAfee Framework Service (FrameworkService.exe) are the services that can use port 8081. If these services are required, then the Apache Tomcat port must be changed. Refer to If these services are not required then they can be stopped and configured not to run on startup in Windows Services.
Impact	If a conflict occurs, then both AACC Agent Greeting and CCT Console will be impacted. McAfee Anti-Virus could potentially be one of the third party applications that conflicts with port 8081.
Workaround	If you need to change the port number to avoid conflicts with third-party software, see your Apache Tomcat documentation. If the Tomcat port is changed then refer to section: " Adding Communication Control Toolkit to CCMA " in the commissioning guide to change the CCT Console port used.

Some fields are not aligned when Agent Performance report exported to .pdf file,

Tracking Number	CC-3856
Application	Contact Center Manager Administration
Description	AACC7.0 HR- Export Agent Performance report to .pdf file, some fields are not aligned.
Impact	A number of reports within AACC are larger than a standard A4 page and as a result appear misaligned when exported to pdf. They also span pages when printed.

Release Notes

Workaround	None
------------	------

Report Creation Wizard – Some sample reports do not work

Tracking Number	CC-5035
Application	Contact Center Manager Administration
Description	The following sample reports do not work in this release: BillingByAddress SkillsetOutboundDetails Voice Skillset Name ID Mapping Network Consolidated Skillset Performance ICPCSRSample MMCSRStat
Impact	These samples cannot be used as a starting point for new reports
Workaround	None

Unable to login to CCMA using System Manager 7.0 or earlier with TLS 1.1 or TLS 1.2 enabled

Tracking Number	CC-9923
Application	Contact Center Manager Administration
Description	Unable to login to CCMA using System Manager 7.0 or earlier when TLS 1.1 or TLS 1.2 is enabled. System Manager 7.0 and earlier versions do not support TLS 1.1 or 1.2
Impact	Unable to login to CCMA
Workaround	1. System Manager 7.0.1 supports TLS 1.1 and TLS 1.2

One instance of Agent greetings and Voice recording not working “A Serious Error has occurred – Exiting”

Tracking Number	CC-13218
Application	Contact Center Manager Administration
Description	When security is ON, CCMA Authentication web service only supports HTTPS request, not HTTP request from clients. If the client requests HTTP, it will return an error code 403 (HTTP 403) to the client. However in the case of CC-13218, the client requests HTTP, CCMA Authentication web service still works when security is ON.
Impact	Agent greetings and Voice recording do not work. CCMA Authentication is not secure.
Workaround	The following Authentication web service configuration was found in IIS config file, applicationHost.config located at C:\Windows\System32\inetsrv\config folder. <location path="Default Web Site/WebServices/Authentication/Service.asmx"> <system.webServer> <security> <access sslFlags="None" /> </security>

```
</system.webServer>
</location>
```

That configuration incorrectly makes IIS support both http and https for Authentication service. We need to remove that incorrect configuration.

Install wrong .NET Framework version from installing pre-requisites on CCMA Dashboard

Tracking Number	CC-13274 (CC-9825)
Application	Contact Center Manager Administration
Description	Cannot launch Dashboard report from Real-Time Report page
Impact	Unable to use CCMA Dashboard
Workaround	1. Install .NET FW 4.5.2 from DVD for the client machine. 2. Apply "SchUseStrongCrypto" value for the client machine. Create a text file named strongcrypto35-enable.reg that contains the following text: <pre>Windows Registry Editor Version 5.00 [HKEY_LOCAL_MACHINE\SOFTWARE\Microsoft\.NETFramework\v4.0.30319] "SchUseStrongCrypto"=dword:00000001 [HKEY_LOCAL_MACHINE\SOFTWARE\Wow6432Node\Microsoft\.NETFramework\v4.0.30319] "SchUseStrongCrypto"=dword:00000001</pre> Run regedit.exe In Registry Editor, click the File menu and then click Import. Navigate to and select the strongcrypto35-enable.reg file that you created in the first step. Click Open and then click OK Exit Registry Editor. 3. For Windows 7 SP1, the client needs to install the update https://support.microsoft.com/en-us/kb/3140245 4. Restart the client.

With SSO enabled prior to upgrade, SCT Tool and OD are failed to connect CCMA after upgrading to new release

Tracking Number	CC-13655
Application	Contact Center Manager Administration
Description	For users who have already configured SSO and enabled SSO - When they upgrade their system to 7.0.3 GA, SCT and OD will fail to connect CCMA
Impact	SCT and OD fail to connect CCMA
Workaround	The workaround is to disable SSO and re-enable SSO from Security Details dialog. Steps: - Open Manager Administrator Configuration - Open Security Settings - Click Disable button - Click Yes button from the confirmation dialog - Click OK button from the information dialog - Click Enable button - Click Yes button from the confirmation dialog - Click OK button from the information dialog

CCMA- All texts in Attribute in JSON variables showed "ERROR: Could not get text: Index = 9040, Language = en-us!" for upgraded lab from 7.0.1

Tracking Number	CC-13468
Application	Contact Center Manager Administration
Description	From Scripting, open JSON variable (JSON Object, JSON String, JSON Pair), the text string shows the error "ERROR: Could not get text: Index = 9040, Language = en-us!"
Impact	Text does not explain the guidelines around JSON variable
Workaround	We need to run the command "AccessToInterSystems.exe -install ALLTEXT" at D:\Avaya\Contact Center\Manager Administration\Server\bin folder. Steps: - Open a cmd - Change the folder to D:\Avaya\Contact Center\Manager Administration\Server\bin - D:\Avaya\Contact Center\Manager Administration\Server\bin > AccessToInterSystems.exe -install ALLTEXT

Unable to access CCMA component intermittently after enabling SSO

Tracking Number	CC-14606
Application	Contact Center Manager Administration
Description	After enabling SSO via Security Settings snap-in, unable to access CCMA component intermittently, the page is stuck at loading...
Impact	Customer Impact: Cannot configure data from CCMA
Workaround	The workaround is to restart IIS service using Manager Administration Configuration -> Security Settings -> Advanced -> Restart Service.

Document the use case for UnInstallADLDS.bat

Tracking Number	CC-14620
Application	Contact Center Manager Administration
Description	Customers migrating from AACC 6.x to CC7 will restore the ADLDS instance but it is not always auto removed.
Impact	Customer Impact: ADLDS exists on the system and some Windows ADLDS events are displayed
Workaround	Users need to manually remove the ADLDS instance by running the following bat file: UnInstallADLDS.bat located in D:\Avaya\Contact Center\Manager Administration\Apps\Sysops\NESRestore

AAD launch fails from IE on some clients

Tracking Number	CC-14738
Application	Contact Center Manager Administration
Description	The launch address of AAD doesn't seem to work correctly. For example, if the user enters https://<FQDN>/agentdesktop/ where FQDN is the AACC server, the user cannot launch AAD
Impact	AAD
Workaround	User needs to clear IE browsing history and try it again or use the MSI to install AAD

CCMA Launchpad shows more items which should be hidden. This backslash issue happens with IE on both client and server

Tracking Number	CC-17167
Application	Contact Center Manager Administration
Description	CCMA Launchpad displays more items which should be hidden on AACC/ ACCS 7.0.3 and 7.1. This backslash issue happens with IE on both client and server.
Impact	Launchpad Page
Workaround	KB4491113 fixed IE backslash issue. KB4491113 resolves this issue on Windows 2012 server. KB4487011 – Windows 10 1703 (https://support.microsoft.com/en-us/help/4487011/windows-10-update-kb4487011) KB4482887 – Windows 10 1809 (https://support.microsoft.com/en-us/help/4482887/windows-10-update-kb4482887) If the issue still shows, please also check the following things for IE: a) Internet Options -> Advanced and uncheck "Always expand ALT text for images". Click Apply button. b) Go to Multimedia and check "Show pictures". Click Apply button c) Close IE and Open IE and try CCMA URL again

Installing CCMS Patch on a very large database can take 20+ minutes

Tracking Number	CC-5140
Application	Contact Center Manager Server
Description	Installing a CCMS database patch on very large databases can take 20+ minutes. This is due to re-indexing of the CCMS database tables with volume of data in the order of few million rows.

Release Notes

Impact	Longer CCMS patch install time.
Workaround	None

Agent Greeting not working when extended characters used in Skillset name.

Tracking Number	CC-12057
Application	Agent Greeting
Description	Agent Greeting experiences the following issues when extended characters (non-US-ASCII) used in Skillset name. Agent Greeting Recorder will drop the call when trying to record an Agent Greeting for a Skillset with extended characters.
Impact	Agent cannot record an Agent Greeting for Skillset with non-ASCII characters.
Workaround	None

Agent Greeting Recording not playing Welcome message or other messages as AAMS is unable to fetch wav files from AACC when security is disabled on upgraded system.

Tracking Number	CC-14728
Application	Agent Greeting
Description	Agent Greeting Recording not playing Welcome message or other messages as AAMS is unable to fetch wav files from AACC when security is disabled on upgraded system
Impact	Agent cannot hear any instructions after dialing into Agent Greeting Recorder. i.e. Welcome message, Please enter your Agent ID etc...
Workaround	1. Launch AACC Security Manager. 2. Select Security Configuration tab 3. Select Security On radio button and hit Apply button 4. Select Security Off radio button and hit Apply button This adds the parameter: sendReasonPhrase="true" to apache-tomcat server.xml HTTP connector: <pre><Connector connectionTimeout="20000" port="8081" protocol="HTTP/1.1" redirectPort="8445" sendReasonPhrase="true"/></pre>

Agent Controls Browser Application – Online help not available when using Chrome browser

Tracking Number	CC-9849
Application	Agent Controls Browser Application
Description	Online help feature is not working when using Chrome browser.
Impact	Online documentation not available with this browser type.
Workaround	Online help may be accessed using another browser.

CCT services keep restarting if no resources configured on CS1000 platform

Tracking Number	CC-11144
Application	Communication Control Toolkit
Description	In CS1K voice only deployments which do not use CCT clients, AAAD or custom CCT clients, it is possible to not have any CCT terminals configured. This leads to a scenario where some CCT services will restart continually, these being ACDPROXYService and NCCT TAPI Connector Service.
Impact	Some CCT services will restart continually, these being ACDPROXYService and NCCT TAPI Connector Service. AACC server operation may become negatively impacted if the services are allowed to keep restarting. It is therefore recommended to make the configuration changes outlined below as soon as possible.
Workaround	To avoid the CCT services from continually restarting it is necessary to have at least one CCT terminal configured. To avoid warnings being logged a valid address should also be created and mapped to the terminal. Ensure CCT has been started as the NCCTDALS service is required for configuration. Following the steps documented in "Avaya Aura® Contact Center Client Administration": 1. section "Adding an address" to add a valid address 2. section "Adding a terminal" to add a valid terminal. 3. While creating the new terminal a mapping to the address/addresses created in the first step should be added. This is done by using the "Address assignments" section of the "Update Terminal" screen. The "Update Terminal" screen is available when creating or editing a terminal. When the address and terminal, with address terminal mappings, has been successfully saved a restart of CCT is required. The restart should be performed as follows: 1. Using SCMU "Shut down CCT" button 2. Wait for all of the services to successfully stop 3. Using SCMU "Start CCT" button 4. All of the CCT service should now start successfully and stay running.

Agent Controls not working in Firefox Browser

Tracking Number	CC-11673
Application	Agent Controls Application
Description	The agent controls application will not connect to the Integration Portal web socket when launched from Mozilla Firefox browser.
Impact	It is not possible to use Agent Controls Application with Mozilla Firefox browser.
Workaround	Use another browser, for example Internet Explorer.

On one particular deployment CCMS IS_Service fails to start

Tracking Number	CC-13554
Application	Contact Center Manager Server
Description	On one particular deployment CCMS IS_Service fails to start.
Impact	Intrinsics in scripting do not have valid data.
Solution	There is no workaround. However, the problem usually disappears after a server restart.

AAD dashboard unable to zip log files from most recent startup

Tracking Number	CC-14479
Application	Agent Desktop
Description	Cannot create log Zip file when collect logs from 'Most Recent Startup' option is selected in AAD dashboard
Impact	Unable to use the collect logs from 'Most Recent Startup' option
Workaround	Use 'Last hour' or 'Specify Time and Date' options to collect logs.

AAD does not display Agent Statistics when security is on

Tracking Number	CC-13431
Application	Agent Desktop
Description	AAD will fail to display Agent Statistics if the following conditions exist: 1) Security is turned on in Security Manager (formerly known as Certificate Manager) 2) The server signed cert has SAN's configured, ie for MCHA deployments the managed name should be configured as a SAN 3) The hostname configured within CCMM Administration for CC Web Stats matches one of these SAN names. ie in MCHA the managed name is configured
Impact	If the conditions described above exist then Agent Statistics will not display in AAD
Solution	The work around is to configure (Agent Statistics) CC Web Stats to use an IP address instead of a hostname or FQDN. 1) Through CCMA launch the CCMM Administration client 2) Navigate to: General Administration -> Server Settings 3) With Server Settings selected on the left hand pane, a list of host names should be present on the right hand pane. 4) Under Server Type find an entry called CC Web Stats and change the Hostname entry to use the relevant IP address instead of a hostname or FQDN 5) In HA environments this should be the managed IP address, in all other environments this should be the CCMS server IP address

For large Contact Centers, Agent RTD may fail to load agents

Tracking Number	CC-13860
Application	Contact Center Manager Administration
Description	For a Contact Center with a very large number of configured agents, the time to load the agent records from the database may exceed the configured timeout. If the timeout is exceeded, the Agent RTD will not display the agents.
Impact	The Agent RTD will not display the agents.
Workaround	Increase the OAM Timeout to allow more time to load the agent records from the database. 1. From Start Menu, launch Manager Administration Configuration. 2. Select RTR Registry Settings. 3. Change OAM Timeout to 300000 milliseconds. 4. Accept the ICERTdService restart.

In some lab upgrades with a Local WebLM configuration, ACCS was found to be operating with grace licensing after the upgrade

Tracking Number	CC-17177
Application	Upgrade
Description	In some lab upgrades with a Local WebLM configuration, AACC was found to be operating with grace licensing after the upgrade.
Impact	The system is operating with grace licensing. Grace licensing is allowed to be in effect for 30 days.
Solution	The XML license file must be re-applied using License Manager Configuration Utility .

Creating a Prepared Response generates an error dialog popup

Tracking Number	CC-14815
Application	CCMM Administration
Description	When a user saves a new Prepared Response in CCMM Admin, a dialog pops up saying that "Prepared response body could not be updated". However the prepared response is generated successfully.
Impact	The user is given incorrect feedback on the operation
Workaround	Generate the prepared response as normal and ignore the erroneous popup.

CCMM Services not all starting on a fresh install, where Security has failed to be applied via Ignition Wizard

Tracking Number	CC-18286
Application	Ignition Wizard
Description	When a user imports certificate in Security Store Ignition Wizard can create broken certificate with alias URName.
Impact	Security fails during configuration and CCMM services not all starting on a fresh install
Workaround	Do not set security on in Ignition Wizard. Security can be applied via the "Security Manager" application after install has completed.

Localization issues

Internationalization issues or common across all languages and require a base fix

APPENDIX

Appendix A – Issues Addressed in this release

This section of the release notes provides information on customer issues that have been addressed in this Feature Pack.

CCMS, CCSU, CCCC and CCLM Defect Listing

This list contains defects addressed for the Manager Server, Common Components and License Manager Components

WI/JIRA	Summary
CC-6420	AACC 6.4 SP15: Abandoned calls not showing in Crosstab Skillset report
CC-14255	Intermittently completing a transfer results in the call getting dropped
CC-14379	Agent NRRC report is showing NotReady default reason code even though he is not set
CC-14522	FP2 ACTIV backup fails during restore to FP2 STBY - Duplicate variable names in parameter list
CC-14601	SMMC Database information shows Local license reported as not supporting Resiliency
CC-14631	SGM sends USM Active for not answered call after FailedEvent
CC-14675	UNE pads stop responding - nicmfjvm mem high
CC-14730	Phantom calls get hung in PSCAN
CC-14824	After importing the custom WSDL file, Unable to execute the queries in the WSDL and getting the SQL error 51514
CC-14831	Loss of functionality in LM config utility after upgrade to 7.0.2
CC-14905	Database Integration Wizard not working after upgrade from 6.4 to 7 SP2
CC-14909	TFE not going UP after DB Migration completed
CC-14983	DB backup taken from 7.0 FP1 system is not restoring in the FP3.
CC-14984	XMLscript returned for Master_Script is larger than the 409600*2 value currently defined
CC-15014	Unable to modify SQL statement in DIW
CC-15046	EB Discards NIEB_clCallPresentedToAgent busy Agent showing idle in RTD
CC-15068	STBY OAM not starting due to NextTFFile Memory violation
CC-15073	Offline Store requires signme.csr to become active
CC-15484	License Manager Configuration Tool shows WebLM Host ID mismatch when license file contains multiple Host IDs
CC-15647	customer uses their CRM Application and the Supervised transfer to DN or CDN fails after doing Hold/UnHold actions + noticed long delays during transfer actions. Able to complete the transfer if there are no hold/unhold in the call.
CC-15783	Grace period unlock tool crashes when processing unlock code
CC-15863	Unable to import Pem certificate
CC-15899	AACC auto SwitchOver while working on OD
CC-16496	JSON STRING to STRING conversion not working
CC-16612	The ^CCMSUpdatedOn and ^ExpressUpdatedOn globals are removed during Cache update
CC-16683	AACC Calls defaulting

CC-16727	Agent on a skillset call supervised transfer to local CM expert station which has coverage path another CDN back to AACC which is failing
CC-16799	Agents stuck after switchover
CC-16873	Calls stuck in Master script
CC-16944	unassigned skillset not getting applied on new active AACC after switchover
CC-16953	TFE Service is crashed when join two different CDN contacts with on hold music
CC-17186	RTDs not correctly showing agent status
CC-17532	CCMS_HDM stops handling historical Data and files are stuck in data folder
CC-17548	DIW cannot be used to write long JSON strings to the database
CC-17588	CCMM Screenpop isn't showing parameter when script uses ASSIGN TO with double quotes

CCMA Defect Listing

This list contains defects addressed for the Manager Administration components

WI/JIRA	Summary
CC-14690	With Finnish timeformat CCMA cannot set interval for CBC report if it overlaps noon
CC-14761	Exception in GetMMContactsWaitingData been displayed every 30 secs
CC-14787	Application RTD collection not launching from left hand side menu
CC-14935	CCMA / ACCS fp2 does not accept domain name containing underscore
CC-15022	contact summary report Select Element list not returning Contact Types list
CC-15491	CCMM auto Sign On fails for new agent following CCMA change from SAM to UPN after FP3
CC-15979	Outbound reports return no data if partition is applied
CC-16467	Loading CCMA Script variables is very slow. It takes more than 5 minutes
CC-16802	Login CCMA in production FP3 slowly when SSO is enabled
CC-16829	Creating a new agent takes 20-25 sec when including CCT Agent
CC-17618	After FP3 upgrade Private Reports disappears intermittently.
CC-18002	CCMA Script Variables modified timestamp wrong by 1 hour (after DST change)

CCMM/AAAD Defect Listing

This list contains defects addressed for the Multimedia\Outbound Server and Avaya Agent Desktop components

WI/JIRA	Summary
CC-13743	Custom POM attributes slow to load in AAD intrinsics panel
CC-14238	After RGN switchover agents are presented with Error message upon initial login
CC-14508	Not Ready Reason Codes in Random Order After Reboot
CC-14689	Agents couldn't schedule callback on POM Schedule Callback module, as AAAD sending the timeformat of the client PC - which is on Finnish locale.
CC-14709	Invalid XML when search custome so the customer history can not be displayed
CC-14726	AAAD Login Failure Takes multiple attempts to login into AAD
CC-14813	7.0.3 - AAAD – Images in Email signature cannot be displayed properly at customer site
CC-14844	EWC session stuck in the AAAD. Close contact button grey out

Release Notes

CC-14986	The NotReady time displayed in AAAD top bar is less than actual time
CC-15058	When adding a contact to a campaign via webservices priority defaults to 6
CC-15487	Un-acquired Routepoint causes high CPU when CCMM Audit runs.
CC-15496	Multitab/bar/calls in AAD when using POM.
CC-15686	Agent loses focus from email body when new message arrives to WC session
CC-16499	Agent Greeting is not getting a license if High Availability is enabled on AACC
CC-16658	Unable to re-schedule POM calls for future days, earlier than the current time
CC-16825	ACCS is corrupting attachments when transferring to external address
CC-17218	inline image not being seen properly on outlook
CC-17591	AAD sends double answercall requests for CTRL+1 usage with advanced screen pop alerting
CC-17600	Unable to enable Web stats in CCMM Admin stating: Web Stats are not enabled on CCMS
CC-18199	Application has % in the Path opening outside AAD it is replacing the % with %25
CC-9352	MM WS ReadFirstBlockOfContacts ReadLastBlockOfContacts ReadPreviousBlockOfContacts ReadNextBlockOfContacts returns bad values

Install Defect Listing

This list contains Installation defects addressed for in this release

WI/JIRA	Summary
CC-17119	configuration of Advanced screen pop up doesn't merge during patch installation

CCT Defect Listing

This list contains defects addressed for the Communication Control Toolkit components

WI/JIRA	Summary
CC-14251	Agents are reporting AAAD logouts or crashes especially after making call transfers
CC-16958	AACC 7.0.3 - NCCT TAPI Service crashes

CCMA ActiveX Control MSI – Content and Versions

File Name	File Size (bytes)	Version
ChartWrapperCtrl.ocx	57344	1.0.0.1
DTPWrapperCtrl.ocx	90112	8.0.0.0
hrctrl.dll	106496	8.0.0.4
iceemhlpcontrol.dll	122880	8.0.0.2
icertdcontrol.dll	847872	9.0.0.3
iemenu.ocx	65648	4.71.115.0
ntzlib.dll	65080	1.1.4.0
olch2x8.ocx	2102448	8.0.20051.51
rope.dll	241664	1.0.0.4
rsclientprint.dll	594432	2011.110.3128.0
sstree.ocx	337120	1.0.4.20
WSEColorText.ocx	172032	6.0.0.15
xerces-c_2_7.dll	1893832	12.5.0.1190

Appendix B – Additional Security Information

Store Maintenance – backup and restore

Backing up the Certificate Store

- 1) Ensure all services are stopped
- 2) Launch Security Manager
- 3) Go to Store Maintenance Tab
- 4) In the Backup and Restore Certificate Store section choose a location in which to create the backups. **NOTE:** do not choose a Contact Center directory structure
- 5) Press the Backup button to back up the store and its associated files
- 6) Check your chosen backup location and verify the following files are present in the directory: CCKeystore.jks, signme.csr (optional), storeInformation.txt ,storePwdEncrypt.txt

Restoring the Certificate Store

- 1) Ensure all service are stopped
- 2) Launch Security Manager
- 3) Go to Store Maintenance Tab
- 4) Select the location where your backups are stored, in the Backup and Restore Certificate Store section
- 5) Press Restore button to restore the store and associated files
- 6) Close Security Manager
- 7) Open Security Manager and confirm store has the correct content
- 8) Start Services

After restoring Certificate Store – Reset Security Level if previously set to ON

If the certificate store has been restored onto a system that contained another store and had the security level set to ON then the following steps have to be followed to apply the new stores certificates to the various web servers otherwise the previous stores certificates will remain in effect.

This procedure is only if the previous security setting was set to ON while using the previous store and the store has been restored.

- 1) Ensure all services are stopped.
- 2) Launch Security Manager.
- 3) Go to Security Configuration Tab.
- 4) Check Security level – If ON then turn OFF and then ON again.
- 5) Hit Apply button.

This effectively will remove the previous configuration settings on the various web servers and apply the contents of the new store to web servers.

Failure to follow this step will result in the various web servers using the certificates from the previous store regardless of the restore procedure.

Restoring a certificate store whose contents have been signed by another Certificate Authority

If the certificate store has been restored to a system that used another certificate authority (CA) to sign the contents of the store used previously then, if not done already, the root certificate authority certificate will have to be deployed to the various clients that communicate with the server.

If the restored certificate store has been signed by the same certificate authority then this is not required since the root CA certificates should have already been distributed.

Backing up the Certificate Store

- 1) Ensure all services are stopped
- 2) Launch Security Manager
- 3) Go to Store Maintenance Tab
- 4) In the Backup and Restore Certificate Store section choose a location in which to create the backups. **NOTE:** do not choose a Contact Center directory structure
- 5) Press the Backup button to back up the store and its associated files
- 6) Check your chosen backup location and verify the following files are present in the directory: CCKeystore.jks, signme.csr (optional), storeInformation.txt ,storePwdEncrypt.txt

Restoring the Certificate Store

- 9) Ensure all service are stopped
- 10) Launch Security Manager
- 11) Go to Store Maintenance Tab
- 12) Select the location where your backups are stored, in the Backup and Restore Certificate Store section
- 13) Press Restore button to restore the store and associated files
- 14) Close Security Manager
- 15) Open Security Manager and confirm store has the correct content
- 16) Start Services

After restoring Certificate Store – Reset Security Level if previously set to ON

If the certificate store has been restored onto a system that contained another store and had the security level set to ON then the following steps have to be followed to apply the new stores certificates to the various web servers otherwise the previous stores certificates will remain in effect.

This procedure is only if the previous security setting was set to ON while using the previous store and the store has been restored.

- 1) Ensure all services are stopped.
- 2) Launch Security Manager.
- 3) Go to Security Configuration Tab.
- 4) Check Security level – If ON then turn OFF and then ON again.
- 5) Hit Apply button.

This effectively will remove the previous configuration settings on the various web servers and apply the contents of the new store to web servers.

Failure to follow this step will result in the various web servers using the certificates from the previous store regardless of the restore procedure.

Restoring a certificate store whose contents have been signed by another Certificate Authority

If the certificate store has been restored to a system that used another certificate authority (CA) to sign the contents of the store used previously then, if not done already, the root certificate authority certificate will have to be deployed to the various clients that communicate with the server.

If the restored certificate store has been signed by the same certificate authority then this is not required since the root CA certificates should have already been distributed.

TLS Information

Non-mandatory TLS SIP connections

Session Manager releases TLSv1 support

SM Release	TLS v1.0 support	TLS v1.1 support	TLS v1.2 support	Options
7.0.1	Yes	Yes	Yes	
7.1	No	No	Yes (Greenfield sites only)	Minimum TLS version in SM R7.1 will be inherited from the release upgrading from The 7.1 SM EM running on SMGR will set the network global default to TLS 1.2 if it sees no SMs administered in the DB

Avaya Aura Media Server releases and TLSv1 support

AAMS Release	TLS v1.0 support	TLS v1.1 support	TLS v1.2 support	Options
8.0	No	No	Yes	Configurable (via Element Manager) TLSv1.0 or TLSv1.1 can be set instead if required

Known applications and services that cannot support TLS v1.2

HDX / DIW connection to databases

HDX / DIW can be used to connect to customer databases. HDX / DIW connect to a remote database using an ODBC Data Source Name (DSN). The DSN for the database connection must be manually created on AACC using the ODBC Data Source Administrator.

If connecting to older versions of Microsoft SQL Server, the DSN created will not connect successfully if TLS is set to higher than TLS v1.0. In this scenario, enable TLS v1.0 on Security Manager Security Configuration field "CCMA – Multimedia Web Service Level".

Remote desktop

Remote desktop connections can also be impacted on some client machines and requires a Microsoft KB required to remote into AACC server when TLS v1.1 or higher is set due to RDC only supporting TLS v1.0. Disabling TLS 1.0 on the CCMA- Multimedia web services setting in Security Manager will break RDP under default settings on Windows 7 clients and Windows 2008 R2 Server.

This setting covers the entire AACC server and not only CCMA-MM WS and thus causes remote desktop connections to fail from Windows 7 and Windows 2008 R2 server due to the fact it cannot support TLS v1.1 or TLS v1.2.

Please apply the following KB from Microsoft on your CLIENT or machine wishing to connect to CC server.

This update provides support for Transport Layer Security (TLS) 1.1 and TLS 1.2 in Windows 7 Service Pack 1 (SP1) or Windows Server 2008 R2 SP1 for Remote Desktop Services (RDS).
<https://support.microsoft.com/en-us/kb/3080079>

System Manager 7.0

System Manager 7.0 and earlier releases do not support TLS 1.1 and TLS 1.2

If implementing a Single Sign-On configuration using System Manager to login to CCMA then if TLS 1.1 or TLS 1.2 is enabled the System Manager login page will not be presented.

System Manager 7.0.1 includes support for TLS 1.1 and TLS 1.2