



Avaya Contact Center Select

Release 7.1.0.2

Release Notes

This document contains information on software lineup, known issues and workarounds specific to this release of Avaya Contact Center Select.

TABLE OF CONTENTS

Purpose.....	3
Publication History	3
Software Information	4
Hardware Appliance	4
Software Appliance.....	4
DVD Product Installation.....	5
Release Pack Bundle	5
Additional Required Updates.....	6
Additional Optional Updates	7
Switch Software Support	9
Avaya IP Office Software.....	9
Platform Vendor Independence (PVI)	10
Hardware Requirements.....	10
Recommended Network Adapter	10
Operating System & Virtualization	11
Operating System Information	11
Microsoft Operating System Updates	13
Internet Explorer Support.....	15
Microsoft .NET Framework Support	15
VMware Support.....	15
Deployment & Configuration Information	16
Pre-Installation Considerations.....	16
Installation	19
Post-Installation Configuration	24
Workspaces on Avaya Contact Center Select.....	27
Deployment	27
Post-Deployment	32
Workspaces with ACCS Business Continuity.....	33
Workspaces Troubleshooting	34
Security Information.....	36
Localization.....	41
Overview of I18N and L10N Products & Components.....	41
Language specific support and configuration.....	42
Start Localized AAD Client.....	45
Troubleshooting.....	46
Known Issues	47

Release Notes

Hardware Appliance	47
Software Appliance.....	47
Installation	47
Workspaces on ACCS	48
Application\Features	50
Localization issues.....	61
Appendix.....	62
Appendix A – Issues Addressed in this release	62
Appendix B – Additional Security Information	65

PURPOSE

This document contains known issues, patches and workarounds specific to this build and does not constitute a quick install guide for Contact Centre components. Please refer to the information below to identify any issues relevant to the component(s) you are installing and then refer to the Avaya Contact Center Select Installation and Commissioning guides for full installation instructions

PUBLICATION HISTORY

Issue	Change Summary	Author(s)	Date
1.0	Generally Available Release	CCReleaseEng	4-Oct-2019
2.0	Update document metadata	CCReleaseEng	7-Oct-2019
2.1	Updated KNOWN ISSUES: Installation	CCReleaseEng	8-Oct-2019
3.0	Add GA Patch Bundle details	CCReleaseEng	16-Oct-2019

SOFTWARE INFORMATION

Hardware Appliance

There are no software downloads associated with the Hardware Appliance deployment

Software Appliance

The following are the files required to deploy Avaya Contact Center Select, Release 7.x into a virtualization environment. Please ensure you are using this version for all new software installation.

Avaya Aura Media Server OVA

File Name	MD5 Checksum
MediaServer_8.0.0.169_A6_2018.10.24_OVF10.ova	eda4b84b51ab9447d78755a3e2d31af8

Avaya WebLM OVA

The Avaya WebLM 8 OVA is the required software when deploying the OVA in a virtualisation environment. This software is used for product licensing. Please download this software from <http://support.avaya.com>

File Name
WebLM-8.0.0.0.9-31370-e65-14.ova

Workspaces Cluster

The Avaya Contact Center Select Workspaces OVA is required when deploying the workspaces cluster in a virtualization environment. The software provides the base image and software for the deployment of the Avaya Contact Center Select Workspaces Cluster.

Filename	MD5 Checksum
ACC_WORKSPACES_OVA_BASEIMAGE-1569412280.ova	32cdfab7d4ef0b498dce24ace91ea5f3

DVD Product Installation

The following are the files required when deploying Avaya Contact Center Select using the Avaya Contact Center Select DVD. Please note, as part of the deployment of the product you are required to install the latest available service pack bundle when installing the product.

The supported Avaya Contact Center Select DVD version is outlined below. Please ensure you are using this version for all new software installation.

Filename	MD5 Checksum
ACCS _7.1.0.2-16.iso	c291036753593b2418057e52aa7e4181

Important Note:

Information on the latest updates available with this release are documented in the **Release Pack Bundle** section below.

Release Pack Bundle

The Avaya Contact Center Select software is delivered to customers as a Release pack bundle. The Release Pack is installed on your base software and contains the latest software updates for the release.

Filename	MD5 Checksum
ACC_7.1.0.2-74.zip	621629f47775ca772abcd07c754cb196

Additional Required Updates

Avaya Contact Center Select Server

The following are additional Avaya Contact Center Select updates containing critical fixes that must be applied to your system.

File Name	MD5 Checksum
ACC_7.1.0.2_FeaturePack00ServicePack02_GA_Patches-29.zip	676cc3eac7d4bb6c306aeca3f40459a8

You must download all files listed. Please verify the MD5 checksums after download to ensure all files have been downloaded successfully.

Avaya Contact Center Select Workspaces Cluster

The following updates contain critical fixes that must be applied to your Workspaces Cluster

File Name	MD5 Checksum

Avaya Aura Media Server OVA and Hyper-V Upgrade

The AAMS OVA version is: 8.0.0.169. Both need to be upgraded to the latest version. The Media Server needs to be updated to 8.0.0.205 and the System layer needs to be updated to 16. This is accomplished by downloading the two ISO files in the table below.

This procedure is detailed in document: "Upgrading and patching Avaya Aura® Contact Center"

File Name	MD5 Checksum
MediaServer_Update_8.0.0.205_2019.04.29.iso	32ff99844e1d40d3c9f0d9341307f829
MediaServer_System_Update_8.0.0.16_2019.04.05.iso	5bd8c1d0ada215088b03571350185924

Additional Optional Updates

ASG Plugin

The ASG Plugin is a serviceability application which enables secure access to the server when installed using a challenge-response mechanism. This update removes the presence of unnecessary accounts which are given permission to access the files in the applications directory. This effectively restricts access to the applications files to administrator users only.

The ASG Plugin currently placed on the server, not installed, does not have this patch and if required this version can be downloaded and placed on the server instead of the incumbent version.

This is optional in that only if you wish to install and use this plugin should it be installed; otherwise it is not required for normal Contact Center operations

File Name	MD5 Checksum
ASGPlugin4WindowsX64.zip	76aaa6844a4863a86884d19a0b409558

SNMP Trap Configuration File

An SNMP Trap Configuration File (.cnf) is delivered containing the Avaya recommended events for SNMP capture. The configuration file can be imported into the SNMP Event Translator that is available after installing SNMP on the Windows Server. SNMP traps will be automatically generated and forwarded to the configured NMS system for all Event Viewer events that have a match in the configuration file.

The SNMP Trap Configuration File can be imported into the SNMP Event Translator using evntcmd.exe from the command prompt. A restart of the SNMP service is required after which the file content can be viewed using the SNMP Event Translator GUI (evntwin.exe). Exact details for the procedure are available in Windows Server 2012 R2 and Windows Server 2016 documentation.

The SNMP Trap Configuration File is available for download from the support site.

This is optional in that it should only be imported if you wish to forward SNMP traps to an NMS system for treatment or monitoring. Otherwise it is not required for normal Contact Center operations.

Note: As detailed in the ACCS deployment guide, SNMP should be installed on the Windows Server prior to deployment of the ACCS application.

File Name	MD5 Checksum
ACC_7_1_SNMP_Trap_File_ver1_0.cnf	08a97caf629637aa7f9b4d9cd31beb8e

Patch Scanner

This Patch Scanner utility is released with every Release Pack and Patch bundle from ACCS 6.4 SP13 onwards. If you are moving from an Avaya Contact Center Select 6.4 lineup to Avaya Contact Center Select 7.x you must use the version of the Patch Scanner published in the 7.x Release Notes document.

This version of the tool can be used prior to moving to Avaya Contact Center Select 7.x. See readme with the application zip file for further information.

File Name	MD5 Checksum
N/A	N/A

Migration Tool for RCW Generated Reports

This application is required when exporting Historical Reporting templates on an NES6/NES7/ACC 6.x server as part of a server migration. The most up to date version of the application is available with the Service Pack from the ACCS lineup above.

The utility is available in: **Install Software\CCMA\RCW_Migration_Utility**

SWITCH SOFTWARE SUPPORT

Avaya IP Office Software

This section outlines the software requirements for the Avaya IP Office communications infrastructure

Avaya Contact Center Select 7.1 supports integration with the following:

- Avaya IP Office 10.1
- Avaya IP Office 11.0 Feature Pack 4

Phone Compatibility updates with Avaya IP Office 10.0

Phone Compatibility
Digital 5400 series are not supported with IPO 10.0 or later
Digital 4610/4620x series and 5600 series is not supported with IPO 10.0 or later
IP Phones 1120e and 1220 are supported when running IP Office Release 10.0 or later SIP firmware.

PLATFORM VENDOR INDEPENDENCE (PVI)

Hardware Requirements

For Single Server deployments of, Voice and Multimedia with Avaya Media Server with/without Workspaces on a physical platform, a Gigabit Network Adapter is required that supports Receive Side Scaling (RSS) with 4 RSS queues.

Single Server deployments of, Voice and Multimedia with Avaya Media Server with/without Workspaces, are supported on physical mid-range to high-end servers only, as defined in Avaya Aura Contact Center Overview and Specification document. Lab and customer deployments must adhere to the minimum RAM requirements. Failure to do so can result in Avaya Aura Media Server being unable to launch.

Single Server deployments of, Voice and Multimedia with Avaya Aura Media Server, now deploy AAMS as a Hyper-V Linux virtual machine. Workspaces is also deployed as a Hyper-V Linux solution. A hardware requirement is that CPU Virtualization / Virtualization Technology is enabled in the host Windows Server BIOS. The available virtualization settings vary by hardware provider and BIOS version. Read your hardware provider's documents covering virtualization support to determine which settings to configure. This is commonly found in BIOS *System Settings* -> *Processor settings*.

Refer to document *AACC Overview and Specification* for additional information on Hardware requirements.

Recommended Network Adapter

The following RSS capable Gigabit Network adapter has been tested successfully with Single Server deployments – **Intel(R) Gigabit 4P I350-t Adapter**

OPERATING SYSTEM & VIRTUALIZATION

Operating System Information

All Avaya Contact Center Select server applications are supported on the following operating systems:

- Windows Server 2012 R2 Standard (64-bit Edition)
- Windows Server 2012 R2 Data Center (64-bit Edition)
- Windows Server 2016 Standard with Desktop Experience
- Windows Server 2016 Standard Datacenter (64-bit Edition)

This release no longer supports the Avaya Aura Media Server (AAMS) installed co-resident with ACCS on a Windows Server platform. A single box solution where ACCS and AAMS are running on the same physical server is achieved by deploying the AAMS OVA as a virtual server on the Windows Server with Hyper-V manager. This is applied in both fresh installations and upgrades.

AAMS is supported on Red Hat Enterprise Linux (RHEL) 7.x 64-bit OS. It is not supported 32-bit RHEL. It is not supported on any other version of Linux.

Microsoft Windows Server Updates

Before deploying any new Windows Security Patches and Hotfixes – you must confirm that any Windows patches are listed as supported in the Avaya Contact Center Select Security Hotfixes and Compatibility listing – published every month on support.avaya.com.

Ensure that you do not enable Automatic Updates on your Avaya Contact Center Select Server or Client PCs. All Windows Security patches and hotfixes must be manually deployed after consulting the supported Avaya Contact Center Select Security Hotfixes and Compatibility listing.

Windows Server 2012 R2

Currently, please do not install **KB4340558** (specifically sub component **KB4338419**) or **KB4340006** (specifically sub component **KB4338605**) on your Avaya Contact Center Select Server. Refer to Avaya Aura® Contact Center Security Hotfixes and Compatibility listing for updates relating to **KB4340558** or **KB4340006**.

Additionally, install all required Microsoft Operating System update listed in the section of this document.

Windows Server 2016 with Desktop Experience

Please apply all available Microsoft hotfixes as per the Avaya Contact Center Select Security Hotfixes and Compatibility listing

Red Hat Enterprise Linux Updates

AAMS is only supported on Red Hat Enterprise Linux (RHEL) 7.x 64-bit servers.

For an AAMS installed on a customer installed RHEL 7.x 64-bit server, it is mandatory to register the RHEL OS with Red Hat Networks (RHN) and to apply all the latest updates. AAMS is tested regularly against all the latest RHEL updates.

The AAMS VMWare OVA Hyper-V installation ships with the most recent RHEL security updates as of GA. Avaya supplied RHEL updates as an AAMS System Update ISO file that is uploaded and applied using AAMS Element Manager. AAMS System updates are released as part of a Service Pack release. The OVA or Hyper-V AAMS do not need to register with Red Hat Networks.

CentOS Linux Updates

The Workspaces VMWare OVA and Hyper-V installations ship with the all the most recent CentOS security updates as of GA.

Before conducting a yum update of any new CentOS packages you must confirm whether any CentOS package updates are excluded, and not to be installed, by checking the Avaya Aura® Contact Center Security Hotfixes and Compatibility listing – published every month on support.avaya.com.

Microsoft Operating System Updates

The section outlines additional Microsoft Updates that must be applied to your system. Click on the link below to bring you directly to the KB article on the update.

Windows Server 2012 R2

Update ID	Summary
KB3100956	You may experience slow logon when services are in start-pending state in Windows Server 2012 R2

Important Notes:

1. **Important** If you install a language pack after you install this update, you must reinstall this update. Therefore, we recommend that you install any language packs that you need before you install this update. For more information, see [Add language packs to Windows](#).

Update ID	Summary
KB2973337	SHA512 is disabled in Windows when you use TLS 1.2

Important Notes:

1. **Important** Do not install a language pack after you install this update. If you do, the language-specific changes in the update will not be applied, and you will have to reinstall the update. For more information, see [Add language packs to Windows](#).
2. This KB is contained in KB2975719 (see below)

Update ID	Summary
KB2975719	August 2014 update rollup for Windows RT 8.1, Windows 8.1, and Windows Server 2012 R2

Important Notes:

1. **Important** When you install this update (2975719) from Windows Update, updates 2990532, 2979582, 2993100, 2993651, and 2995004 are included in the installation.

Update ID	Summary
KB3101694	"0x000000D1" Stop error in Pacer.sys when there's heavy QoS traffic in Windows Server 2012 R2

Important Notes:

1. **Important** If you install a language pack after you install this hotfix, you must reinstall this hotfix. Therefore, we recommend that you install any language packs that you need before you install this hotfix. For more information, see [Add language packs to Windows](#).
2. **Important** This KB should only be applied to servers which include Avaya Aura Media Server on Windows Server 2012 R2, i.e. where ACCS and AAMS have been installed co-resident on a single physical server. It is not required on any deployment which does not include Avaya Aura Media Server on Windows Server 2012 R2.

Update ID	Summary
KB3140245	Update to enable TLS 1.1 and TLS 1.2 as a default secure protocols in WinHTTP in Windows

Important Notes:

1. **Important** This hotfix is required for windows 7 SP1 clients. Do not apply to ACCS server.
2. **Important** Please read the Microsoft update at the link provided, as there are manual steps required with this hotfix.
3. **Important** This update is **NOT** required if Security Manager on ACCS server has Current TLS Protocol Level for CCMA-MM set to TLSv1.0.

Update ID	Summary
KB4517298	Addresses an issue in which the following may stop responding and you may receive the error, "Invalid procedure call": <ul style="list-style-type: none">- Applications that were made using Visual Basic 6 (VB6).- Macros that use Visual Basic for Applications (VBA).- Scripts or apps that use Visual Basic Scripting Edition (VBScript).

Windows Server 2016 with Desktop Experience

Install the latest updates available as per the recommendations in the Avaya Contact Center Select Security Hotfixes and Compatibility listing.

Update ID	Summary
KB4512495	Updates an issue with downloading copyrighted digital media (music, TV shows, movies, and so on) from certain websites using Microsoft Edge and Internet Explorer. Updates an issue that causes File Explorer to intermittently stop working.

Internet Explorer Support

Element Manager and CCMA require that Internet Explorer 10.0 and Internet Explorer 11.0 be configured to run the web sites in “Compatibility Mode”.

Microsoft support indicates that some websites might not display correctly in Windows Internet Explorer 10 or Internet Explorer 11. For example, portions of a webpage might be missing, information in a table might be in the wrong locations, or colors and text might be incorrect. Some webpages might not display at all.

If a portion of the webpage doesn't display correctly, try one or more of the following procedures:

Note: IE Compatibility Mode must be enabled on IE 10.0 and IE 11.0.

To turn on Compatibility View

1. Open Internet Explorer by clicking the Start button
2. In the search box, type Internet Explorer, and then, in the list of results, click Internet Explorer
3. From the *Tools* menu select the *Compatibility View settings* option and add the relevant website address to the list of websites

The supported browser is Microsoft Internet Explorer 10.0 or later (**32 Bit only** – 64 Bit not supported).

NOTE: If Avaya Agent Desktop (AAD) is used on a client desktop then individual websites for CCMA and Element Manager should be added to compatibility view. The “Display all websites in Compatibility View” setting in IE should not be used on these client.

The Avaya Agent Desktop (AAD) embedded browser defaults to IE 10 on clients with IE 10.0 or later.

Microsoft .NET Framework Support

Avaya Contact Center Select 7.1.0.2 is not dependent on a specific version of Microsoft .NET Framework. This release supports Microsoft .NET Framework 4.6.2 through 4.7.x

VMware Support

Avaya Contact Center Select 7.1.0.2 supports VMware vSphere 6.5 and 6.7

ESXi/vCenter 6.5 Limitations

Deploying OVA's to an ESXi 6.5 host using the desktop vSphere Client is not supported by VMware and the vSphere Web Client or Host Client must be used instead. It is recommended that you use vSphere Web Client (<https://FQDN-or-IP-Address-of-VC/vsphere-client>) when deploying new OVA's since there are known issues with the Host Client (<https://FQDN-or-IP-Address-of-ESXi-host/UI>).

The following issues exist when using the Host Client to deploy OVA:

- During deployment you are not prompted to select a profile. To work around this, you will need to manually edit the VM Virtual Hardware settings before powering the VM on.
- Properties specified when deploying OVA are ignored and they must be re-entered during the first boot process. Drop-down lists are not provided, and property defaults are not populated.

DEPLOYMENT & CONFIGURATION INFORMATION

Pre-Installation Considerations

Tools for extracting software

It is advised that you utilize the latest versions of your preferred tools for unpacking the Avaya Contact Center Select software.

Important - Default Out-of-Box Certificate Removal

Removal of Default Out-of-box Certificates

Default out-of-box certificates will be removed during the installation of the Contact Center 7.1.x.x Release. Custom certificates **must** be applied to your system before upgrade begins, or after upgrade completion, using the Security Manager application.

Failure to create custom security certificates prior to or after the upgrade to 7.1.x.x will result in the loss of functionality, specifically the TAPID link to IPO on Avaya Contact Center Select (if IPO has not been configured to accept TCP connections).

As well as the loss of functionality any previously secure connections will now not be secure until custom security certificates are put in place.

Removal of default certificates from the Contact Center server will result in additional configuration on other services that make up the solution, such as IPO, as they will have to be setup to accept the new custom certificates.

Disable Windows Automatic Maintenance

Windows Server 2012 R2

Windows Server 2012 R2 and 2016 provides a centralized mechanism for maintaining the operating system. This feature is called Automatic Maintenance and is used to carry out tasks such as hard disk defragmentation and application of Microsoft Windows updates among others.

This mechanism can sometimes interfere with the deployment of Contact Center software, resulting in failed installations. It is recommended that this feature be disabled for the duration of Contact Center software installs.

To disable Automatic Maintenance:

1. Start – Run ‘Taskschd.msc’
2. In the Task Scheduler Library browse to Microsoft – Windows – TaskScheduler
3. Select the *Idle Maintenance* task, right-click and choose ‘Disable’
4. Select the *Regular Maintenance* task, right-click and choose ‘Disable’
5. Alternatively, modify the properties of the *Regular Maintenance* task and ensure it is not set to run during your installation maintenance window.

After installation is complete you may re-enable Automatic Maintenance

To enable Automatic Maintenance:

1. Start – Run ‘Taskschd.msc’

2. In the Task Scheduler Library browse to Microsoft – Windows – TaskScheduler
3. Select the *Idle Maintenance* task, right-click and choose 'Enable'
4. Select the *Regular Maintenance* task, right-click and choose 'Enable'

Disable Windows Updates

Windows Server 2012

The download and installation of Windows Updates, during the installation and configuration of Contact Center software, can severely impact the fresh install and upgrade processes.

Microsoft Updates must be disabled before the Contact Center installation and configuration phase, however only after all applicable windows updates have been applied.

To disable Microsoft Updates:

1. Launch the *Windows Control Panel*
2. Click *System and Security*
3. Click *Windows Update*
4. Click *Change settings*
5. In the available drop down, choose the option to *Never check for updates (not recommended)*

Windows Server 2016 with Desktop Experience

The download and installation of Windows Updates, during the installation and configuration of Contact Center software, can severely impact the fresh install and upgrade processes.

Microsoft Updates must be disabled during the Contact Center installation and configuration phase.

To disable Microsoft Updates:

1. Start – Run *gpedit.msc*
2. Browse to Computer Configuration \ Administrative Updates \ Windows Components \ Windows Update
3. Locate the *Configure Automatic Updates* setting
4. Note the current setting so that it can be reverted to later
5. Double-click on *Configure Automatic Updates* and select the *Disabled* radio button option
6. Click Apply
7. Click OK
8. Exit *gpedit.msc*

After installation and configuration of Contact Center software is complete, you may revert this setting to its original value.

Voice & Multimedia Contact Server with Avaya Aura Media Server

Avaya Contact Center Select no longer supports the Avaya Aura Media Server (AAMS) installed co-resident with ACCS on a Windows Server platform. This release achieves a single box solution where ACCS and AMS are running on the same physical server by deploying the AAMS OVA as a virtual server on the Windows Server 2012 or 2016 Hyper-V Manager. This is applied in both fresh installations and upgrades scenarios.

Hardware considerations:

- CPU Virtualization / Virtualization Technology must be enabled in the host Windows Server BIOS. The available virtualization settings vary by hardware provider and BIOS version. Read your hardware provider's documents covering virtualization support to determine which settings to configure. This is commonly found in BIOS System Settings -> Processor settings
- The Hyper-V deployment of Linux AAMS 8.0 is only supported on physical mid-range to high-end servers as defined in Avaya Aura Contact Select Solution Description document. Lab & site deployments must adhere to the minimum RAM requirements

Software considerations:

- As in previous releases, you cannot deploy a Voice and Multimedia Contact Server with AAMS in a virtual environment. This will be blocked by the Universal Installer and Avaya Release Pack Installer applications
- The AAMS should be upgraded or patched following the AAMS procedures for virtual deployments as outlined in product documentation. For ACCS 7.0.3 and later releases, the co-resident Linux based AAMS Hyper-V image will not be upgraded or downgraded using the Avaya Release Pack Installer.
- If upgrading from ACCS 7.0.2 or earlier, it is necessary to manually backup the AAMS database BEFORE upgrading the ACCS and restore the AAMS database post upgrade to ensure that all media files are preserved. Detailed steps are documented in the *Backing up the Avaya Aura® Media Server database* and *Restoring the Avaya Aura® Media Server database* sections of the *Upgrading and patching Avaya Contact Center Select* user guide.

Orchestration Designer Scripts

Before upgrading you must ensure that all scripts are validated and compile successfully in Orchestration Designer.

Installation

New Installations

Install-time Patching

Install-time patching is mandatory for Avaya Contact Center Select software deployments using the provided DVD media.

Reboot required before Ignition Wizard

After the Universal installer has completed, a reboot is required before launching the Ignition Wizard. If a reboot prompt is not displayed, please reboot the system anyway before launching the Ignition Wizard. Failure to do so may result in an Ignition Wizard failure.

Mandatory Execution of Ignition Wizard – Patch Deployments

After deployment of the ACCS software using the DVD installer, if the Ignition Wizard process is deferred, it will not be possible to install Patches (DPs) either via Update Manager or manually (double-clicking on the installer file). Successful execution of the Ignition Wizard prior to applying Patches to the system is **mandatory**.

This does **not** affect the removal or reinstallation of ACCS Release Packs, only ACCS Patches (DPs).

System Backup after Ignition (IMPORTANT)

A full ACCS backup must be taken after the ignition process has completed and before the system is commissioned or used.

This is important for systems that will be used as migration targets. The CCMA data can only be migrated to a system that does not contain any customer data. The CCMA migration will fail if the system is found to contain data other than what was injected by the Ignition Wizard.

If the CCMA migration fails in this way, the solution is to go back to the post-ignition backup or re-install the system.

Upgrades

Direct upgrades from 7.0.0.0 and 7.0.0.1 to 7.1.x.x are not supported. You must first upgrade to 7.0.1.x before upgrading to 7.1.x.x

Encrypted databases must be un-encrypted before performing the upgrade. Encrypted databases are unencrypted using Security Manager.

Avaya Release Pack Installer

A new application is provided within the Avaya Contact Center Select Release Pack bundle called the Avaya Release Pack Installer (RPI). This application provides an automated method of updating existing Avaya Contact Center Select 7.x software and must be used when upgrading to this software release.

The application will perform the following actions

1. remove all installed ACCS 7.x.x.x Product Updates (Feature Pack/Service Packs and Patches)
2. remove all unwanted ACCS Third Party software
3. install required Third Party Software for the release
4. install the latest ACCS software from within the release pack bundle
5. install GA Patches from any available GA Patch bundle

Application Location:

The Avaya Release Pack Installer is contained within the Release Pack bundle in folder 'AvayaReleasePackInstaller'. The application supports the installation of Generally Available Patch bundle content. Please note, the Avaya Release Pack Installer is run via the setup.exe and NOT the AvayaReleasePackInstaller.exe.

Reboot Prompts

Before running the Avaya Release Pack Installer application, if the operating system or other installed software display prompts for a reboot, please reboot your system.

If additional reboots are required during execution of the Avaya Release Pack Installer application, a prompt will be displayed to the user.

All reboot prompts should be actioned – failure to reboot when requested will adversely affect the installation of software.

Limited Patch Installation

The Avaya Release Pack Installer application does not support the installation of limited patches. To deploy limited patches the Update Manager application must be used.

Note: If upgrading, the Avaya Contact Center Select Update Manager application resident on the system will fail to install the ACCS 7.1.x.x Release Pack software. This is due to third party software changes between ACCS 7.0.x.x and ACCS 7.1.x.x

Note: It is not possible to install Generally Available patch (DP) content until the Ignition Wizard has been run successfully.

Update Configurator

A new application is provided within the Avaya Contact Center Select Release Pack bundle called the Update Configurator. This application provides an automated mechanism to deploy and configure the Linux Hyper-V AAMS upgrade and the Avaya Contact Center Select Workspaces Cluster. This application will launch automatically after the Avaya Release Pack Installer reboot has completed.

Downgrades

Important: Direct downgrades from 7.1.x.x to 7.0.0.0 or 7.0.0.1 are not supported. You must downgrade from 7.1.x.x to 7.0.1.x first, before downgrading to 7.0.0.x

If local WebLM is used then turn off security using Security Manager before downgrade to 7.0.x. Security can be re-enabled after downgrade is finished.

Avaya Release Pack Installer

To downgrade to an earlier 7.0.3.x, 7.0.2.x, 7.0.1.x, or 7.1.0.x release, you must use the Avaya Release Pack Installer which accompanies that target release.

E.g. if the downgrade target is release 7.0.1.1, you must download the complete 7.0.1.1 release bundle from the support site.

Instructions:

Refer to the Release Notes for the target Release for downgrade instructions.

High Availability Maintenance Utility

After a downgrade, certain High Availability and Configuration information is lost. It is therefore necessary to run the High Availability Maintenance Utility to restore this information.

This utility should be run after ARPI has been run and completed the downgrade, but before the Server has been rebooted.

Application Location:

The High Availability Maintenance Utility is installed with this release of the software and can be found in the following location:

D:\Avaya\Contact Center\Common Components\HighAvailabilityMaintenance\HAMaintenance.exe

Instructions:

1. Launch the HAMaintenance.exe from the above location.
2. Use the Browse button to select the correct file to import.
 - a. The correct file will be in the .:\Avaya\Cache\Cachesys folder and will be named SYSDataExport-YYYY-MM-DD-tttt.xml where “YYYY-MM-DD-tttt” are a date/time stamp of when the file was created.
 - b. If there are multiple files with this naming format then the newest one should be selected.
3. Once a file has been selected, click the Import button.
4. Progress will be indicated on the screen and a MsgBox will be presented to the user when the import has completed. The Import should take no longer than 5 minutes.

Avaya Aura Media Server

For co-resident Voice and Multimedia Contact Center with AAMS it is not possible to downgrade the Linux Hyper-V AAMS once it has been deployed and configured. The newly upgraded Hyper-V AAMS 8.0 can be maintained and is supported with ACCS 7.0.2 onwards.

Post-Installation Configuration

Agent Controls Browser Application – Mandatory certificate with IOS 9

From IOS9 any IOS device running the Agent Controls Browser Application to connect to ACCS will be required to provide a certificate.

Multimedia Prerequisites for server migration

This is only applicable to users migrating to new servers and keeping the same server names:

In this scenario users must select the same Multimedia Database Drive during the ACCS 7.0 install as contained in Backup. If post install, users migrate a database backup from a previous version of AACS and the Multimedia Database drive defined in the backup does not match the Multimedia Database drive selected during the 7.0 install users will be unable to open attachments that were restored from the backup.

Server Utility - Users.

All customer created desktop users in Contact Center Server Utility have their passwords reset during the upgrade. To update the passwords to the correct values, use Contact Center Server Utility to delete and recreate all of the customer created users.

Avaya Aura Media Server

Avaya Aura Media Server Configuration

The following configuration must be carried out on all AAMS servers (VMWare OVA and Hyper-V).

1. Launch AAMS Element Manager and browse to **System Configuration >> Network Settings >> General Settings >> Connection Security**
2. Un-tick "**Verify Host Name**" setting and hit the "**Save**" button followed by "**Confirm**".
3. If using TLS SRTP media security then skip to step 6.
4. Browse to **System Configuration >> Network Settings >> General Settings >> SOAP**
5. Add ACCS IP Address into **SOAP Trusted Nodes**.
6. Hit the "**Save**" button followed by "**Confirm**".
7. Browse to **System Configuration >> Signalling Protocols >> SIP >> Nodes and Routes**
8. Add ACCs IP Address into **SIP Trusted Nodes**.
9. Ensure that AAMS can resolve both the hostname and Fully Qualified Domain Name (FQDN) of the CCMA server by pinging the CCMA hostname and FQDN from the AAMS.
 - Name resolution can be achieved either by using a DNS server or editing the hosts file on the AAMS.
 - The AAMS OVA and Hyper-V deployments do not allow root ssh access, so the ability to edit the hosts file is provided in Element Manager:
 - On EM navigate to **System Configuration > Network Settings > Name Resolution** and enter the hostname and FQDN name resolution of the CCMA server.
 - On PVI AAMS running on customer supplied Red Hat servers, EM does not provide Name Resolution functionality. Host and FQDN resolution need to be added to **/etc/hosts** file on Red Hat server.

Avaya Aura Media Server - Upgrade - License

If the AAMS *Element Manager* -> *Element Status* is displaying "*Media Server instance is not licensed*" then the following configuration steps must be carried out to update the AAMS license:

1. On ACCS launch SCMU and navigate to LM tab

2. Shut down License Manager
3. Start License Manager

Avaya Aura Media Server - Upgrade - Service Status

If the AAMS *Element Manager* -> *Element Status* -> *Service Status* is displaying *Stopped* state, and it is not possible to Start AAMS via Element Manager then the following configuration steps must be carried out to update the Service Status:

1. Open an SSH session to the AAMS e.g. using putty
2. Login with cust and <custpw> entered during configuration.
3. At the prompt enter 'reboot' and 'y' to confirm
4. Allow time for the AAMS to restart and verify the state is Started in Element Manager -> Element Status -> Service Status

Supporting Powered by Avaya Deployment

A new licensing capability is introduced in ACCS 7.0.3.0 to support ACCS deployment in a *Powered by Avaya* cloud environment. *Powered by Avaya* licenses are temporary and expire after 14 days. The licenses are automatically renewed 3 days before the licenses expire. The new licensing capability provides the mechanism to force ACCS License Manager to load the renewed licenses.

A new configuration field is introduced to the configuration tab of **License Manager Configuration Tool**. The *Reload Before Expiry (Hours)* field defines when the license reload will occur. The new configuration field is present for all deployments. The default value in the field is zero. The zero value indicates that the reload is not enabled. To enable the capability, the value in the field must be greater than zero. As licenses are renewed 72 hours before expiry, an appropriate value will be less than 72 hours.

WebLM

WebLM provides Contact Center licensing in an ACCS deployment. A WebLM instance is available as part of ACCS. This instance is called **Local WebLM**. Alternatively, an independent WebLM can be deployed using the WebLM OVA. The independent WebLM is called **Remote WebLM**. Local WebLM and Remote WebLM are supported on all ACCS deployment platforms and all ACCS deployment configurations.

WebLM generate a unique ID to identify the WebLM instance. The ID is called **Host ID**. The Host ID is used to lock a license file to the customer deployment. The Host ID is generated by WebLM and is published as a server property in the Web License Manager web application. For Local WebLM, the web application can be accessed from <https://localhost:8444/WebLM>. For Remote WebLM, the web application can be accessed from [https://\[HOST\]:52233/WebLM](https://[HOST]:52233/WebLM).

The Host ID generated by WebLM for a virtualized deployment is a function of the IP address and the VMware UUID. To guarantee a constant Host ID is generated by WebLM in Business Continuity deployments, configure the managed IP address lower than both the active and standby IP addresses. Managed IP address configuration is effected using the Business Continuity configuration utility.

EWC – Server name change procedure: Steps when removing CCMM patches

This section is only applicable to systems running Enterprise Web Chat (EWC). EWC is a licensed feature introduced in ACCS 7.1.0.0 offering an alternative to the traditionally available Web Communications. EWC uses a new chat engine and because of this additional steps are required when performing a server name change on the CCMM server with EWC installed. These steps are fully documented in the *Administering ACCS* document. In the event that CCMM patches are removed from the CCMM server after a server name change operation has occurred, it will be necessary to reapply the EWC specific name change steps again. These steps are outlined below and should be run after CCMM patches have been removed/re-applied.

Before you begin

Shut down the CCMM services using SCMU.

Procedure

1. Log on to the Multimedia Contact Server
2. Right-click Start.
3. Select Run.
4. Type cmd.
5. Click OK.
6. In the command line window, enter
`CD D:\Avaya\Contact Center\EnterpriseWebChat\eJabberd`
7. Enter `update_hostname.bat <CCMM_servername>` where `<CCMM_servername>` is the new Multimedia Contact Server name.
8. Restart the CCMM server to apply changes
9. Ensure CCMM services have started OR use SCMU to start CCMM services.

Disable IIS Rapid-Fail Protection for CCMA_DefaultAppPool to avoid intermittent w3wp.exe crashes

When IIS Rapid-Fail Protection is enabled for CCMA_DefaultAppPool it may lead to intermittent w3wp.exe crashes. To protect against this issue perform the following steps

1. On AACC server, please open Internet Information Server (IIS) Manager application
2. Click Application Pools then right click on CCMA_DefaultAppPool then select Advanced Settings...
3. Go to Rapid-Fail Protection then select False for Enabled then click OK button.
4. Perform iisreset command from a Windows cmd

WORKSPACES ON AVAYA CONTACT CENTER SELECT

Deployment

This release makes the Workspaces feature available on Avaya Contact Center Select. Workspaces on ACCS is deployed as a Kubernetes single node cluster in virtual deployments, and as a multi node cluster in physical deployments.

Workspaces can be deployed in the following environments:

1. Physical machine; Hyper-V Workspaces cluster co-resident with Contact Center software
2. Virtual deployment; VMWare hosted Workspaces cluster

Physical Machine Deployments

Physical Pre-Install Checks

- **Microsoft Updates**
 - All applicable MS Updates must be applied to the Contact Center system **before** installation of Contact Center software.
Both the download **and** install of MS Updates must be turned **off** for the duration of the Contact Center installation and configuration phases
- **Additional Hard Drive/Partition**
 - For Workspaces deployments, additional disk space is required as defined in *AACC Overview and Specification* document available on support.avaya.com
 - The additional disk space must be accessible via a single drive letter e.g. W:
 - During deployment, users will be prompted to choose a drive which will be used for the storage of cluster data
 - This drive will be used to store cluster data in Network File System (NFS) shared folders
- **Workspaces Cluster Provisioning**
 - For physical deployments, all required Workspaces machines will be created automatically during the configuration phase
- **IP Addressing**
 - IP addresses must be supplied during Workspaces configuration
 - IP addresses provided must not already be allocated to existing systems on the network
 - All cluster IP addresses must reside within the **same subnet** as the Contact Center server
 - It is expected that the Subnet Mask IP is 255.255.255.0 and Gateway IP Subnet matches the user entered IPs e.g. GW 192.168.10.xxx and user entered IPs 192.168.10.xxx

Fresh Install

1. Review section *Physical Pre-Install Checks* above
2. Review the additional disk space requirement as defined in *AACC Overview and Specification*
3. Download the AACC 7.1.0.2 DVD and verify checksum
4. Download the AACC 7.1.0.2 Release Bundle and verify checksum
5. Extract all downloaded content locally
6. Launch the Universal Installer application from the DVD
7. To deploy Workspaces, choose the option to configure Workspaces

8. Progress through the Universal Installer application providing required input (Release Bundle location, drive selections etc.)
9. Reboot system if/when prompted
10. After reboot, configure the system using the Ignition Wizard application
11. Complete required Ignition Wizard fields providing appropriate input on the Workspaces tab
12. Reboot system after Ignition Wizard completion

Upgrades

1. Download the ACCS 7.1.0.2 Release Bundle and verify checksum
2. Extract all downloaded content locally
3. From the extracted Release Bundle content, launch the Avaya Release Pack Installer application to upgrade Contact Center and Third Party software
4. Also, while running the Avaya Release Pack Installer, choose the option to install Workspaces, providing the required input
5. Also, while running the Avaya Release Pack Installer, install all 7.1.0.2 GA patch bundles available
6. **Reboot** system when prompted
7. Perform post deployment configuration as detailed in section 'Post-Deployment' and 'Post-Installation Configuration' sections below.

Maintenance – Fresh install

If it is necessary to repair a Workspaces fresh install the Ignition Wizard application can be re-run. For physical deployments the Ignition Wizard will remove and re-deploy the required Hyper-V virtual switch and virtual machines:

1. Launch the Ignition Wizard by double clicking the desktop shortcut
2. Enter the required data and follow the onscreen instructions

Maintenance - Upgrades

If it is necessary to repair a Workspaces upgrade the Update Configurator application can be re-launched in Maintenance mode. For physical deployments the Update Configurator will remove and re-deploy the required Hyper-V virtual switch and virtual machines:

1. Launch the Update Configurator by double clicking D:\Avaya\Contact Center\Update Configurator\Update Configurator.exe
2. Enter the required data and follow the onscreen instructions

Virtual Environment Deployments

Virtual Pre-Install Checks

- **Microsoft Updates**
 - All applicable MS Updates must be applied to the Contact Center system **before** installation of Contact Center software.
Both the download **and** install of MS Updates must be turned **off** for the duration of the Contact Center installation and configuration phases
- **Additional Hard Drive/Partition**
 - For Workspaces deployments, additional disk space is required as defined in AACC Overview and Specification document available on support.avaya.com
 - The additional disk space must be accessible via a single drive letter e.g. W:
 - During deployment, users will be prompted to choose a drive which will be used for the storage of cluster data
 - This drive will be used to store cluster data in Network File System (NFS) shared folders
- **Workspaces Cluster Provisioning**
 - For virtual deployments, users must manually deploy a single system using the provided OVA, **prior** to installation or upgrade of Contact Center
- **IP Addressing**
 - IP addresses must be supplied during Workspaces configuration
 - For physical machine deployments, IP addresses provided must not already be allocated to existing systems on the network
 - During creation of VMWare cluster machines via the provided OVA, each node/machine must be allocated an IP address and readily accessible on the network
 - For both physical and virtual deployments, all cluster IP addresses must reside within the **same subnet** as the Contact Center server
 - It is expected that the Subnet Mask IP is 255.255.255.0 and Gateway IP Subnet matches the user entered IPs e.g. GW 192.168.10.xxx and user entered IPs 192.168.10.xxx

Pre-Installation Steps

1. Review section *Virtual Pre-Install Checks* above
2. Manually Deploy Cluster Machine using provided Workspaces OVA
 - a. Using you preferred VMWare client (vCenter/ESXi Web Client) deploy the Workspaces OVA
 - b. Name the created virtual machine as wsk8master
 - c. During deployment of the OVA, ensure the 1TB disk of each virtual machine is configured as **thin**
3. Manually Configure the OVA onto the Network
 - a. Log into the deployed virtual machine with username *root* and password *root01*
 - b. Using the following command, open the CentOS network config script:
vi /etc/sysconfig/network-scripts/ifcfg-ens192
 - c. Select the *<Insert>* key on the keyboard to enter edit mode
 - d. Add/modify the *IPADDR*, *GATEWAY*, *NETMASK* & *DNS* entries as required.

```
NAME="ens192"
DEVICE="ens192"
ONBOOT=yes
NETBOOT=yes
IPV6INIT=no
BOOTPROTO=None
TYPE=Ethernet
IPADDR=0.0.0.0
GATEWAY=0.0.0.0
NETMASK=0.0.0.0
DNS1=0.0.0.0
```

- e. To save changes select the Esc key then type *wq!* followed by Enter
 - f. To exit without saving, select the *Esc* key then type *q!* followed by Enter
 - g. A restart of the network service is required to enable the changes. Enter the following command: *systemctl restart network*
4. Verify that the date and time of the CentOS wsk8master node is the same as the Windows ACCS machine. Log into the deployed virtual machine with username *root* and password *root01*:
 - a. Inspect the current date and time of each node using the command:
timedatectl
 - b. If the date and time needs to be modified to align with the ACCS machine it is most likely only the timezone that needs to be modified. The commands to utilise are:
timedatectl list-timezones
 - c. Use the set-timezone argument to change the time zone:
timedatectl set-timezone [DesiredTimezone]
 - d. If you require to modify the date time further then the following commands can be used:
To change the date *# timedatectl set-time [YYYY-MM-DD]*
To change the current time *# timedatectl set-time [HH:MM:SS]*
 5. Ensure the wsk8master VM is in a running state and pingable, via IP address, from the Contact Center Windows server

Fresh Install

1. Download the AACC 7.1.0.2 DVD and verify checksum
2. Download the AACC 7.1.0.2 Release Bundle and verify checksum
3. Extract all downloaded content locally
4. Launch the Universal Installer application from the DVD
5. To deploy Workspaces, choose the option to configure Workspaces
6. Progress through the Universal Installer application providing required input (Release Bundle location, drive selections etc.)
7. Reboot system if/when prompted
8. After reboot, configure the system using the Ignition Wizard application
9. Complete required Ignition Wizard fields providing appropriate input on the Workspaces tab
10. Reboot system after Ignition Wizard completion

Upgrades

1. Download the AACC 7.1.0.2 Release Bundle and verify checksum
2. Extract the downloaded content locally
3. From the extracted Release Bundle content, launch the Avaya Release Pack Installer application to upgrade Contact Center and Third Party software

4. Also, while running the Avaya Release Pack Installer, choose the option to install Workspaces, providing the required input
5. Also, while running the Avaya Release Pack Installer, install all 7.1.0.2 GA patch bundles available
6. **Reboot** system when prompted
7. Perform post deployment configuration as detailed in section 'Post-Deployment' and 'Post-Installation Configuration' sections below.

Maintenance – Fresh install

If it is necessary to repair a Workspaces fresh install the Ignition Wizard application can be re-run.

Important: The Workspaces OVAs must be re-deployed and configured on the network before the Ignition Wizard is started.

1. Launch the Ignition Wizard by double clicking the desktop shortcut
2. Enter the required data and follow the onscreen instructions

Maintenance - Upgrades

If it is necessary to repair a Workspaces upgrade the Update Configurator application can be re-launched in Maintenance mode.

Important: The Workspaces OVAs must be re-deployed and configured on the network before the Update Configurator maintenance is started.

1. Launch the Update Configurator by double clicking D:\Avaya\Contact Center\Update Configurator\Update Configurator.exe
2. Enter the required data and follow the onscreen instructions

Post-Deployment

Please also review the Known Issues - Workspaces on ACCS section

Date and Time

1. Inspect the Date and Time of each Kubernetes Node
 - a. Log into each Kubernetes node with username *root* and the user supplied password entered during the configuration phase
 - b. Inspect the current date and time of each node using the following command *timedatectl*
 - c. If the date and time needs to be modified, it is most likely only the timezone that needs to be modified. The commands to utilise are:
timedatectl list-timezones
 - d. Use the *set-timezone* argument to change the time zone. The following example changes the time zone to Europe/Dublin:
timedatectl set-timezone Europe/Dublin

If you require to modify the date time further, then the following commands can be used.

2. To change the date, use the following syntax:
timedatectl set-time [YYYY-MM-DD]
3. To change the current time, use the following syntax. Enter the hour by using a 24-hour clock:
timedatectl set-time [HH:MM:SS]
4. To configure your system to maintain the clock in the local time, use the following command:
timedatectl set-local-rtc yes
5. To configure your system to use UTC, use the following command:
timedatectl set-local-rtc no

Email handling – Closed Reason Code

Email reply will not send if a closed reason code was never created on the AACCC/ACCS system.

Check if Closed reason Code exists

1. Run CCMM Administration
2. Check under Agent Desktop Configuration -> Resources → Closed Reason Codes
3. If no Closed Reason code exists then create one

Workspaces and Domain Server

NOTE: Workspaces Agents must Domain users

Add the Workspaces and Workspaces Domain servers to the CCMM admin

- Launch CCMA and select multimedia.
- Launch the CCMM admin
- Navigate to Workspaces Configuration
- Add "Workspaces server IP" using the Master IP
- Add "Domain Server IP"
- Leave the ports as the default

Workspaces with ACCS Business Continuity

The current deployment does not provide a highly available Workspaces. This applies to the multi-node and single-node configurations. The Kubernetes cluster for Workspaces does not provide a high availability configuration - there is insufficient redundancy, resiliency and recoverability.

ACCS Business Continuity continues to be available to protect ACCS operation in the event of critical ACCS hardware and software failures. However, if a switchover occurs (ACCS switchover or a Kubernetes node failover), agents must re-login to AAD to continue processing contacts.

When deploying Workspaces with ACCS Business Continuity, you must configure only a single Workspaces for both ACCS nodes. When installing / upgrading select and configure Workspaces only on one node. When installing/upgrading the second node do not select Workspaces. The ACCS configuration related to Workspaces is automatically copied across to the standby node. There is no Workspaces configuration needed on the standby.

Agent experience during an ACCS Switchover using a Workspaces OVA deployment

The following lists the observed behaviors for a switchover with a logged-in agent active on a contact.

Voice Agent & Customer Experience

On switchover, the agent will remain connected with the customer on the physical phone, but the interaction card may or may not exist in Workspaces. If the interaction card is dropped, agent will not have CTI call control of that voice call. Customer will remain on the call and will not experience anything different. It is recommended that agent should login to AAD. Admin/supervisor should check CCMA for the agent status post switchover. If the agent is shown as logged in, the admin/supervisor must use the force logout option in CCMA to logout the agent. New calls after the switchover are successfully routed and presented to the agent.

Email Agent & Customer Experience

On switchover, E-mail interaction is dropped from Workspaces and therefore any response being prepared by the agent is lost as are any other open drafts. However, the Email will be returned to the queue and presented as a new email to the next available agent. It is recommended that agent should login to AAD. Admin/supervisor should check CCMA for the agent status post switchover. If the agent is shown as logged in, the admin/supervisor must use the force logout option in CCMA to logout the agent. New calls after the switchover are successfully routed and presented to the agent.

Webchat Agent & Customer Experience

On switchover, customer and agent chat conversation is broken resulting in loss of all open chats with no way of re-establishing the conversations. Since the interaction cards and the chats are dropped from Workspaces, any response prepared by the agent is also lost. However, the chat contact continues to show as active in RTDs. Customer continually sees an error message "A connection error has occurred". It is recommended that agent should login to AAD. Admin/supervisor should check CCMA for the agent status post switchover. If the agent is shown as logged in, the admin/supervisor must use the force logout option in CCMA to logout the agent. New calls after the switchover are successfully routed and presented to the agent.

Workspaces Troubleshooting

There may be a requirement to restart a Workspaces Cluster node or container in the event of a failure scenario. Detailed procedures are provided in this section. However, restart procedures should only be executed where it's clear that this is the appropriate recovery action.

How to restart a Workspaces cluster

Virtual Environment Deployment

- Login to vCenter
- Power down the master node in Workspaces Single Node Cluster
- Power up the master node
- Login to the master node and run the command "kubectl get nodes"
- Verify that the master node is "ready"

Physical Server Deployment

- Login to hyperv manager
- Power down the three nodes in Workspaces Cluster (i.e master, node1 and node2)
- Power up the master node
- Login to the master node and run the command "kubectl get nodes"
- Verify that the master node is "ready"
- Power up node1 and node2
- From the master node, run the command "kubectl get nodes" and verify all nodes are "ready"

How to restart a Workspaces container in the event of a failure

Virtual Environment Deployment

- Login to vCenter
- Login to the master node and run the command "kubectl get pods"
- Verify the pod name and execute "kubectl delete pod <pod name>"
- From the master node, run the command "kubectl get pods" and verify the pod has restarted

Physical Server Deployment

- Login to hyperv manager
- Login to the master node and run the command "kubectl get pods"
- Verify the pod name and execute "kubectl delete pod <pod name>"
- From the master node, run the command "kubectl get pods" and verify the pod has restarted

How to collect logs for the relevant containers

Virtual Environment Deployment

- Login to vCenter
- Login to the master node and run the command “kubectl logs <pod name>”

Physical Server Deployment

- Login to hyperv manager
- Login to the master node and run the command “kubectl logs <pod name>”

SECURITY INFORMATION

Avaya Contact Center Select security certificate migration considerations

Migrating security custom security certificates has caveats that require planning and consideration before beginning the process.

Migration from 6.4 to 7.x

Due to the changes made in ACCS 7.x release regarding improved security stance, migration of the ACCS 6.4 certificate store to ACCS 7.x or higher is not possible.

The only path available when moving to ACCS 7.x from ACCS 6.4 is the creation of a new store on the ACCS 7.x system, the signing of the certificate signing request (CSR) by a selected Certificate Authority and the importing of these new security certificates into the new store.

No elements of the security store from ACCS 6.4 can be migrated to ACCS 7.x

Migrating ACCS Security Store for ACCS 7.0 to 7.x.x

The following sections are applicable to migrations from 7.0 to later versions only.

Note: ACCS releases prior to 7.0.3 come with the default store as standard and as such does not need to be migrated from previous releases. Please be advised this default store is not to be used in a production environment and is designed to be used in a test/configuration only situation.

Name of Server is important

When intending to reuse existing security certificates on a new system then the receiving system will have to have the exact name as the donor system otherwise the security certificate will not match the underlying server. If the security certificate and underlying server name do not match, then warnings and errors will be presented to the user, when attempting to use this security certificate to establish a secure connection.

Note

The recommendation is that, if possible, new security certificates be generated for the new system rather than reuse security certificates from another system.

Restoring Certificate store to a new system

If the decision to reuse the security certificates then the migration of security certificates is a manual process and requires that the security certificate store on the server be backed up using the Security Manager Backup feature.

This will back up the necessary files required to be imported back in on the new system using the Security Manager Restore feature.

The receiving system name must be the same as the donor system otherwise errors will occur when attempting to use the security certificates to establish a secure connection.

Note

The backed up files will be modified if coming from a release prior to 7.0 during the restore process so it is recommended that you keep a copy of the original backed up files.

See [Appendix C – Store Maintenance](#) for details on backing up and restoring the certificate store.

From Avaya Contact Center Select release 7.0.2 fresh installations, Out of The Box (OTB) security store and AES specific security certificates are no longer provided.

From release 7.0.3.0 fresh installations of the solution will not provide the default security store with default security certificates for AACC and the AES.

Fresh installations

For fresh installs the customer will have to create a custom security store for the server during the Ignition Wizard security configuration stage to enable the On by Default and secure the server and services as was provided automatically in previous releases.

If the Ignition Wizard security configuration is not completed fully then upon completion of the Ignition Wizard phase and reboot of the server the services will not be secure and the SIP-CTI link to AES will not be operational as it supports secure connection only.

Ignition Wizard has been enhanced to allow the creation and population of the contact center security store during the configuration phase. If this is skipped then warnings will be given and Security Manager (previously Security Manager) can be used to complete the creation and/or population of the security store.

From Avaya Contact Center Select release 7.0.3, upgrades to 7.0.3 or higher will remove OTB or default store if detected.

Upgrades

From 7.0.3.0, if the OTB store is being used and is on the server it will be actively removed by the installer. From 7.0.3.0 all existing deployments will be required to have implemented custom security configuration.

Prior to upgrading to 7.0.3.0 or higher please put in place custom security certificates and security store via the Security Manager, this is the application on the server to create a custom security store.

TLS v1.2 as default level for TLS communication

Fresh installations

On fresh installations only, the default TLSv1 level enforced is TLS v1.2. This means that TLS v1.0 and TLS v1.1 protocol levels are disabled and are not available to be used in the solution or on the underlying Windows 2012 R2 operating system.

Migrations

Migrations can be considered in the same area as fresh installations in that the default TLSv1 level enforced is TLS v1.2.

Upgrades

On an upgrade where the feature pack is applied on an existing 7.0 release then there is no enforcement of TLS v1.2 on the server. This is relevant only to the Windows operating system level support of TLS versions.

For SIP traffic and Event Broker web services the enforcement of TLS v1.2 still applies and if these levels need to be modified then please refer to the section “Resetting TLSv1 Levels”.

In 7.0.1 the default TLSv1 level enforced is TLS v1.2. This means that TLS v1.0 and TLS v1.1 protocol levels are disabled and are not available to be used in the solution or on the underlying Windows 2012 R2 operating system.

Resetting TLSv1 Levels

For upgrades this new TLS v1.2 default setting may have an impact on any legacy applications that consume ACCS services that cannot support this level of TLSv1. To allow backward compatibility with older releases and applications that consume ACCS services the TLSv1 level can be lowered to reestablish functionality if found to be incompatible with the new TLSv1 level.

The general rule when setting the TLSv1 levels is shown in the table below

TLS Level Set	TLS v1.0 available	TLS v1.1 available	TLS v1.2 available
1.0	Yes	Yes	Yes
1.1	No	Yes	Yes
1.2	No	No	Yes

When the TLS v1 level is set the general rule is any level under that set level is disabled and any level above it is still available. It is configurable via Security Manager Security Configuration tab

How to change the TLSv1 levels

The new TLSv1 level settings can all be changed in the Security Manager application which can be launched from the ACCS server.

In the Security Configuration Tab of the Security Manager application there are three drop boxes which allow the user to lower the TLSv1 levels for the following application and services outlined in the next section.

Services and Applications covered by new TLSv1 setting

The three main areas where this new setting covers are

- Windows operating system
- Web Traffic
- SIP Traffic

Windows operating system

This covers all of the windows operating system and any Microsoft based applications, such as IIS for example.

This can be lowered to TLS v1.0 or TLS v1.1 if required via the Security Manager application. If TLS v1.0 is set as default for example, then TLS v1.1 and TLS v1.2 is still available.

Web Traffic

IIS

This is covered with the changes made to the underlying Windows Operating system. Which is also the same setting configurable via the Security Manager Security Configuration tab.

Tomcat

This web server is set to use TLS v1.2 only. It is currently not configurable.

All known applications that use Tomcat can operate at TLS v1.2 and thus no need to have an option to enable lower protocols.

Lightweight/framework web application servers

Event Broker Web Service TLS v1 level can be set on the Security Manager application.

SIP and CTI Traffic

This covers all SIP and CTI traffic to and from the ACCS server. This is configurable via Security Manager Security Configuration tab.

For non-mandatory TLS SIP connections

The servers that can make up the solution may be configured to secure their connection to the ACCS server and so below are the compatibility tables for the different versions that may be used in the solution.

IP Office releases	See Appendix C – IP Office releases TLSv1 support
Avaya Aura Media Server	See Appendix C – Avaya Aura Media Server releases and TLSv1 support

Known applications and services that cannot support TLS v1.2

There are applications and services which cannot support TLS v1.2 currently and a review of these applications and services should be made to determine the course of action prior to moving to 7.0.1. The table below lists all known application and services that cannot support TLS v1.2

HDX / DIW connection to databases	See Appendix C – HDX/DIW connection to databases
Remote desktop	See Appendix C – Remote Desktop
System Manager 7.0	See Appendix C – System Manager 7.0

LOCALIZATION

Avaya Contact Center Select 7.1 (7.1) Avaya Agent Desktop (AAD), Outbound Campaign Management Tool (OCMT), Contact Center Manager Administration (CCMA) and Web Agent Controls UI and online Help is localized into French, German, LA Spanish, Simplified Chinese, Brazilian Portuguese, Russian, Japanese, Korean and Italian.

Overview of I18N and L10N Products & Components

Components that are used by Contact Center agents or by Contact Center supervisors performing non-specialized functions are localized. Interfaces to support administration or specialized functions (for example, creating routing applications) are not localized.

All ACCS 7.1 products and components support Internationalization (I18n). The following table lists all ACCS 7.1 products and components that support Localization (L10n):

ACCS 7.1 Products	Component
CCT	Web Agent Controls
CCT	Web Agent Controls online help
CCMA	Contact Center Management
CCMA	Access and Partition Management
CCMA	Real-Time Reporting
CCMA	Historical Reporting
CCMA	Configuration
CCMA	Emergency Help
CCMA	Outbound
CCMA	Historical Report Templates
CCMA	Agent Desktop Display
CCMA	Online Help
CCMM	AAD Client
CCMM	AAD online Help
CCMM	OCMT Client
CCMM	OCMT online Help

Refer to Chapter 24: Language support fundamentals in the Avaya Contact Center Select Advanced Administration guide for supported languages.

Localized Components (CCMA and CCMM)

The following table lists the compatibility between the CCMA/CCMM language patches and the operating system language family. Only compatible languages can be enabled on the server.

		Supported Languages									
		CCMA									CCMM
		FR	DE	ES	PT-BR	IT	ZH-CN	JA	RU	KO	
OS Language	English	Y	Y	Y	Y	Y	N	N	N	N	Y
	Any 1 Latin1 language	Y	Y	Y	Y	Y	N	N	N	N	Y
	Simplified Chinese	N	N	N	N	N	Y	N	N	N	Y
	Japanese	N	N	N	N	N	N	Y	N	N	Y
	Russian	N	N	N	N	N	N	N	Y	N	Y
	Korean	N	N	N	N	N	N	N	N	Y	Y

Language specific support and configuration

All languages are supported on Internet Explorer 10 & 11.

Language	CCMA Client Browser Language Preference	CCMM Client Client Windows Support	ACCS Server Server Windows Support/ Regional Options Configuration*
French	fr-FR	French Windows 7, 8.1 and 10	French Win 2012 R2. Regional option default (French)
German	de-DE	German Windows 7, 8.1 and 10	German Win 2012 R2. Regional option default (German)
LA Spanish	es-CO	LA Spanish Windows 7, 8.1 and 10	Spanish Win 2012 R2. Regional option default (Spanish)
Simplified Chinese	zh-CN	Simplified Chinese Windows 7, 8.1 and 10	Simplified Chinese Win 2012 R2. Regional option default (Simplified Chinese)
Brazilian Portuguese	pt-BR	Brazilian Portuguese Windows 7, 8.1 and 10	Brazilian Portuguese Win 2012 R2. Regional option default (Brazilian Portuguese)
Russian	ru-RU	Russian Windows 7, 8.1 and 10	Russian Win 2012 R2. Regional option default (Russian)
Italian	it-IT	Italian Windows 7, 8.1 and 10	Italian Win 2012 R2. Regional option default (Italian)
Japanese	ja-JP	Japanese Windows 7, 8.1 and 10	Japanese Win 2012 R2. Regional option default (Japanese)
Korean	ko-KR	Korean Windows 7, 8.1 and 10	Korean Win 2012 R2. Regional option default (Korean)

* If you wish to launch AAD or OCMT in a local language BUT THE CLIENT OPERATING SYSTEM IS ENGLISH, then change the default language in the regional language options to the local language.

Email Analyzer configuration

An English email analyzer (AlphanumericAnalyzer) is enabled by default for keyword analysis of English Latin-1 character sets on the ACCS server. The email analyzer can be configured based on language specific values specified in the following table:

Language	Email Analyzer
French	Change default SimpleAnalyzer to FrenchAnalyzer
German	Change default SimpleAnalyzer to GermanAnalyzer
LA Spanish	Change default SimpleAnalyzer to AlphanumericAnalyzer
Simplified Chinese	Change default SimpleAnalyzer to ChineseAnalyzer
Brazilian Portuguese	Change default SimpleAnalyzer to BrazilianAnalyzer
Russian	Change default SimpleAnalyzer to RussianAnalyzer
Italian	Change default SimpleAnalyzer to ItalianAnalyzer
Traditional Chinese	Change default SimpleAnalyzer to ChineseAnalyzer
Japanese	Change default SimpleAnalyzer to CJKAnalyzer
Korean	Change default SimpleAnalyzer to CJKAnalyzer

The *mailservice.properties* file on the ACCS Server specifies which analyzer is enabled and lists all supported analyzers in the comments.

This procedure can be used to enable a language specific email analyzer:

1. Stop the **CCMM Email Manager** service on the server.
2. Navigate to D:\Avaya\Contact Center\Multimedia Server\Server Applications\EMAIL.
3. Open *mailservice.properties*.
4. Change the properties of the file from read only to write available.
5. In the <box> search for the line *mail.analyzer=AlphanumericAnalyzer*.
6. Change *mail.analyzer* value to language specific value.
7. Start the CCMM Email Manager service on the server.

Email Analyzer Limitation 1 - Wildcard use (Asian) – Single Byte Routing

There is a limitation when the email analyzer is enabled for Asian languages. A problem arises when routing with SINGLE BYTE characters in the keyword. Double byte keywords route successfully. This limitation also applies for wildcards included in keywords.

To route a single byte keyword to a skillset, you must save the keyword as DOUBLE byte on the server. For example to route the single byte keyword コプタ to a skillset called EM_Test do the following:

1) Create a DOUBLE byte keyword

- In the Multimedia Administrator, click the plus sign (+) next to Contact Center Multimedia, click the plus sign next to E-mail Administration, and then double-click Keyword Groups.
- The Keyword Groups window appears.
- To create a new keyword group, click New.
- In the Name box, type a unique name for the keyword group (maximum 64 characters. This NAME must be in English). E.g. "DoubleByteCoputa"
- In the Keyword box, type the word (in DOUBLE byte) you will be searching for. E.g. "コプタ" Click Add.
The keyword is added to the list, and the keyword group is created. Click Save.

2) Create a Rule to route the keyword to a skillset

- Start the Rule Configuration Wizard.

Release Notes

- On the Rule Configuration Wizard – Input Criteria window, under Available Keyword Groups, select a keyword group you want to use for this rule. E.g. “DoubleByteCoputa”
- Click the black arrow to insert the keyword group name into the selection box.
- Click Next.
- In the Rule box, type the name for your rule. E.g. “DoubleByteCoputaRule”
- In the Skillset box, select a skillset for your rule. . E.g. “EM_Test”
- Click Save.
- Click Finish. Your rule is created with the keyword group.

Note: This is a limitation of the 3rd party creator of the analyzer, Lucene.

Email Analyzer Limitation 2 - Wildcard use (Asian) - Wildcard * and ? string position

There is a limitation when the email analyzer is enabled for Asian languages. Wildcard ‘?’ or ‘*’ can only be used at the end of a keyword.

e.g. Wildcard use たば* is correct. Wildcard use た*た is not correct.

Note: To route the wildcard keyword successfully, the ‘*’ can be entered in either full-width or half width. The ‘?’ can be entered in full-width only.

Start Localized AAD Client

Pre-installation steps

- Ensure that Localization is enabled in CCMM Administration -> Agent Desktop Configuration -> User Settings



Enable Localization ☒

- If you wish to launch AAD in a local language but the client operating system is ENGLISH, then change the default language in the regional language options to the local language.

Installing the Agent Desktop Client

Install the Agent Desktop if you are launching the application for the first time or if you are launching the application following installation of an upgrade or a patch.

Prerequisites

- Ensure that the administrator has configured your Windows User ID in CCT and that you have a valid User ID, Password, and Domain for use with Contact Center Agent Desktop.

Procedure steps

1. In Windows Explorer or Internet Explorer, enter the HTTP address (URL) using format:
https://<Avaya Contact Center Select servername>/agentdesktop/LANGUAGE CODE*
2. Click Launch AAD.
3. Click Install.

Starting the Agent Desktop Client

Start the Agent Desktop when you are ready to view the application.

Prerequisites

- Ensure that you install Avaya Agent Desktop.

Procedure steps

1. In Windows Explorer or Internet Explorer, enter the HTTP address (URL) using format:
https://< Avaya Contact Center Select servername>/agentdesktop/LANGUAGE CODE*
2. Click Launch AAD.

Alternative Procedure steps

1. Click Windows Start, All Programs, Avaya, Avaya Aura Agent Desktop.
The Agent Desktop toolbar appears. If a CCT Connection Failure message appears, your Windows User ID is not configured on CCT. Click Retry to enter valid User Credentials or click Cancel to exit the application.

* Applicable **LANGUAGE CODEs** to be used are:

- French = fr
- German = de
- LA Spanish = es
- Simplified Chinese = zh-cn
- Brazilian Portuguese = pt-br
- Russian = ru
- Italian = i

Troubleshooting

Detecting latest Language files

In case that client runs the English AAD and OCMT applications and does not pick up the language files, then these files are now stored in the GAC (.Net cache) on the client PC. The .Net cache (GAC) therefore, needs to be emptied on the client PC so the latest English and language files can be taken from the server.

Note: If you install an updated Service pack or Design patch, the client still runs applications with cached language files. The .Net cache (GAC) must be emptied, so the latest language files can be taken from the server.

Emptying the .Net cache on the client PC running AAD and OCMT

Procedures such as uninstalling application and emptying the .Net cache require administrator rights.

1. Close AAD and OCMT.
2. Click Add/Remove Programs.
3. Remove Avaya/Avaya Agent Desktop.
4. Navigate to *C:\Documents and Setting\USERNAME\local settings\apps*.
5. Delete the 2.0 folder.
6. *Note:* This folder may be hidden. If so, open Windows Explorer and click on Tools, Folder options. Choose the View tab. Under Files and folders or Hidden files and folders, choose to show hidden files and folders. Click Apply and click OK.
7. Start AAD to download the latest AAD files from the CCMM server.

Start OCMT from CCMA to download the latest OCMT files from the CCMM server.

KNOWN ISSUES

Hardware Appliance

None

Software Appliance

None

Installation

DNS entry beginning with a digit is allowed through and causes an error

Tracking Number	CC-18895
Application	Ignition Wizard
Description	On the Security Configuration tab of the Ignition Wizard, if a DNS which begins with a digit is added, there will be an error when creating the store. It should be blocked from being entered.
Impact	If a DNS beginning with a digit is added, the store will not be able to be created at Ignition time.
Workaround	<ol style="list-style-type: none">1. Do not enter a DNS beginning with a digit.2. OR If a DNS beginning with a digit has been entered and the Create Store button produces an error, delete the troublesome DNS entry and press the Create Store button again.3. OR if the user has chosen not to create the store after getting the error, security can be applied once the system is up and running in Security Manager.

Sysop log files missing on ACCS non Workspaces upgrades from 7.1.0.1

Tracking Number	CC-18745
Application	Avaya Release Pack Installer
Description	On Contact Center systems deployed without the Workspaces feature, upgrades from previous release 7.1.0.1 results in the removal of C:\Avaya\Logs directory occurs
Impact	As logs are not available, troubleshooting possible installs issues will be impacted
Workaround	Before upgrade of ACCS non Workspaces 7.1.0.1 to 7.1.0.2, backup C:\Avaya\Logs directory to a new directory named C:\Avaya_Logs_Backup

Workspaces on ACCS

Workspaces Deployment – ACCS Virtual Single Node Deployment Subnet Mask

Tracking Number	CC-18351
Application	Workspaces Deployment – ACCS Virtual Single Node Deployment
Description	The expected Subnet Mask on a Workspaces Single Node deployments is 255.255.255.0.
Impact	The network configuration of the cluster can fail.
Workaround	The network configuration of the underlying physical NIC card must have a Subnet Mask IP of 255.255.255.0.

Workspaces voice agent with difference between loginId and voiceURI unable to activate

Tracking Number	CC-19162
Application	Workspaces
Description	Agent configured with a different loginID and Voice URI i.e. Login ID 123456, Voice URI sip:23452@lab.avaya.com fails to activate on Workspaces
Impact	Workspaces voice agents unable to activate
Workaround	Configure agent with matching LoginID and Voice URI i.e. Login ID 123456, Voice URI sip:123456@lab.avaya.com

Exiting Workspaces when using HTTPS presents error page

Tracking Number	CC-19087
Application	Workspaces
Description	Logout Agent from Workspaces https returns connection error page
Impact	Workspace does not automatically return to login page after agent exits
Workaround	To login, agent need to refresh Workspace https URL from browse

Workspaces Service Utility fails to collect logs

Tracking Number	CC-19155
Application	Workspaces
Description	Intermittently Workspaces Service Utility fails to collect logs.
Impact	Logs not collected for issue investigation due to missing logs folder.
Workaround	Manually create missing log folder under: D:\Avaya\Contact Center\Workspaces\WorkspacesServiceUtility\ i.e. D:\Avaya\Contact Center\Workspaces\WorkspacesServiceUtility\Logs

Incorrect Time Zone in Logs

Tracking Number	CC-17638
Application	Workspaces
Description	The timestamp in the log files was incorrect. It was GMT instead of the relevant time zone
Impact	Troubleshooting
Workaround	Manually apply time zone offset from GMT

Agents Cannot Start Work in Ready State

Tracking Number	CC-18154
Application	Workspaces
Description	Agents are not automatically set to Ready on login to AACC if option selected in Agents Workspace Preferences. Default is Not Ready
Impact	Agents Workspace Preferences not picked up for Starting Work Ready
Workaround	Agents can manually go ready

Agents cannot activate after an un-controlled AACC restart

Tracking Number	CC-18268
Application	Workspaces
Description	When AACC is restarted in an-uncontrolled manner only, there is no feedback that the connection is lost. Menus and buttons are available, but no actions take effect. If the web-page is refreshed, the user can login and can activate, however menus and buttons have no effect.
Impact	No issue for controlled restarts within a maintenance window. Agents are not able to activate when AACC is restarted in un-controlled manner.
Workaround	Restart the IntegrationPortalAppPool application pool in IIS: From Start menu: Launch internet information Services (IIS) Manager. Navigate to Application Pools/IntegrationPortalAppPool. Right-click and select Stop. When status is stopped, right click and select Start.

Agents able to Close Emails without Replying

Tracking Number	CC-17930
Application	Workspaces - Email
Description	It is possible to close the email interaction without replying
Impact	Behavior change between AAD flow and workspaces flow
Workaround	None

Call interaction card not created when Invalid number dialed

Tracking Number	CC-18089
Application	CCS SDK
Description	No interaction card created on making a call to an invalid number
Impact	No indication of failed call on workspaces and Agent cannot release call on workspaces
Workaround	Call to invalid number needs to be released from phone set

Contact represented to agent within 3 seconds

Tracking Number	CC-19080
Application	Workspaces

Description	Contact with same Id not displayed if created within 3 seconds of original contact
Impact	Agent will go not ready and contact will get presented to next available agent
Workaround	None

Multiple requests sent when there is more than 1 active session

Tracking Number	CC-19078
Application	Workspaces
Description	Multiple requests sent when there is more then 1 active session
Impact	Error popup messages or duplicated webchat messages
Workaround	None

Delay in creating new interaction so call only alerted for 1 second

Tracking Number	CC-19026
Application	CCT-Contact Control Service
Description	Delay in creating new interaction so call only alerted on workspaces for 1 second
Impact	Agent will go not ready and contact will get presented to next available agent
Workaround	None

Voice and MM icon removed if agent selects not ready while active on contact

Tracking Number	CC-18118
Application	Workspaces
Description	Voice and MM icons are removed when agent is working on contact and changes state to not ready
Impact	Icons gone until contact is released
Workaround	None

Application\Features

AMS VHDX does not allow a subnet mask different from 255.255.255.0

Tracking Number	CC-17121
Application	AAMS VHDX Deployment
Description	There is a network restriction when installing the AMS VHDX where the customer must use 255.255.255.0 as the Subnet Mask IP
Impact	Customer networks may not conform to this so these restrictions need to be removed
Workaround	The network configuration of the underlying physical NIC card must have a Subnet Mask IP of 255.255.255.0.

AAMS Media Services displayed incorrectly as not started in EM after AACC licenses AAMS

Tracking Number	CC-14420
Application	Avaya Aura Media Server
Description	If an AAMS is not licensed and AACC licenses the AAMS then the AAMS Element Manager can sometimes display the AAMS Media Services as “Not Running” when it is up and running. The Start Button in AAMS EM Element Status will be selectable and the Stop button will be grayed out.
Impact	There is no impact on AACC as AAMS is up and running fully. The AAMS is displaying the wrong state in EM.
Workaround	Reboot the AAMS by logging into ssh terminal and running “reboot”

Remote desktop connection fails due to service stuck in starting

Tracking Number	CC-2435
Application	Windows Server 2012 R2
Description	Under certain error conditions, i.e. misconfiguration, some ACCS services will not complete startup. While in this error state remote desktop connection logins and local console logins can fail with a “please wait” message.
Impact	Inability to login through RDC of local console to ACCS server.
Workaround	If this error condition is experienced a connection to the console should be attempted. In the case of a physical sever deployment this would be the physical keyboard and monitor connection to the server. In the case of virtualized environments the equivalent to the physical console should be used.
Solution	If a connection is successful on the console the service which is stuck in starting should be identified and normal trouble shooting performed to determine why the service is not completing startup.
	If the connection to the console is not successful a power cycle of the server will be required. A connection should be attempted, either through the console or through RDC, as soon as possible after the power cycle is performed.
Solution	This issue is resolved by applying the following Microsoft fix (KB3100956) mentioned in the Microsoft Operating System Updates section.

AAMS Element Manager may display incorrect FQDN of AAMS VHDX server after deployment AAMS SP

Tracking Number	CC-16955
Application	AAMS VHDX Deployment
Description	After deployment AAMS SP, Element Manager may display invalid FQDN of AAMS server. EM may display the following instead of FQDN: <ul style="list-style-type: none"> • hostname without domain name; • FQDN with default domain name (“accdev.lab”); • two IP addresses of AAMS.
Impact	Element Manager displays incorrect FQDN

Release Notes

Workaround	Log into AAMS VHDX Linux. Look at a content of the <code>/etc/sysconfig/network-scripts/ifcfg-eth0</code> file. It must contains IPADDR and NETWORK entries only once. If necessary, edit that file removing duplicated entries and reboot AAMS VHDX server.
------------	--

When a consult call is initiated from AAD, call first presents to the consulting agent. Only when answered, the consult call is finally initiated

Tracking Number	CC-17612
Application Description	SGM
Description	When a consult call is initiated from AAD by an agent using SIP endpoint (hard phone or Equinox), the call first presents to the agent that initiated the consult. Only when that call is answered, is the consult call presented to the target agent / CDN.
Impact	There does not seem to be any impact to any of the applications, just that this behavior of consulting agent having to answer the call first leads to confusion for the agent.
Workaround	Initiate the consult call directly from the phone set.

Some fields are not aligned when Agent Performance report exported to .pdf file,

Tracking Number	CC-3856
Application	Contact Center Manager Administration
Description	AACC7.0 HR- Export Agent Performance report to .pdf file, some fields are not aligned
Impact	A number of reports within AACC are larger than a standard A4 page and as a result appear misaligned when exported to pdf. They also span pages when printed.
Workaround	None

Report Creation Wizard – Some sample reports do not work

Tracking Number	CC-5035
Application	Contact Center Manager Administration
Description	The following sample reports do not work in this release: BillingByAddress SkillsetOutboundDetails Voice Skillset Name ID Mapping Network Consolidated Skillset Performance ICPCSRSample MMCSRStat
Impact	These samples cannot be used as a starting point for new reports
Workaround	None

Unable to login to CCMA using System Manager with TLS 1.1 or TLS 1.2 enabled

Tracking Number	CC-9923
Application	Contact Center Manager Administration
Description	Unable to login to CCMA using System Manager 7.0 or earlier when TLS 1.1 or TLS 1.2 is enabled. System Manager 7.0 and earlier versions do not support TLS 1.1 or 1.2
Impact	Unable to login to CCMA
Workaround	1. System Manager 7.0.1 supports TLS 1.1 and TLS 1.2

Install wrong .NET Framework version from installing pre-requisites on CCMA Dashboard

Tracking Number	CC-13274 (CC-9825)
Application	Contact Center Manager Administration
Description	Cannot launch Dashboard report from Real-Time Report page
Impact	Unable to use CCMA Dashboard
Workaround	<p>1. Install .NET FW 4.5.2 from DVD for the client machine.</p> <p>2. Apply "SchUseStrongCrypto" value for the client machine.</p> <p>Create a text file named strongcrypto35-enable.reg that contains the following text:</p> <pre>Windows Registry Editor Version 5.00 [HKEY_LOCAL_MACHINE\SOFTWARE\Microsoft\.NETFramework\v4.0.30319] "SchUseStrongCrypto"=dword:00000001</pre>

	<p>[HKEY_LOCAL_MACHINE\SOFTWARE\Wow6432Node\Microsoft\.NETFramework\v4.0.30319]</p> <p>"SchUseStrongCrypto"=dword:00000001</p> <p>Run regedit.exe</p> <p>In Registry Editor, click the File menu and then click Import.</p> <p>Navigate to and select the strongcrypto35-enable.reg file that you created in the first step.</p> <p>Click Open and then click OK</p> <p>Exit Registry Editor.</p> <p>3. For Windows 7 SP1, the client needs to install the update https://support.microsoft.com/en-us/kb/3140245</p> <p>4. Restart the client.</p>
--	---

With SSO enabled prior to upgrade, SCT Tool and OD are failed to connect CCMA after upgrading to new release

Tracking Number	CC-13655
Application	Contact Center Manager Administration
Description	Users already configure SSO and enable SSO. When they upgrade their system to 7.1 GA and they do not need to have any further configuration for SSO after the upgrade, SCT and OD will fail to connect CCMA
Impact	SCT and OD are failed to connect CCMA
Workaround	<p>The workaround is to disable SSO and enable SSO from Security Details dialog.</p> <p>Steps:</p> <ul style="list-style-type: none"> - Open Manager Administrator Configuration - Open Security Settings - Click Disable button - Click Yes button from the confirmation dialog - Click OK button from the information dialog - Click Enable button - Click Yes button from the confirmation dialog - Click OK button from the information dialog

CCMA- All texts in Attribute in JSON variables showed "ERROR: Could not get text: Index = 9040, Language = en-us!" for upgraded lab from 7.0.1

Tracking Number	CC-13468
Application	Contact Center Manager Administration
Description	From Scripting, open JSON variable (JSON Object, JSON String, JSON Pair), the text string shows the error "ERROR: Could not get text: Index = 9040, Language = en-us!"
Impact	User does not understand the guideline of JSON variable
Workaround	<p>We need to run the command "AccessToInterSystems.exe -install ALLTEXT" at D:\Avaya\Contact Center\Manager Administration\Server\bin folder.</p> <p>Steps:</p> <ul style="list-style-type: none"> - Open a cmd

Release Notes

- Change the folder to D:\Avaya\Contact Center\Manager Administration\Server\bin
- D:\Avaya\Contact Center\Manager Administration\Server\bin > AccessToInterSystems.exe -install ALLTEXT

Unable to access CCMA component intermittently after enabling SSO

Tracking Number	CC-14606
Application	Contact Center Manager Administration
Description	After enabling SSO via Security Settings snap-in, unable to access CCMA component intermittently, the page is stuck at loading...
Impact	Customer Impact: Cannot configure data from CCMA
Workaround	The workaround is to restart IIS service using Manager Administration Configuration -> Security Settings -> Advanced -> Restart Service.

Document the use case for UnInstallADLDS.bat

Tracking Number	CC-14620
Application	Contact Center Manager Administration
Description	Customers migrating from AACC 6.x to CC7 will restore the ADLDS instance but it is not always auto removed.
Impact	Customer Impact: ADLDS exists on the system and some Windows ADLDS events are displayed
Workaround	Users need to manually remove the ADLDS instance by running the following bat file: UnInstallADLDS.bat located in D:\Avaya\Contact Center\Manager Administration\Apps\Sysops\NESRestore

AAD Auto Sign On cannot login with SSO enabled

Tracking Number	CC-14729
Application	Contact Center Manager Administration
Description	AAD Auto Sign On cannot login with SSO is enabled
Impact	ADD Auto Sign On feature
Workaround	Configuring CCMM General Administration. Ensure that Contact Center Manager Administration is configured with the managed name of the Voice and Multimedia Contact Server High Availability pair. The format of the managed name should be FQDN name, not a short hostname in case SSO is enabled.

AAD launch fails from IE on some clients

Tracking Number	CC-14738
Application	Contact Center Manager Administration
Description	The launch address of AAD doesn't seem to work correctly. For example, if the user enters https://<FQDN>/agentdesktop/ where FQDN is the AACC server, the user cannot launch AAD
Impact	AAD
Workaround	User needs to clear IE browsing history and try it again or use the MSI to install AAD

CCMA Launchpad shows more items which should be hidden. This backslash issue happens with IE on both client and server

Tracking Number	CC-17167
Application	Contact Center Manager Administration
Description	CCMA Launchpad displays more items which should be hidden on AACC/ ACCS 7.0.3 and 7.1. This backslash issue happens with IE on both client and server.
Impact	Launchpad page
Workaround	KB4491113 fixed IE backslash issue. KB4491113 resolves this issue on Windows 2012 server. KB4487011 – Window 10 1703 (https://support.microsoft.com/en-us/help/4487011/windows-10-update-kb4487011) KB4482887 – Window 10 1809 (https://support.microsoft.com/en-us/help/4482887/windows-10-update-kb4482887) If the issue still shows, please also check the following things for IE: a) Internet Options -> Advanced and uncheck "Always expand ALT text for images". Click Apply button. b) Go to Multimedia and check "Show pictures". Click Apply button c) Close IE and Open IE and try CCMA URL again

After migrating from NES 6.0 or NES7 to AACC SIP 7.1 Windows 2016, cannot find "IcelInstallADAM.vbs" when upgrading CCMA data

Tracking Number	CC-18121
Application	Contact Center Manager Administration
Description	After migrating from NES 6.0 or NES7 to AACC SIP 7.1 Windows 2016, a message showing that the file "C:\Windows\system32\ADAMScripts\IcelInstallADAM.vbs" cannot be found when upgrading CCMA data.
Impact	Migrating NES6 or NES7 to AACC 7.1 on Windows 2016
Workaround	We will use CCMA 6.4 as a middle layer. NES6/7 backup data will be restored on CCMA 6.4, then backup it as 6.4 backup data, then migrating this new 6.4 backup data on Windows 2016. Here are steps: 1. Migrate NES6/7 to 6.4 SP16 a) On CCMA 6.4 SP16, we delete all of CCMS servers, Users, Partitions and Access Class b) On 6.4 SP16, on drive D: , create a folder NES67 then copy the following files from a 7.0 machine - ntbackup.exe - ntmsapi.dll - vssapi.dll c) Copy NES67 backup file (.bkf file) to NES67 folder d) Run ntbackup.exe and select the backup file of NES67 (bkf file) then only select "Program Files" to restore CCMA files e) Run CCMA System Upgrade Utility f) Run CCMA backup&Restore to take a CCMA backup file on 6.4 SP15. This file is used for migration on Windows 2016 For more details, please refer to [NES67 workaround pictures.docx] file from the JIRA

CCMA - Users cannot input FQDN name for AMS server name and FQDN name's length is longer than 30 characters

Tracking Number	CC-18904
Application	Contact Center Manager Administration
Description	Users cannot add a Media server name with FQDN name that its length is larger than 30 characters into CCMA Media Servers Configuration
Impact	Prompt Management
Workaround	Add Avaya Aura® Media Server to CCMA Media Servers Configuration as the trusted host name (AMS server name, not FQDN name). The trusted host name is the Avaya Aura® Media Server name that is used to sign the certificate. Note: If you are using AMS HA, please use the AMS managed name (short name, not FQDN name) already signed in the certificate. For more information, please refer to CC-16818/CC-18621 - 7.1 Document update for Media Server hostname to be added to CCMA as trusted name.

Installing CCMS Patch on a very large database can take 20+ minutes

Tracking Number	CC-5140
Application	Contact Center Manager Server
Description	Installing CCMS Database Patch on a very large database can take up to 23 minutes. This is due to re-indexing of the CCMS database tables with large volume of data in the order of few million rows.
Impact	Longer CCMS patch install time.
Workaround	None

Agent Controls Browser Application – Online help not available when using Chrome browser

Tracking Number	CC-9849
Application	Agent Controls Browser Application
Description	Online help feature is not working when using Chrome browser.
Impact	Online documentation not available with this browser type.
Workaround	Online help may be accessed using another browser.

Agent Controls not working in Firefox Browser

Tracking Number	CC-11673
Application	Agent Controls Application
Description	The agent controls application will not connect to the Integration Portal web socket when launched from Mozilla Firefox browser.
Impact	It is not possible to use Agent Controls Application with Mozilla Firefox browser.
Workaround	Use another browser, for example Internet Explorer.

On one particular deployment CCMS IS_Service fails to start

Tracking Number	CC-13554
Application	Contact Center Manager Server
Description	On one particular deployment CCMS IS_Service fails to start.
Impact	Intrinsics in scripting do not have valid data.

Solution	There is no workaround. However, the problem usually disappears after a server restart.
----------	---

AAD does not display Agent Statistics when security is on

Tracking Number	CC-13431
Application	Agent Desktop
Description	AAD will fail to display Agent Statistics if the following conditions exist: 1) Security is turned on in Security Manager (formerly known as Certificate Manager) 2) The server signed cert has SAN's configured, ie for MCHA deployments the managed name should be configured as a SAN 3) The hostname configured within CCMM Administration for CC Web Stats matches one of these SAN names. ie in MCHA the managed name is configured
Impact	If the conditions described above exist then Agent Statistics will not display in AAD
Solution	The work around is to configure (Agent Statistics) CC Web Stats to use an IP address instead of a hostname or FQDN. 1) Through CCMA launch the CCMM Administration client 2) Navigate to: General Administration -> Server Settings 3) With Server Settings selected on the left hand pane, a list of host names should be present on the right hand pane. 4) Under Server Type find an entry called CC Web Stats and change the Hostname entry to use the relevant IP address instead of a hostname or FQDN 5) In HA environments this should be the managed IP address, in all other environments this should be the CCMS server IP address

AAD dashboard unable to zip log files from most recent startup

Tracking Number	CC-14479
Application	Agent Desktop
Description	Cannot create log Zip file when collect logs from 'Most Recent Startup' option is selected in AAD dashboard
Impact	Unable to use the collect logs from 'Most Recent Startup' option
Workaround	Use 'Last hour' or 'Specify Time and Date' options to collect logs.

For large Contact Centers, Agent RTD may fail to load agents

Tracking Number	CC-13860
Application	Contact Center Manager Administration
Description	For a Contact Center with a very large number of configured agents, the time to load the agent records from the database may exceed the configured timeout. If the timeout is exceeded, the Agent RTD will not display the agents.
Impact	Workaround
Workaround	Increase the OAM Timeout to allow more time to load the agent records from the database. 1. From Start Menu, launch Manager Administration Configuration.

Release Notes

2. Select RTR Registry Settings.
3. Change OAM Timeout to 300000 milliseconds.
4. Accept the ICERtdService restart.

Loading of agent from database failed

Tracking Number	CC-13265
Application	Contact Center Manager Server
Description	Issue observed on one test server. OAM bridge on startup logs SQL exception and fails to add agents to CMF space. This caused "no devices mapped to session" error in RefClient, similar may be observed in AAAD.
Impact	Agents unable to login or process calls
Solution	Work around applied: 1) Create new agent using CCMA 2) Restart contact center

Creating a Prepared Response generates an error dialog popup

Tracking Number	CC-14815
Application	CCMM Administration
Description	When a user saves a new Prepared Response in CCMM Admin, a dialog pops up saying that "Prepared response body could not be updated". However the prepared response is generated successfully.
Impact	The user is given incorrect feedback on the operation
Workaround	Generate the prepared response as normal and ignore the erroneous popup.

Main call gets disconnected when a transfer/conference is initiated to another agent using phonebook (for a setup using IPO 11.x & ACW)

Tracking Number	CC-14785
Application	IPO 11.x, ACW, SIP Gateway Manager
Description	On a setup with IPO 11.x with agent using Avaya Communicator for Windows as agent station, the main call gets disconnected when a transfer or conference is completed to agent number selected from AAD's phonebook entry. This issue is not seen when IPO 10.x is used. The issue is not seen when agent uses his phone to initiate the consult call. Also, issue does not occur for ACW on Windows 10.
Impact	The customer call is dropped for the specific case mentioned above.
Workaround	Workaround is for the agent to not use the phonebook entry to initiate the call and instead dial the number manually in AAD or to use his phone to initiate the consult.

In some lab upgrades with a Local WebLM configuration, AACC was found to be operating with grace licensing after the upgrade

Tracking Number	CC-17177
Application	Upgrade
Description	In some lab upgrades with a Local WebLM configuration, AACC was found to be operating with grace licensing after the upgrade.

Release Notes

Impact	The system is operating with grace licensing. Grace licensing is allowed to be in effect for 30 days.
Solution	The XML license file must be re-applied using License Manager Configuration Utility .

CCMM Services not all starting on a fresh install, where Security has failed to be applied via Ignition Wizard

Tracking Number	CC-18286
Application	Ignition Wizard
Description	When a user imports certificate in Security Store Ignition Wizard can create broken certificate with alias URIName.
Impact	Security fails during configuration and CCMM services not all starting on a fresh install
Workaround	Do not set security on in Ignition Wizard. Security can be applied via the "Security Manager" application after install has completed.

Local WebLM may have issues after downgrade to 7.0.x with Security ON

Tracking Number	CC-18589
Application	License Manager
Description	There may be issues with Local WebLM after downgrade from 7.1.0.1 to 7.0.x with security ON. The problem will happen if after downgrade, the security is disabled and the keystore is deleted - local WebLM won't start and manual modification of Tomcat's server.xml will be required.
Impact	Local WebLM fails to start so the product will have issue with licensing
Workaround	If local WebLM is used then turn off the security using Security Manager before downgrade to 7.0.x. The security can be re-enabled after downgrade is finished

Localization issues

Internationalization issues or common across all languages and require a base fix

APPENDIX

Appendix A – Issues Addressed in this release

This section of the release notes provides information on customer issues that have been addressed in this Feature Pack.

CCMS, CCSU, CCCC and CCLM Defect Listing

This list contains defects addressed for the Manager Server, Common Components and License Manager Components

WI/JIRA	Summary
CC-15073	Offline Store requires signme.csr to become active
CC-16873	Calls stuck in Master script
CC-16903	skillsets missing from MRCV
CC-17004	Call not presented to agent following return to queue
CC-17186	RTDs not correctly showing agent status
CC-18482	Port fix to 7.0.3 APPEND js_Token_cv TO jsBearerToken_cv command fails
CC-18593	tolower() conversion taking place should not be applied to data
CC-18604	Event in App Event log references mismatch between ACCS SIP domain and secondary IPO SIP Registrar
CC-18701	CTI link not coming up
CC-18725	When agent answered CDN call AAAD is able to show the Caller ID/ANI
CC-18850	ASM terminated. Stack trace shows ermination in "xmlWrp::operator"

CCMA Defect Listing

This list contains defects addressed for the Manager Administration components

WI/JIRA	Summary
CC-18588	CCMA Bulk import of users fails for a domain name containing a hyphen
CC-18601	CCMA - SSO via SMGR - User name containing dot failing web services authentication

CCMM/AAD Defect Listing

This list contains defects addressed for the Multimedia\Outbound Server and Avaya Agent Desktop Components

WI/JIRA	Summary
CC-6722	{AML} ACC7.0_POM_ACW is not pegged in historical reports
CC-8379	CCMM Data Management Utility: "% free" figure enhancement
CC-13725	no reporting of POM agent after invalid handling of agentid having leading zero
CC-17015	Unable to schedule callback with AAD on system on Finnish locale
CC-17224	Email manager stops downloading with Java Heap error
CC-17645	AAD freeze after call transfer seen with multiple exception pattern in AAD log
CC-17946	Outbound Contact Scheduler is not changing contact from Waiting to New
CC-18024	AAD no disposition button after change of contact SessionID after proxy reconnect

CC-18199	Application has % in the Path opening outside AAD it is replacing the % with %25
CC-18371	AAD - Deleted Agents appear at the top of the list of users by their login ID
CC-18454	Unable to transfer emails with attachments, getting the error as "An error has occurred when attempting to transfer this emails attachments."
CC-18490	Midfirst : AACC 7.0.3 : AAAD jumps to tab 1 when restoring call from hold
CC-18614	ACCS 7.0.3 - Advanced screenpops with filter with Agent Queue To is not working properly

CCT Defect Listing

This list contains defects addressed for the Communication Control Toolkit components of Avaya Aura® Contact Center Select.

WI/JIRA	Summary
CC-17223	Agent can't drop customer call leg intermittently after a conference
CC-18605	NCCT TAPI crash

Install Defect Listing

This list contains Installation defects addressed for in this release

WI/JIRA	Summary

Workspaces Defect Listing

This list contains defects addressed for the Workspaces components

WI/JIRA	Summary
CC-18268	Start Work fails for all agents after un-controlled AACC restart
CC-18997	CCS - Unable to answer transferred to skillset web chat contact

CCMA ActiveX Control MSI – Content and Versions

File Name	File Size (bytes)	Version
ChartWrapperCtrl.ocx	57344	1.0.0.1
DTPWrapperCtrl.ocx	90112	8.0.0.0
hrctrl.dll	106496	8.0.0.4
iceemhlpcontrol.dll	122880	8.0.0.2
icertdcontrol.dll	847872	9.0.0.3
iemenu.ocx	65648	4.71.115.0
ntzlib.dll	65080	1.1.4.0
olch2x8.ocx	2102448	8.0.20051.51
rope.dll	241664	1.0.0.4
rsclientprint.dll	594432	2011.110.3128.0
sstree.ocx	337120	1.0.4.20
WSEColorText.ocx	172032	6.0.0.15
xerces-c_2_7.dll	1893832	12.5.0.1190

Appendix B – Additional Security Information

Store Maintenance – backup and restore

Backing up the Certificate Store

- 1) Ensure all services are stopped
- 2) Launch Security Manager
- 3) Go to Store Maintenance Tab
- 4) In the Backup and Restore Certificate Store section choose a location in which to create the backups.
NOTE: do not choose a Contact Center directory structure
- 5) Press the Backup button to back up the store and its associated files
- 6) Check your chosen backup location and verify the following files are present in the directory:
CCKeyStore.jks, signme.csr (optional), storeInformation.txt ,storePwdEncrypt.txt

Restoring the Certificate Store

- 1) Ensure all service are stopped
- 2) Launch Security Manager
- 3) Go to Store Maintenance Tab
- 4) Select the location where your backups are stored, in the Backup and Restore Certificate Store section
- 5) Press Restore button to restore the store and associated files
- 6) Close Security Manager
- 7) Open Security Manager and confirm store has the correct content
- 8) Start Services

After restoring Certificate Store – Reset Security Level if previously set to ON

If the certificate store has been restored onto a system that contained another store and had the security level set to ON then the following steps have to be followed to apply the new stores certificates to the various web servers otherwise the previous stores certificates will remain in effect.

This procedure is only if the previous security setting was set to ON while using the previous store and the store has been restored.

- 1) Ensure all services are stopped.
- 2) Launch Security Manager.
- 3) Go to Security Configuration Tab.
- 4) Check Security level – If ON then turn OFF and then ON again.
- 5) Hit Apply button.

This effectively will remove the previous configuration settings on the various web servers and apply the contents of the new store to web servers.

Failure to follow this step will result in the various web servers using the certificates from the previous store regardless of the restore procedure.

Restoring a certificate store whose contents have been signed by another Certificate Authority

If the certificate store has been restored to a system that used another certificate authority (CA) to sign the contents of the store used previously then, if not done already, the root certificate authority certificate will have to be deployed to the various clients that communicate with the server.

If the restored certificate store has been signed by the same certificate authority then this is not required since the root CA certificates should have already been distributed.

Backing up the Certificate Store

- 1) Ensure all services are stopped
- 2) Launch Security Manager
- 3) Go to Store Maintenance Tab
- 4) In the Backup and Restore Certificate Store section choose a location in which to create the backups.
NOTE: do not choose a Contact Center directory structure
- 5) Press the Backup button to back up the store and its associated files
- 6) Check your chosen backup location and verify the following files are present in the directory:
CCKeyStore.jks, signme.csr (optional), storeInformation.txt ,storePwdEncrypt.txt

Restoring the Certificate Store

- 9) Ensure all service are stopped
- 10) Launch Security Manager
- 11) Go to Store Maintenance Tab
- 12) Select the location where your backups are stored, in the Backup and Restore Certificate Store section
- 13) Press Restore button to restore the store and associated files
- 14) Close Security Manager
- 15) Open Security Manager and confirm store has the correct content
- 16) Start Services

After restoring Certificate Store – Reset Security Level if previously set to ON

If the certificate store has been restored onto a system that contained another store and had the security level set to ON then the following steps have to be followed to apply the new stores certificates to the various web servers otherwise the previous stores certificates will remain in effect.

This procedure is only if the previous security setting was set to ON while using the previous store and the store has been restored.

- 1) Ensure all services are stopped.
- 2) Launch Security Manager.
- 3) Go to Security Configuration Tab.
- 4) Check Security level – If ON then turn OFF and then ON again.
- 5) Hit Apply button.

This effectively will remove the previous configuration settings on the various web servers and apply the contents of the new store to web servers.

Failure to follow this step will result in the various web servers using the certificates from the previous store regardless of the restore procedure.

Restoring a certificate store whose contents have been signed by another Certificate Authority

If the certificate store has been restored to a system that used another certificate authority (CA) to sign the contents of the store used previously then, if not done already, the root certificate authority certificate will have to be deployed to the various clients that communicate with the server.

If the restored certificate store has been signed by the same certificate authority then this is not required since the root CA certificates should have already been distributed.

TLS Information

For non-mandatory TLS SIP connections

IP Office releases TLSv1 support

All supported IP Office releases currently provide support for TLSv1.0, TLSv1.1 and TLSv1.2.

Avaya Aura Media Server releases and TLSv1 support

AAMS Release	TLS v1.0 support	TLS v1.1 support	TLS v1.2 support	Options
8.0	No	No	Yes	Configurable (via Element Manager) TLSv1.0 or TLSv1.1 can be set instead if required

Known applications and services that cannot support TLS v1.2**HDX / DIW connection to databases**

HDX / DIW can be used to connect to customer databases. HDX / DIW connect to a remote database using an ODBC Data Source Name (DSN). The DSN for the database connection must be manually created on ACCS using the ODBC Data Source Administrator.

If connecting to older versions of Microsoft SQL Server, the DSN created will not connect successfully if TLS is set to higher than TLS v1.0. In this scenario, enable TLS v1.0 on Security Manager Security Configuration field "CCMA – Multimedia Web Service Level".

Remote desktop

Remote desktop connections can also be impacted on some client machines and requires a Microsoft KB required to remote into ACCS server when TLS v1.1 or higher is set due to RDC only supporting TLS v1.0. Disabling TLS 1.0 on the CCMA- Multimedia web services setting in Security Manager will break RDP under default settings on Windows 7 clients and Windows 2008 R2 Server.

This setting covers the entire ACCS server and not only CCMA-MM WS and thus causes remote desktop connections to fail from Windows 7 and Windows 2008 R2 server due to the fact it cannot support TLS v1.1 or TLS v1.2.

Please apply the following KB from Microsoft on your CLIENT or machine wishing to connect to CC server.

This update provides support for Transport Layer Security (TLS) 1.1 and TLS 1.2 in Windows 7 Service Pack 1 (SP1) or Windows Server 2008 R2 SP1 for Remote Desktop Services (RDS).

<https://support.microsoft.com/en-us/kb/3080079>

System Manager 7.0

System Manager 7.0 and earlier releases do not support TLS 1.1 and TLS 1.2

If implementing a Single Sign-On configuration using System Manager to login to CCMA then if TLS 1.1 or TLS 1.2 is enabled the System Manager login page will not be presented.

System Manager 7.0.1 includes support for TLS 1.1 and TLS 1.2