

Avaya Solution & Interoperability Test Lab

Application Notes for Configuring Sonexis ConferenceManager with Avaya IP Office using a SIP trunk – Issue 1.0

Abstract

These Application Notes describe the procedure for configuring Sonexis ConferenceManager to interoperate with Avaya IP Office using a SIP trunk.

Sonexis ConferenceManager is an in-house audio conferencing bridge that eliminates the costly pay-as-you-go fees of subscription-based services, while setting new standards for security and ease of use. Sonexis ConferenceManager is designed to work within existing voice and data networks — and available with a fully integrated Web conferencing option

Information in these Application Notes has been obtained through DevConnect compliance testing and additional technical discussions. Testing was conducted via the DevConnect Program at the Avaya Solution and Interoperability Test Lab.

©2013 Avaya Inc. All Rights Reserved.

1. Introduction

These Application Notes describe the procedure for configuring Sonexis ConferenceManager (herein referred to as ConferenceManager) to interoperate with Avaya IP Office.

ConferenceManager is an in-house audio conferencing bridge that eliminates the costly pay-as-you-go fees of subscription-based services, while setting new standards for security and ease of use. ConferenceManager is designed to work within existing voice and data networks, and ConferenceManager is available with a fully integrated Web conferencing option.

These Application Notes assume that Avaya IP Office and Avaya Communication Server 1000 Release 7.5 are already installed and basic configuration steps have been performed. Only steps relevant to this compliance test will be described in this document.

- SIP trunk configuration in IP Office
- Short Code for call route
- Incoming Call Route

2. General Test Approach and Test Results

The general test approach was to place calls to and from ConferenceManager. The main objectives were to verify the following:

- Inbound calls
- Outbound calls
- Hold / Resume
- Call termination (origination/destination)
- Transfer (blind/consult)
- Conference (client initiated/host initiated)
- DTMF
- ANI/DNIS

2.1. Interoperability Compliance Testing

The interoperability compliance testing included features and serviceability tests. The focus of the compliance testing was primarily on verifying the interoperability between ConferenceManager and Avaya IP Office.

2.2. Test Results

The test objectives were verified. For serviceability testing, ConferenceManager operated properly after recovering from failures such as cable disconnects, and resets of ConferenceManager and Avaya IP Office.
During testing here is the observation: Originally, it was required to test the Sonexis for SIP Multi-Server with Avaya IP Office 8.1. Start a 1st conference. Leave that call up (put phone down or put on hold). Start a second conference, on a different conference ID. This will cause the Sonexis to "SIP REFER" the call from system 1 to system 2. In this case, Avaya IP Office 8.1 does not support this SIP REFER method. It will be supported in future release of IP Office.

©2013 Avaya Inc. All Rights Reserved.

2.3. Support

Technical support for the ConferenceManager solution can be obtained by contacting Sonexis:

- URL – CustomerCare@sonexis.com
- Phone – (866) 676-6394

3. Reference Configuration

Figure 1 illustrates the configuration used in these Application Notes. The sample configuration shows an enterprise with Avaya IP Office. Endpoints include an Avaya IP Softphone, 9630G, 1608 DCP and 1140SIP on IP Office.

Note: An Avaya S8300D Server and an Avaya G450 Media Gateway were included to simulate PSTN calls.

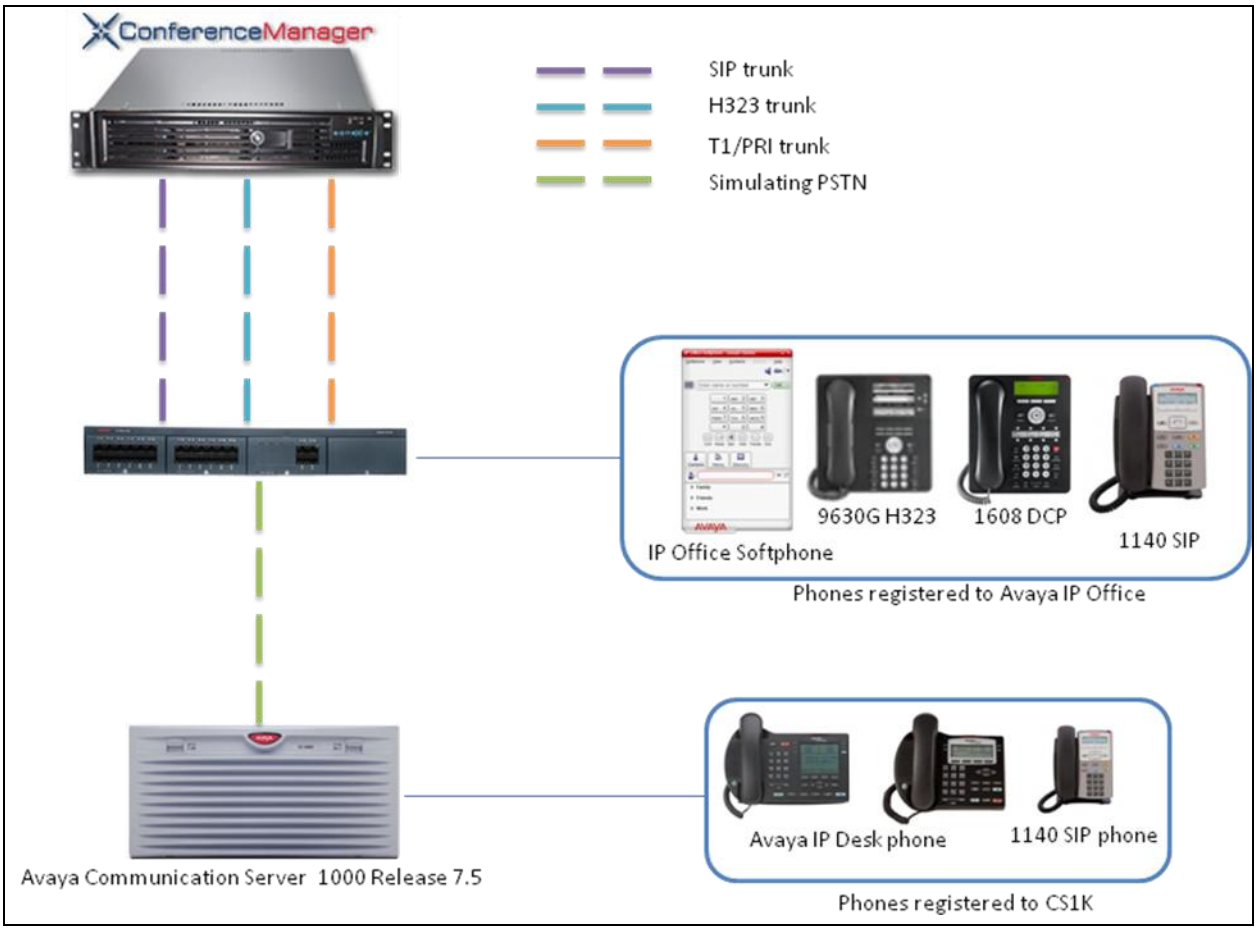


Figure 1: Test Configuration of Sonexis ConferenceManager

©2013 Avaya Inc. All Rights Reserved.

4. Equipment and Software Validated

The following equipment and software were used for the test configuration.

Equipment		Software/Firmware
Avaya IP Office 500 V2		8.1(63)
Avaya IP Office Manager on Windows XP Professional 2002 with SP3		10.1(63)
Avaya Communication Server 1000E running on CP+PM server as co-resident configuration		Release 7.5 Version 7.50.17 Service Pack: 7.50_17 Dec. 12th 2012 Call Server Deplist: X21 07.50Q (Dec. 12th2012)
Avaya phones on IP Office		
	IP Office Softphone 9630G H323 1608 DCP 1140 SIP	 3.1.5 NA 04.03.12
Avaya phones on Avaya Call Server 1000 7.5 (simulating PSTN phones)		
	UNIStim 1140 SIP	FW0625C8L Load 04.03.12.00
Sonexis on Windows Server 2008 with SP 2		10.1.35 Patch 4

5. Configure Avaya IP Office

This section describes the steps required for configuring Avaya IP Office. During the compliance test, a SIP trunk was utilized between Avaya IP Office and ConferenceManager.

The procedures include the following areas:

- Verify SIP trunk Channels License
- Configure LAN interface
- Enable SIP Trunk
- Create the static SIP line
- Configure SIP URI parameters for the SIP Line
- Configure VoIP Parameters for the SIP Line
- Configure a short code to route calls through the SIP trunk
- Create an Incoming Call Route for the Inbound SIP calls

These steps are performed from the Avaya IP Office Manager.


©2013 Avaya Inc. All Rights Reserved.

5.1. Verify SIP Trunk Channels License

IP Office is configured via the IP Office Manager application. Log into the PC running the Avaya IP Office Manager application, and select **Start → All Programs → IP Office → Manager** to launch the Manager application. Select the proper IP Office system if there are more than one IP Office system, and log in with the appropriate credentials.

From the configuration tree in the left pane, select **License → SIP Trunk Channels** to display the SIP Trunk Channels screen in the right pane. Verify that the **License Status** field is set to **Valid**.


If a required feature is not enabled or there is insufficient capacity, contact an authorized Avaya sales representative to make the appropriate changes.

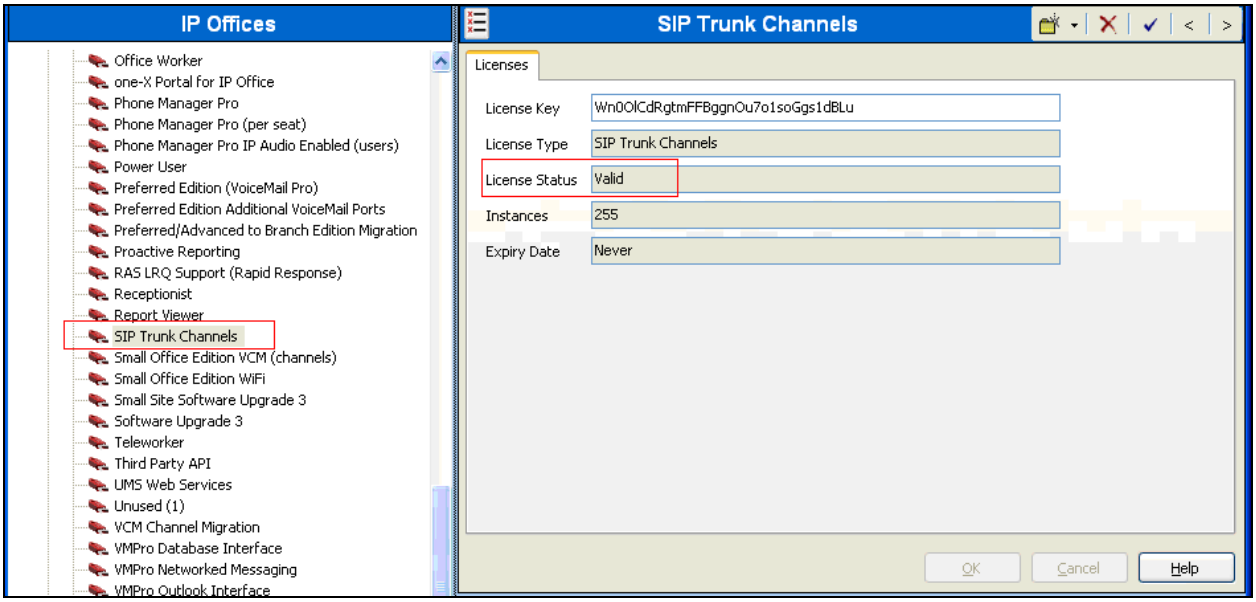

©2013 Avaya Inc. All Rights Reserved.

5.2. Configure LAN interface

From the configuration tree in the left pane, select **System** to display the System screen in the right pane. Click the **LAN1** tab. Under the **LAN1** tab, select the **LAN Settings** sub-tab, and provide **IP Address** for the IP Office and **IP Mask**.

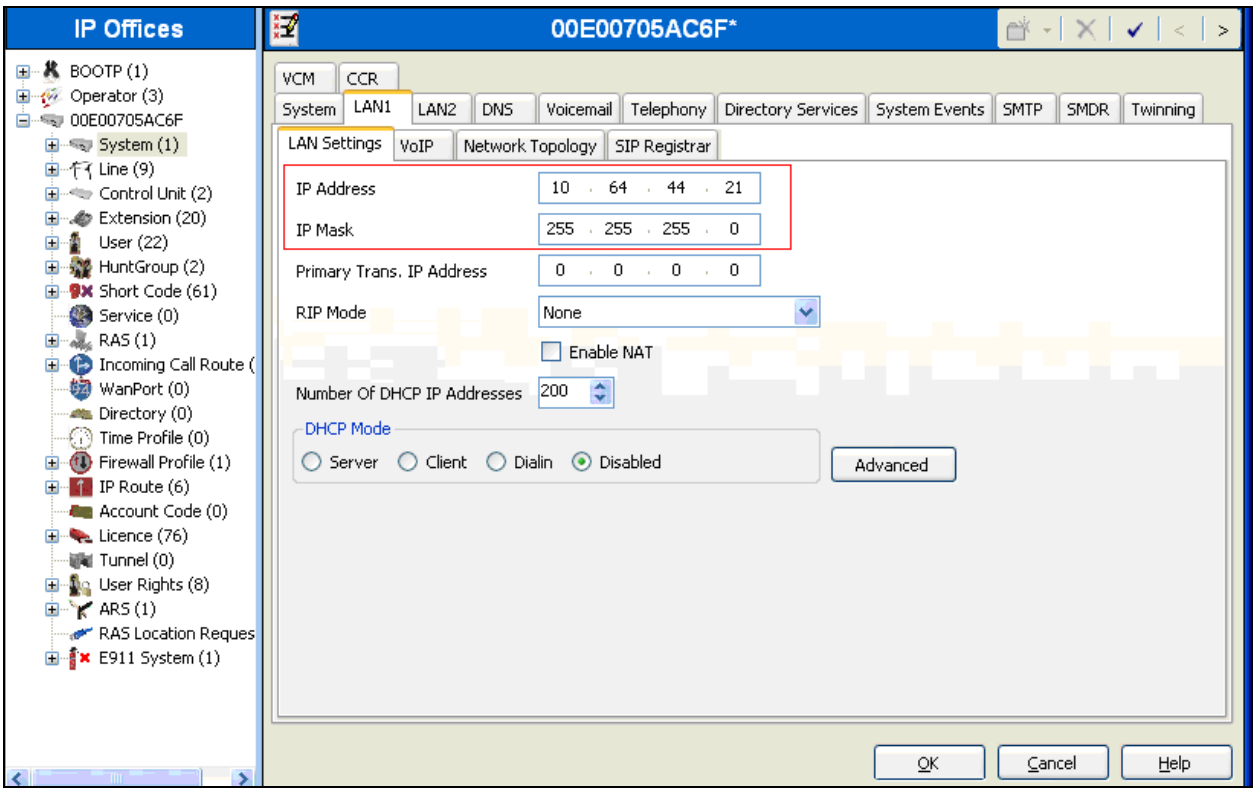


©2013 Avaya Inc. All Rights Reserved.

5.3. Enable SIP Trunk

Under the **LAN1** tab, select the **VoIP** sub-tab and check the **SIP Trunks Enable** box. Click the **OK** button.


Note: During the initial configuration of Avaya IP Office, the LAN1 was configured as a private network (LAN) and the LAN2 was configured as a public network (WAN). Avaya IP Office can support SIP extensions on the LAN1 and/or LAN2 interfaces. However, the compliance test used the LAN1 interface for a SIP trunk termination.

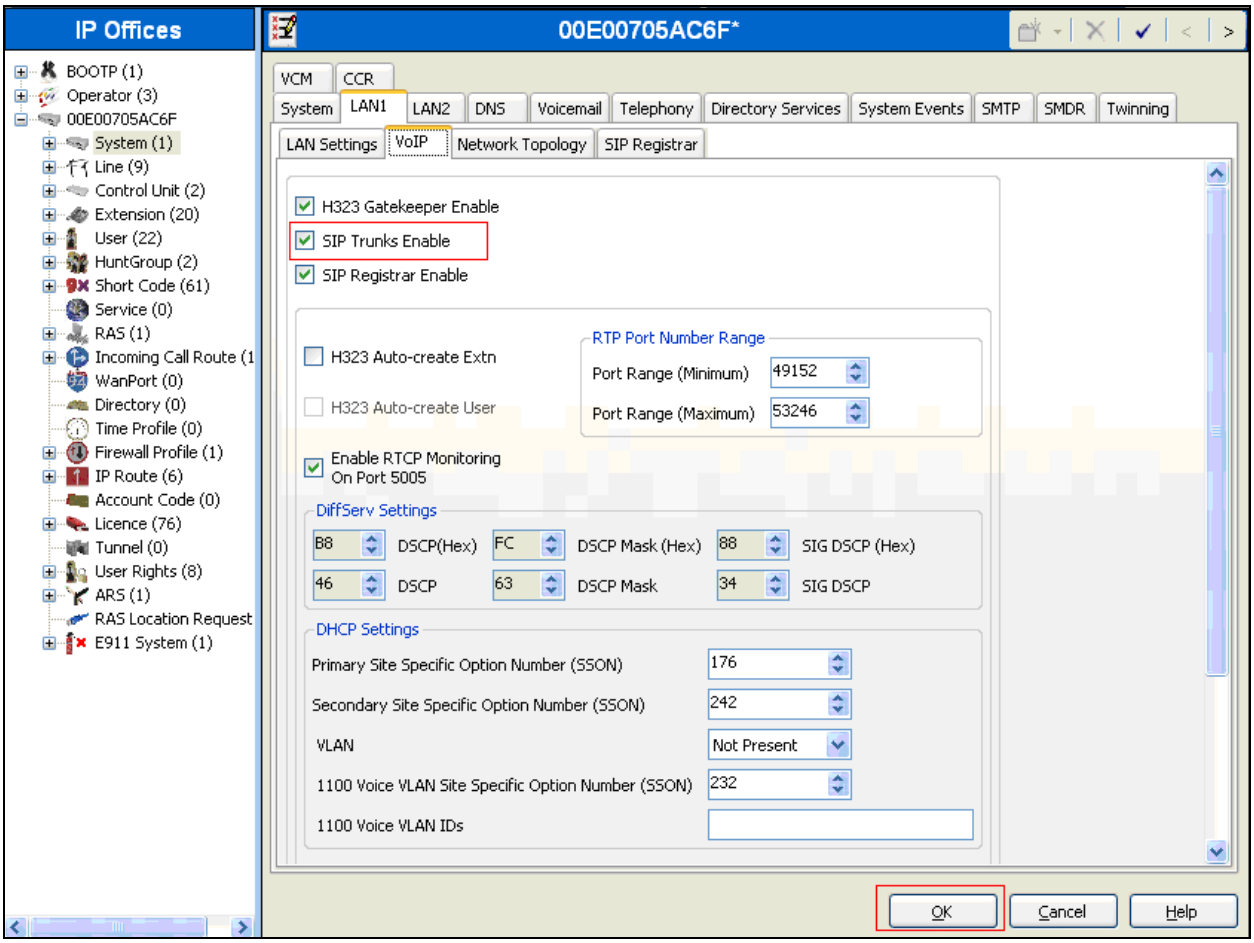

©2013 Avaya Inc. All Rights Reserved.

5.4. Create SIP Lines for a SIP Trunk


Select **Line** in the left pane. Using the right mouse click, select **New** ➔ **SIP Line** [not shown], and create a new **Line Number**. Enter an appropriate domain on the **ITSP Domain Name** field, and check the **InService** check box. Make sure **REFER Support** is checked. During the compliance test, a SIP line (27) was configured.

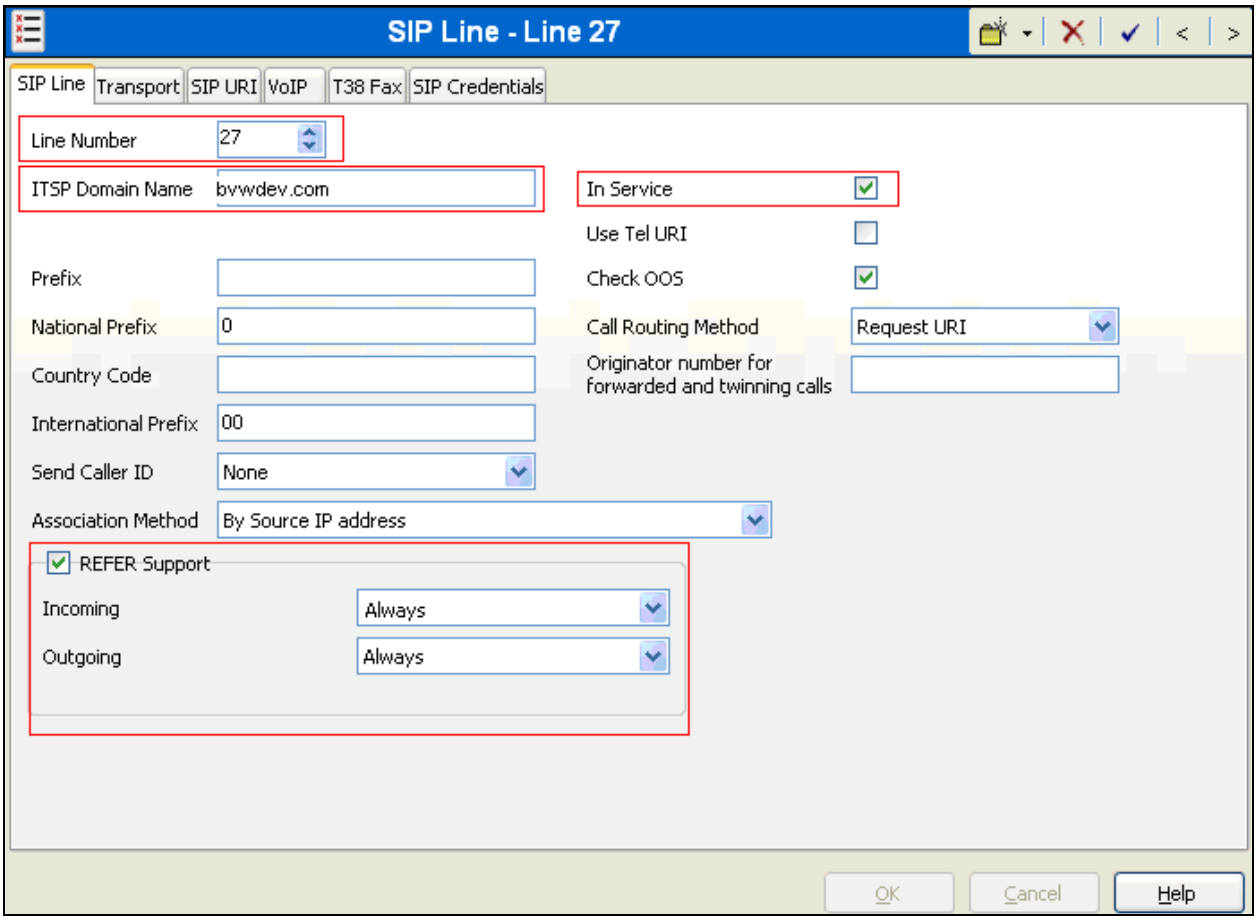

©2013 Avaya Inc. All Rights Reserved.


Select the **Transport** sub-tab, and provide the following information:

- **ITSP Proxy Address** – Enter the IP address of the far-end SIP termination point. This is IP address of Sonexis system.
- **Layer 4 Protocol** – Select **UDP**.
- **Use Network Topology Info** – Select **None**.

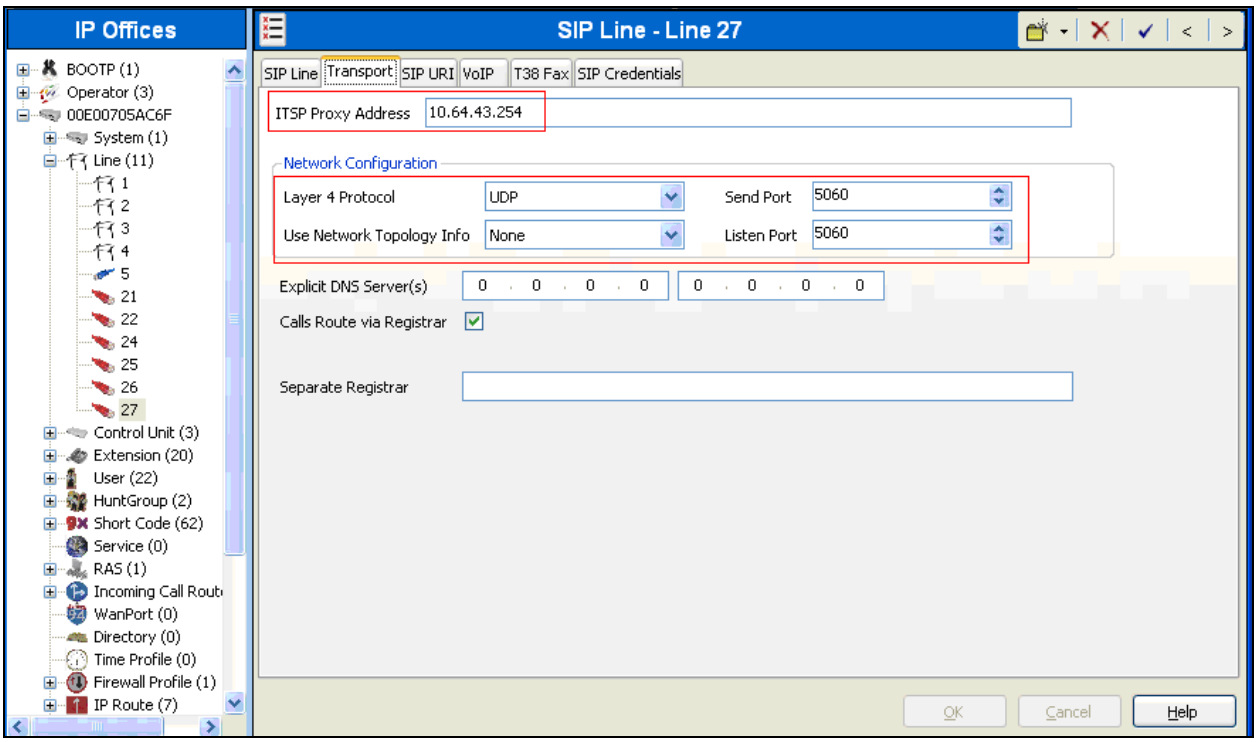


5.5. Configure SIP URI Parameters for the SIP Line

Select the **SIP URI** tab to configure SIP URI parameters for the SIP Line. Click on the **Add** button.

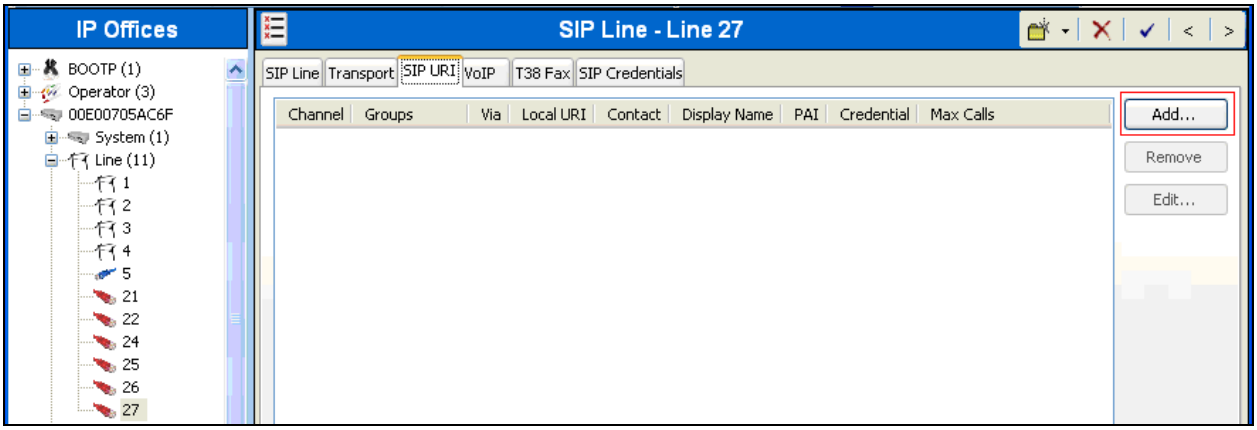

©2013 Avaya Inc. All Rights Reserved.

Select ***** for the **Local URI**, **Contact**, and **Display Name** fields. Enter a unique number for the **Incoming Group** and **Outgoing Group** fields. The **Incoming Group** field will be used for mapping inbound calls from the SIP trunk to local stations. The **Outgoing Group** will be used for routing calls externally via the Short Code configured in **Section 5.7**. Use default values for all other fields. Click the **OK** button.

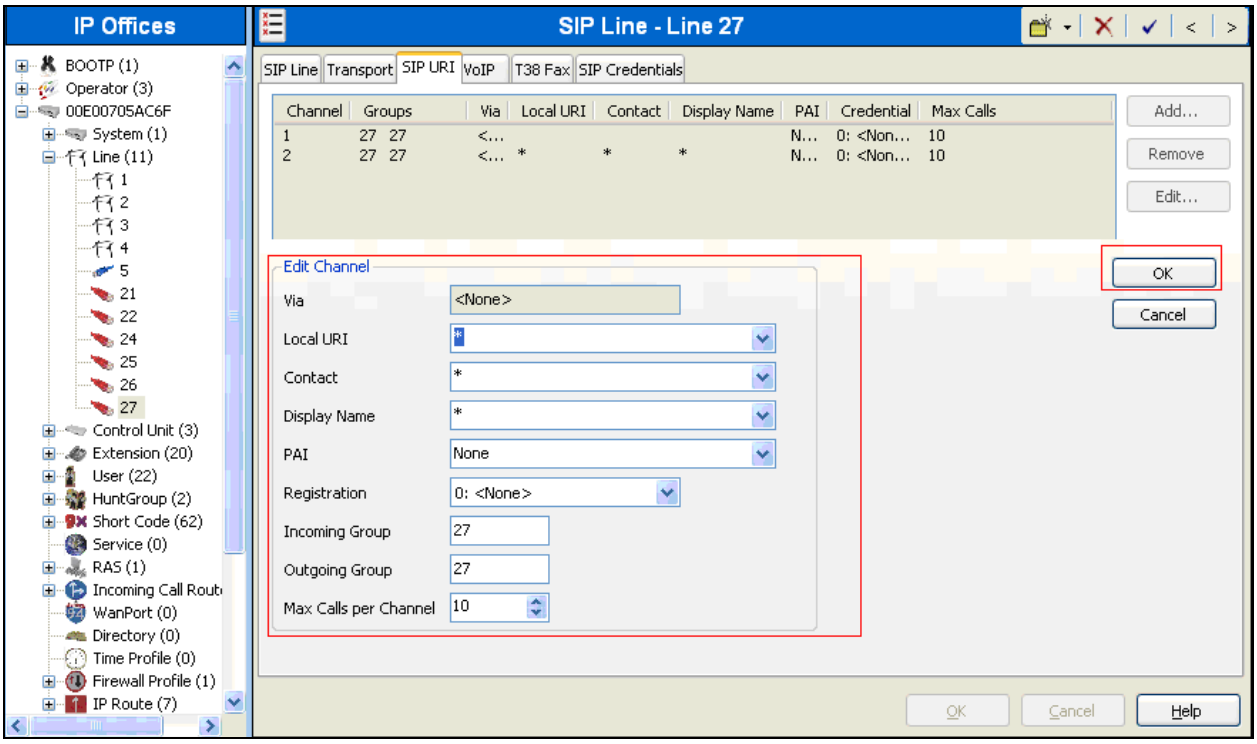


©2013 Avaya Inc. All Rights Reserved.

5.6. Configure VoIP Parameters for the SIP Line

Select the **VoIP** tab to Configure VoIP parameters for the SIP Line. For **Compression Mode**, select **G.711 ULAW 64K**, since ConferenceManager only supports G.711MU. Check **Re-invite Supported** check boxes.

Click the **OK** button.

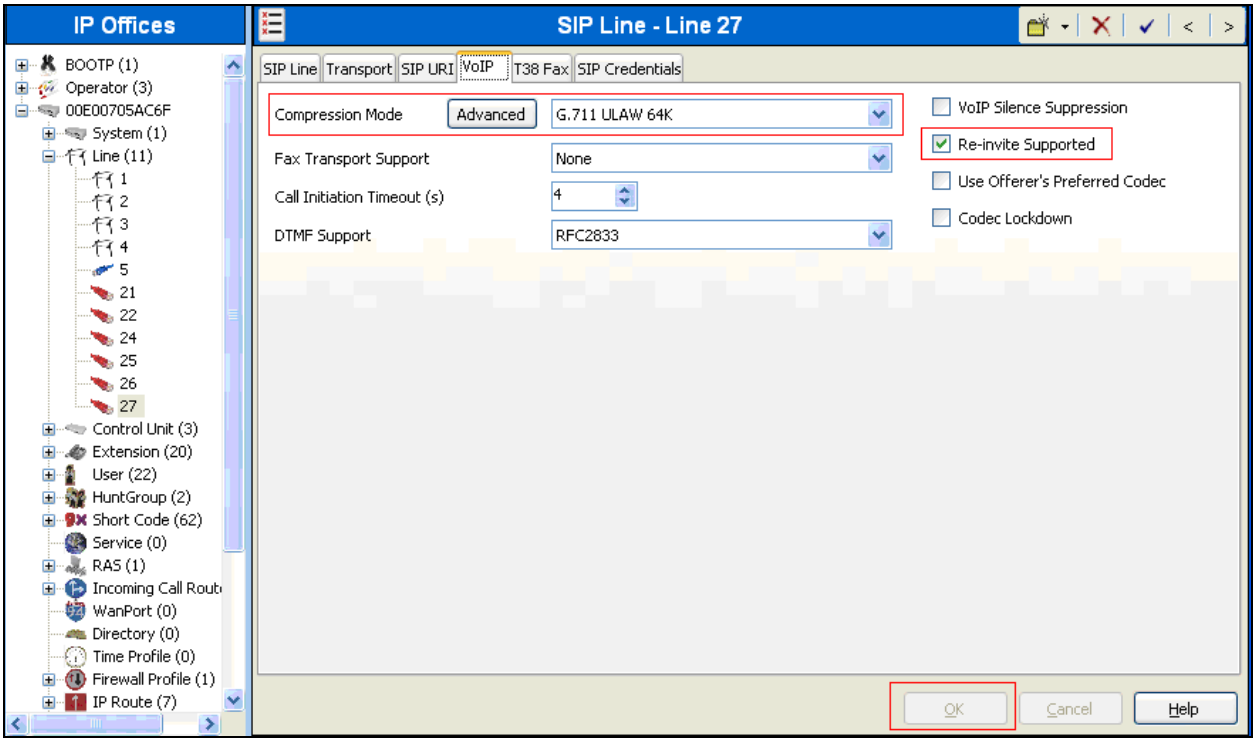


©2013 Avaya Inc. All Rights Reserved.

5.7. Configure a Short Code to Route Calls through the SIP trunk

Select **Short Code** in the left panel. Right click and select **Add**. Enter **78101;** where extension **78101** will be routed to ConferneceManager, in the **Code** text box. Select **Dial** for the **Feature** field. Enter the **Outgoing Group** number created in **Section 5.4** for the **Line Group Id** field. Enter **."@bvwdev.com"** for the **Telephone Number** field. Use default values for all other fields. Click the **OK** button.

Note: When extension 78101 was dialed, the call routed thru the SIP trunk 27.

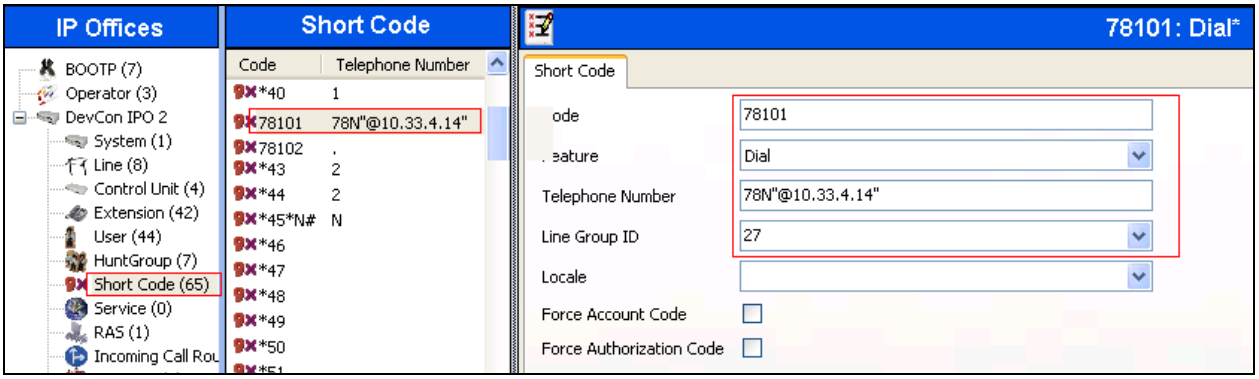


5.8. Create an Incoming Call Route for the Inbound SIP Calls

Select **Incoming Call Route** in the left pane. Right-click and select **New**.

Enter the following:


- **Any Voice** for the **Bearer Capability** field.
- Enter the **Incoming Group** number created for the URI in **Section 5.4** in the **Line Group Id** field.
- Use default values for all other fields.

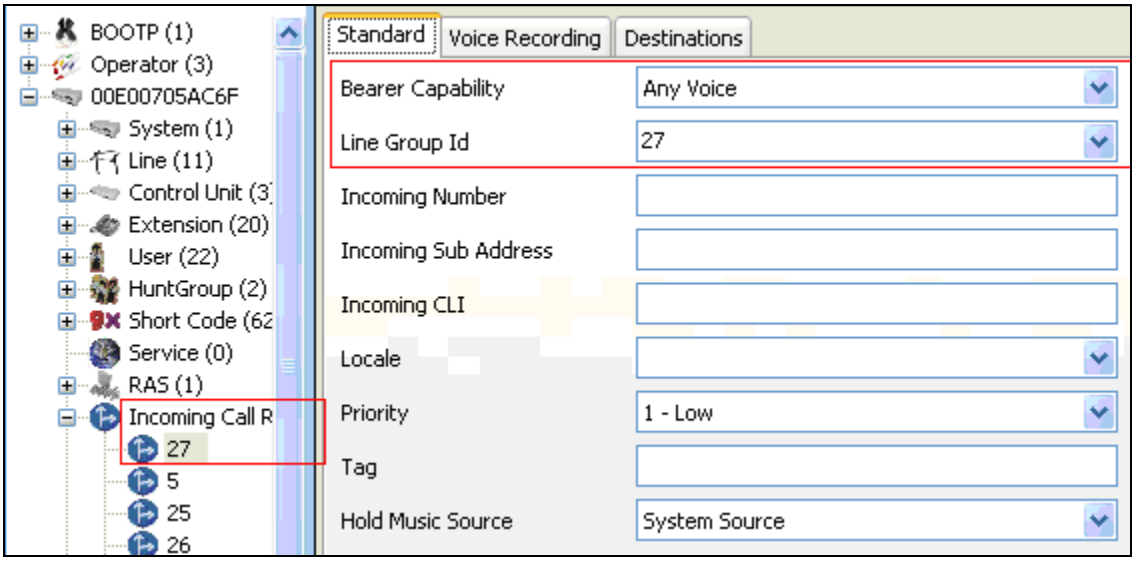

©2013 Avaya Inc. All Rights Reserved.

Next, navigate to the **Destinations** tab and enter "**.**" under the **Destination** field.

Click the **OK** button.

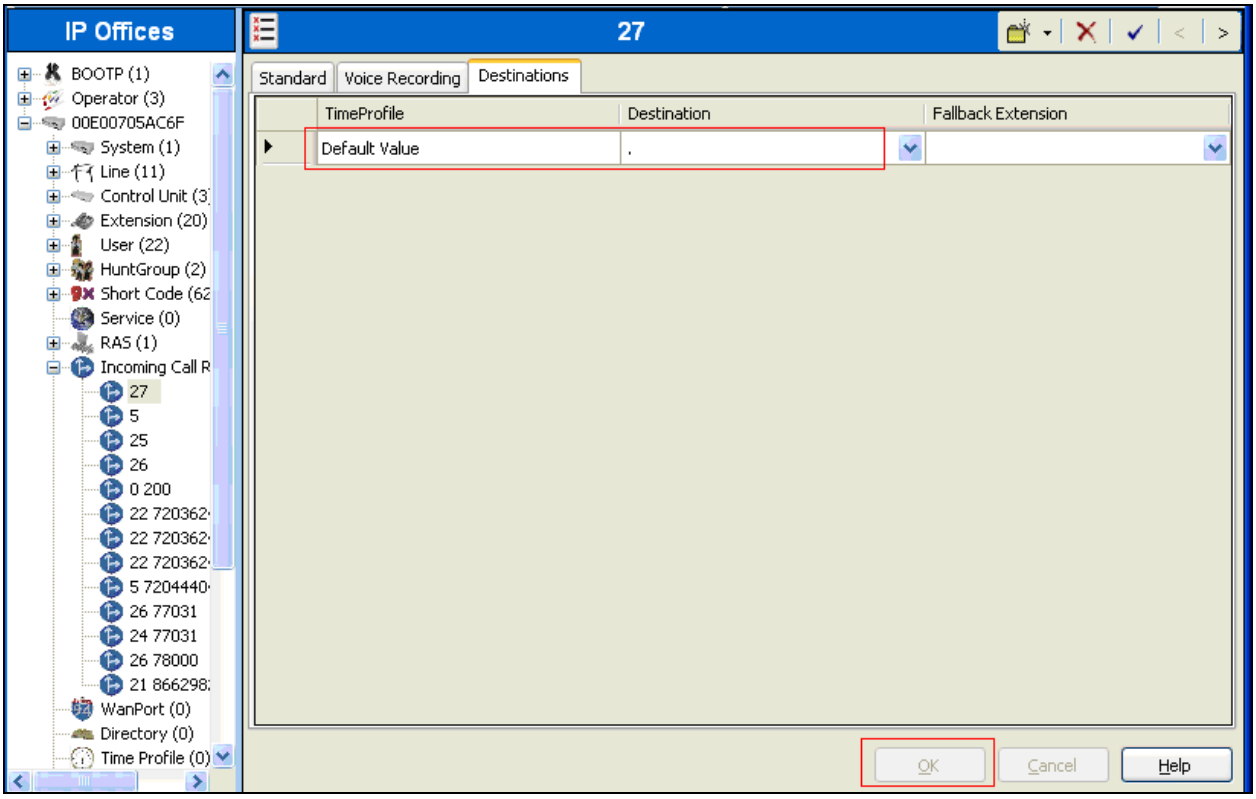

After making the changes, click on the floppy disk icon (not shown) to push the changes to the IP Office system and have them take effect

Note: *Changes will not take effect until this step is completed. This may cause a reboot of Avaya IP Office causing service disruption.*

©2013 Avaya Inc. All Rights Reserved.

6. Configure the Sonexis ConferenceManager

Sonexis installs, configures, and customizes the ConferenceManager application for their end customers. Thus, this section only describes the interface configuration, so that ConferenceManager can talk to Avaya IP Office. By the request of Sonexis, the only codec tested during the compliance test was G.711MU.

The procedures for setting up ConferenceManager for a SIP trunk include the following areas:


- Installing License
- Configure Telephony

6.1. Install SIP Trunk license

Launch an administrative interface on Sonexis system 1 by enter **https://<IP address of ConferenceManager>:8097** in the URL, and log in with the appropriate credentials. Upon initial configuration of the system, enter an appropriate license for multi server SIP trunk in the New License Key field.

Click on the **Apply** button.

Note: During the test, Sonexis provide the licenses for SIP Multi server, SIP, H323 and PRI trunks.

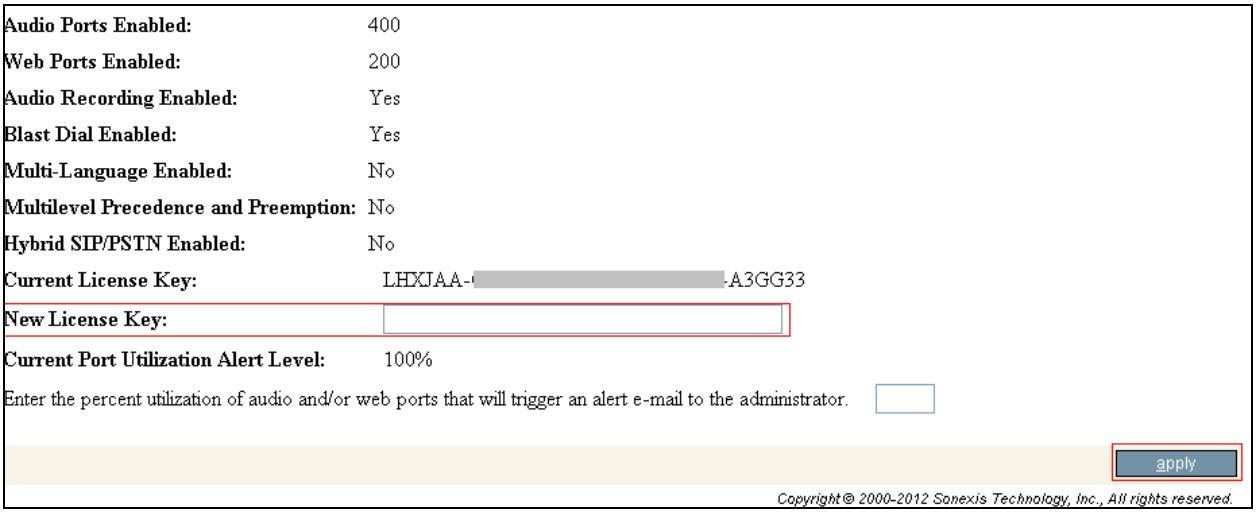


©2013 Avaya Inc. All Rights Reserved.

6.2. Configure Telephony

Launch SIP Advance interface on Sonexis system 1 by enter **https://<IP address of ConferenceManager>:8097/telephony/sipadvanced.asp** in the URL.
Provide the following information:

- **Registration Server IP**: IP of registration server, in this compliance test, it is IP office's IP address.
- **Registration server port**: Typically 5060, will default to 5060 if left blank
- **Registration who**: Extension assigned to Sonexis in dialplan of IP office, it is short code created in **Section 5.7**.
- **Registration password**: if required, password so Sonexis can register, in this test it is left blank.
- **Listen port**: Port that Sonexis will listen on, default is 5060
- **Dialout Gateway**: Sonexis will send invites to this device (IP or Name). In this case it is IP Office's IP address.
- **DTMF payload type**: this is negotiated at call setup, but should be set to match the IP Office setting
- Click on the **restart telephony** button.

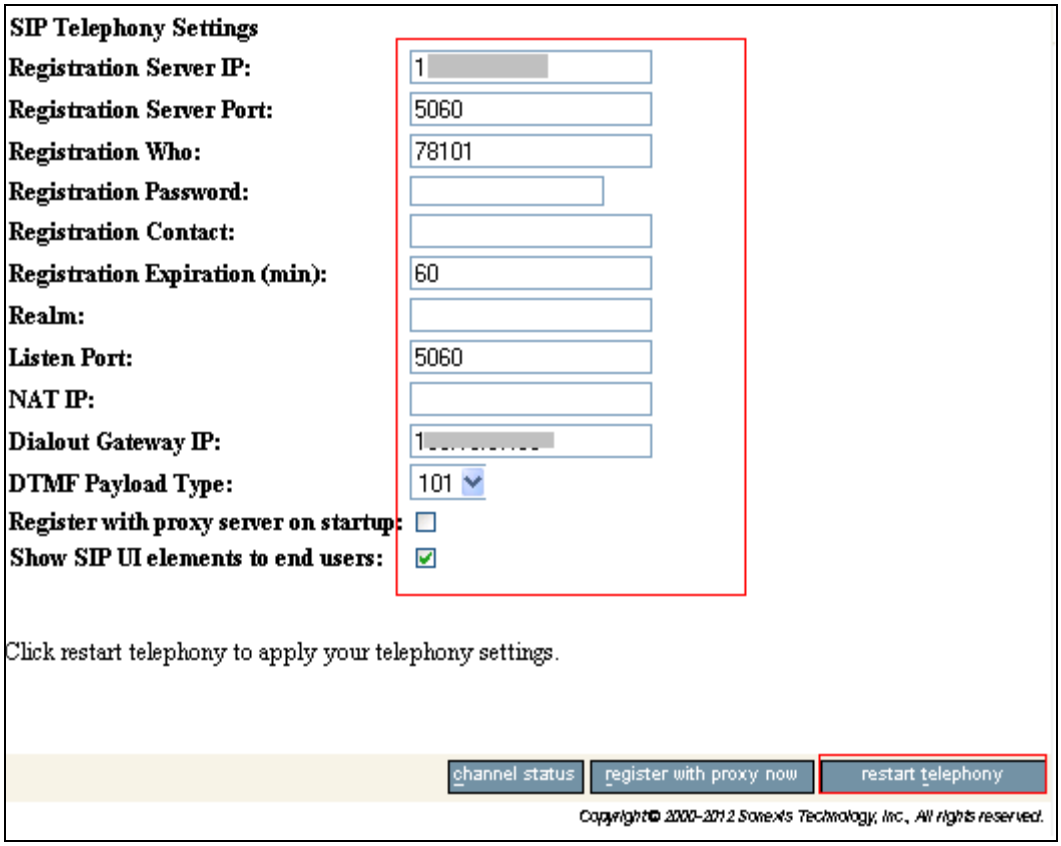

©2013 Avaya Inc. All Rights Reserved.

6.3. Enable dial out service

To enable Dial out service to allow host or participant dial out during conference, by enter **https://<IP address of ConferenceManager>:8097** in the URL, and log in with the appropriate credentials. Select **Conference** tab then select **Class of Service** link, make sure **Allow Dial Out** is set to **Yes.**



7. Verification Steps

This section provides the tests that can be performed to verify proper configuration of Avaya IP Office and ConferenceManager.

7.1. Verify Avaya IP Office

From a PC running the Avaya IP Office Monitor application, select **Start → All Programs → IP Office → System Status** to launch the application. From the **Avaya IP Office System Status** screen, select **Trunks → Line 27** from the left pane and verify the trunk is **Idle** under the **Current State** field.

©2013 Avaya Inc. All Rights Reserved.

8. Conclusion

These Application Notes describe the procedures required to configure Sonexis ConferenceManager to interoperate with Avaya IP Office through a SIP trunk. Sonexis ConferenceManager successfully passed compliance testing.

9. Additional References

The following Avaya product documentation can be found at http://support.avaya.com
[1]*IP Office R8.1 Manager 10.1*, 15-601011 Issue 29o – (03 August 2012)

Sonexis product documentation can be requested at the following site:
http://www.sonexis.com/access/index.asp?id=40&Program=DevConnect

©2013 Avaya Inc. All Rights Reserved.

©2013 Avaya Inc. All Rights Reserved.
Avaya and the Avaya Logo are trademarks of Avaya Inc. All trademarks identified by ® and ™ are registered trademarks or trademarks, respectively, of Avaya Inc. All other trademarks are the property of their respective owners. The information provided in these Application Notes is subject to change without notice. The configurations, technical data, and recommendations provided in these Application Notes are believed to be accurate and dependable, but are presented without express or implied warranty. Users are responsible for their application of any products specified in these Application Notes.

Please e-mail any questions or comments pertaining to these Application Notes along with the full title name and filename, located in the lower right corner, directly to the Avaya DevConnect Program at devconnect@avaya.com.